

Appendix A-3
DRAFT Phase I Environmental Site Assessment
Municipal Parking Lot, Railroad Street and New York Avenue
[Block 1]

EES JV

February 2014

Note: Appendices for this document are available as PDF are located on CD-ROM in back pocket of VDEIS, see title “Appendix A-3 Phase I ESA Block1”

Checklist for Phase I Site Assessments Conducted using EPA Brownfields Assessment Grant Funds

Contact Information

Grantee Name: Town of Huntington, New York

Grant Number: EP-W-11-043

ACRES Property ID: NA

Program Manager Name:
(Point of Contact) Bruce Grant

Contact Phone Number: (631) 351-2881


Name / Address of Property Assessed: Municipal Parking Lot/Railroad Avenue

Checklist

Please indicate that each of the following All Appropriate Inquiries documentation requirements were met for the Phase I assessment conducted at the above listed property:

- An *opinion* as to whether the inquiry has identified conditions indicative of releases or threatened releases of hazardous substances, and as applicable, pollutants and contaminants, petroleum or petroleum products, or controlled substances, on, at, in, or to the subject property.
- An identification of "*significant*" *data gaps* (as defined in §312.10 of AAI final rule and §12.7 of ASTM E1527-05), if any, in the information collected for the inquiry, as well as comments regarding the significance of these data gaps. Significant data gaps including missing and unattainable information that affects the ability of the environmental professional to identify conditions indicative of releases or threatened releases of hazardous substances, and as applicable, pollutants and contaminants, petroleum or petroleum products, or controlled substances, on, at, in, or to the subject property.
- Qualifications and signature* of the environmental professional(s). The environmental professional must place the following statements in the document and sign the document:
 - "[I, We] declare that, to the best of [my, our] professional knowledge and belief, [I, we] meet the definition of Environmental Professional as defined in §312.10 of this part."
 - "[I, We] have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. [I, We] have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312."

Note: Please use either "I" or "We."
- In compliance with §312.31(b) of the AAI final rule and §12.6.1 of ASTM E1527-05, the environmental professional must include in the final report an *opinion regarding additional appropriate investigation*, if the environmental professional has such an opinion.

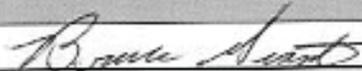

Signature of Grantee Program Manager

3/10/2014

Date



**DRAFT
PHASE I ENVIRONMENTAL SITE
ASSESSMENT**

**Municipal Parking Lot
Railroad Street and New York Avenue
Huntington, New York**

Remedial Action Contract 2 (RAC 2)

U.S. Environmental Protection Agency Region II

Contract EP-W-11-043

Prepared by:

EES JV

a Joint Venture between Sullivan International Group, Inc. and Nobis Engineering, Inc.

February 2014

Revision 0

EES JV



Draft Phase I Environmental Site Assessment

Municipal Parking Lot – Railroad Street and New York Avenue
Huntington, New York
EPA Work Assignment No. 001-SION-0200

Remedial Action Contract 2
No. EP-W-11-043

For:
US Environmental Protection Agency
Region 2

By:
EES JV
a Joint Venture between Sullivan International Group, Inc. and Nobis Engineering, Inc.

Project No. 84001.02

February 2014

Handwritten signature of Stephen Vetere in black ink.

Stephen Vetere, PE, LSP, LEP
Senior Project Manager

Handwritten signature of Jeff Brunelle in black ink.

Jeff Brunelle
Project Geologist



TABLE OF CONTENTS
DRAFT PHASE I ENVIRONMENTAL SITE ASSESSMENT
RAILROAD STREET AND NEW YORK AVENUE
HUNTINGTON, NEW YORK

<u>SECTION</u>	<u>PAGE</u>
1.0 EXECUTIVE SUMMARY.....	1
2.0 INTRODUCTION.....	4
2.1 Purpose.....	4
2.2 Detailed Scope of Services.....	4
2.3 Significant Assumptions.....	5
2.4 Limitations and Exceptions.....	5
2.5 Special Terms and Conditions.....	5
2.6 User Reliance.....	5
2.7 User Obligations.....	6
3.0 SITE DESCRIPTION.....	7
3.1 Location and Legal Description.....	7
3.2 Previous Environmental Investigation.....	7
3.3 Site and Vicinity General Characteristics.....	8
3.4 Current Use of the Site.....	8
3.5 Descriptions of Structures, Roads, or Other Improvements on the Site.....	8
3.6 Current Use of Adjoining Properties.....	9
4.0 USER PROVIDED INFORMATION.....	10
4.1 Title Records.....	10
4.2 Environmental Liens or Activity and Use Restrictions.....	10
4.3 Specialized Knowledge.....	11
4.4 Commonly Known or Reasonably Ascertainable Information.....	11
4.5 Valuation Reduction for Environmental Issues.....	11
4.6 Owner, Property Manager, and Occupant Information.....	11
4.7 Reason for Performing Phase I.....	11
4.8 Other.....	11
5.0 RECORDS REVIEW.....	12
5.1 Standard Environmental Record Sources.....	12
5.1.1 Federal and State Database Search Results.....	13
5.1.1.1 Subject Property.....	13
5.1.1.2 Adjoining Properties.....	14
5.1.1.3 Sites Located Within the Search Radii.....	17
5.1.2 Town of Huntington Municipal Records.....	22
5.2 Physical Setting Sources.....	22
5.3 Historical Use Information on the Site.....	23
5.3.1 Topographic Maps.....	23
5.3.2 Sanborn® Maps.....	23
5.3.3 Aerial Photographs.....	23
5.3.4 City Directories.....	23



TABLE OF CONTENTS (cont.)
DRAFT PHASE I ENVIRONMENTAL SITE ASSESSMENT
RAILROAD STREET AND NEW YORK AVENUE
HUNTINGTON, NEW YORK

<u>SECTION</u>	<u>PAGE</u>
5.3.5	Summary of Historical Site Use..... 23
5.3.6	Historical Use – Adjoining Properties..... 25
6.0	SITE RECONNAISSANCE 27
6.1	Methodology and Limiting Conditions..... 27
6.2	General Site Setting 27
6.3	Exterior Observations 27
6.4	Interior Observations 27
7.0	INTERVIEWS 28
7.1	Interview with Owner 28
7.2	Interview with Site Manager 28
7.3	Interviews with Occupants..... 28
7.4	Interviews with Local Government Officials..... 28
7.5	Interviews with Others 28
8.0	FINDINGS 29
9.0	OPINION 31
10.0	CONCLUSIONS 32
11.0	DEVIATIONS..... 33
12.0	ADDITIONAL SERVICES 34
13.0	REFERENCES..... 35
13.1	Sources Consulted 35
13.2	Agencies Consulted..... 35
14.0	QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS..... 36

FIGURES

- 1 Locus Plan
- 2 Site Sketch



TABLE OF CONTENTS (cont.)
DRAFT PHASE I ENVIRONMENTAL SITE ASSESSMENT
RAILROAD STREET AND NEW YORK AVENUE
HUNTINGTON, NEW YORK

APPENDICES

- A Limitations
- B User Questionnaire
- C Town Provided Information/Assessor's Records
- D EDR Radius Report
- E Historic Topographic Maps, Sanborn Maps, and Aerial Photos
- F Site Inspection Photographs
- G Checklist for Phase I Site Assessments Conducted Using EPA Brownfields Assessment Grant Funds

1.0 EXECUTIVE SUMMARY

Engineering and Environmental Solutions Joint Venture (EES JV) has completed a Phase I Environmental Site Assessment (ESA) for a site located immediately southwest of the New York Avenue/Railroad Street (and Broadway) intersection in Huntington, New York (the subject property). No official street address exists for the subject property; however, the property is located immediately to the east of 2 Railroad Street. Figure 1 depicts the subject property's location.

The subject property is a Town-owned parking lot that serves Long Island Railroad's (LIRR) Huntington Station, which is located southeast of the New York Avenue/Broadway intersection. No structures or buildings exist on the subject property. The subject property is comprised of lots 005.003, 005.005, and a portion of lot 003.000, as identified on tax map 0400-147.00-01.00. The site area totals approximately 2.3 acres.

EES JV reviewed federal and state environmental database records (provided in an Environmental Data Resources® [EDR®] database radius report and records located on the New York State Department of Environmental Conservation [NYSDEC] web page), researched local municipal files, and conducted interviews with Town officials to identify environmental conditions at the subject property.

The subject property was not identified in any of the databases reviewed by EES JV or EDR®; however, incomplete, inaccurate, or ambiguous reporting to federal, state, and local agencies may have limited the accuracy of location-based records listed in these databases. The following database search results are believed to be associated with the subject property:

- Town Parking Lot 22, Route 110 & Railroad Ave - Closed 7/2002
- Spill Number 0204508, New York Ave/Railroad St - Closed 7/2002

Both listings are included in the New York Spills database, and both listings pertain to the same event. According to the 0204508 listing, a tow-behind portable generator leaked approximately 15 gallons of diesel fuel onto the roadway (not the subject property parking lot) and into a nearby storm water catch basin. The Town Parking Lot 22 listing did not include a specific address or coordinates of the spill. Response activities included cleaning the road and removing

approximately 2,000 gallons of a water-and-oil mixture, presumably from the storm drain system. Response actions enabled the spill number to be closed on the same day it was opened.

Huntington Community First Aid Squad is the western abutter of the subject property. This property was listed in the Leaking Storage Tanks (LTANKS), New York Spills, Manifest, RCRA-Non Gen, and FINDS databases. In addition, several sites included in the New York Spills database have ambiguous location information. These spill listings are likely associated with incidents that occurred to the east of the subject property, along New York Avenue and Broadway, at Huntington Station, or at the Highview Condominium site across New York Avenue. These spills are not likely to have occurred adjacent to the subject property. According to EDR®, spill numbers associated with these sites have been closed after appropriate actions mitigated the associated environmental hazards.

Statewide Recycling was formerly located to the south of the railroad tracks and the LIRR parking lot, southeast of the subject property. This site was a former recycling and transfer station for construction and demolition debris, and other historical operations included truck storage and maintenance. This site, located at 1345 New York Avenue, is listed in the NY Spills, SHWS, SWL/LF, Drycleaners, ERP, RGA LF, FINDS, and U.S. Brownfields databases.

EES JV reviewed historical documents dating back to 1903 (Sanborn Maps, aerial photos, topographic maps, city directories, and municipal files) to identify the historic use of the subject property and surrounding area. Potential issues that might be of concern for future development of the subject property include the following:

- A gas station, taxi stand, and auto garages were formerly located in the central portion of the subject property.
- The western portion of the subject property was formerly utilized for coal storage, and the presence of hoppers and coal piles was noted on historic maps.
- Five separate underground storage tanks (USTs) are visible on the 1914, 1930, and 1946 Sanborn maps (with no records of tank removal or closure).
- The western abutter is a former tank farm/oil company and junk yard.

- The Former Long Island Co. sub-station and transfer yard (Statewide Recycling) is located to the south across the railroad tracks.

Based on the findings of the Phase I ESA, EES JV has identified the following recognized environmental conditions (RECs):

- Presence of USTs associated with former operations at the subject property with no records or unavailable records of proper UST removal, closure, or abandonment on file.
- Historical use of the subject property as a taxi stand, car dealership, and gasoline station.
- Historical coal stockpiling on the subject property.

EES JV recommends Phase II investigations, including soil and groundwater sampling, to investigate the RECs identified in this Phase I report.

2.0 INTRODUCTION

The following sections document the purpose of the ESA and provide a detailed scope of services, significant assumptions, limitations and exceptions, special terms and conditions, user reliance, and user obligations.

2.1 Purpose

The objective of this Phase I ESA was to assess environmental conditions at the subject property and vicinity for RECs associated with the presence of petroleum products (PP) or hazardous materials (HM) in conformance with American Society for Testing and Materials (ASTM) E1527-05, "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process". RECs are defined in ASTM Standard Practice E 1527-05 as:

The presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: (1) due to any release to the environment; (2) under conditions indicative of a release to the environment; or (3) under conditions that post a material threat of future release to the environment. De minimis conditions are not recognized environmental conditions.

2.2 Detailed Scope of Services

To meet the objectives of the Phase I, EES JV performed the following tasks.

- Reviewing New York State Department of Environmental Conservation (NYSDEC) and United States Environmental Protection Agency (USEPA) regulatory database listings concerning environmental conditions at and in the vicinity of the subject property, as provided by Environmental Data Resources®, Inc. (EDR®).
- Contacting officials of the Town of Huntington, New York to obtain information pertaining to present and historical environmental conditions at the subject property and adjacent environs.
- Reviewing available history of ownership and land usage records, and the interviewing of persons with knowledge of the subject property to obtain past usage information.

- Reviewing available aerial photographs and topographic maps to aid in assessing local hydrogeology and in assessing past and present land use at the subject property and vicinity.
- Visiting the subject property on January 30, 2014 to assess surficial and general environmental conditions at the property and adjacent environs for evidence of RECs associated with past or present PP or HM waste handling or storage activities.
- Preparing this report summarizing the results of the assessment.

2.3 Significant Assumptions

It is assumed that federal, state, and local records are generally complete and current. The preparer assumes that all individuals contacted and/or interviewed during the preparation of this Phase I ESA have responded in good faith. EES JV is entitled to rely on all information gathered during this scope of work.

2.4 Limitations and Exceptions

Limitations associated with this assessment are noted in Appendix A.

2.5 Special Terms and Conditions

No special terms or conditions apply to this project.

2.6 User Reliance

User reliance is subject to the requirements of 40 CFR Part 312, ASTM E 1527-05, as noted herein.

2.7 User Obligations

As defined in ASTM E 1527-05, the user responsibilities, as applicable, are as follows:

- Identifying the scope of work;
- Deciding whether to use prior assessments;
- Checking title records for environmental liens and activity and use restrictions;
- Disclosing specialized knowledge and experience;
- Explaining why the purchase price is below market value, if it is discounted;
- Answering interview questions in good faith; and
- Providing information as outlined in Section 6 of ASTM E 1527-05, including completing the User Questionnaire attached in Appendix B.

For the purpose of this ESA, the "user" is defined as the Town of Huntington, New York. Bruce Grant, Deputy Director, Huntington Department of Community Development; and Joan Cergol, Director, Huntington Department of Community Development, provided responses to the User Questionnaire that was used to generate the information required under Section 4.0.

3.0 SITE DESCRIPTION

The following section describes the site location, previous environmental investigations performed at the site, general characteristics of the site and immediate vicinity, current use of the site, descriptions of structures, roads other improvements to the site, and current use of adjoining properties.

3.1 Location and Legal Description

The subject property is located immediately southwest of the New York Avenue/Railroad Street (and Broadway) intersection and north of the Long Island Railroad (LIRR) tracks. It is bordered to the west by the Huntington Community First Aid Squad property. Figure 1 depicts the subject property location and boundary.

The subject property is owned by the Town of Huntington and is comprised of lots 005.003, 005.005, and a portion of lot 003.000 (as identified on tax map 0400-147.00-01.00). Lots 005.003 and 005.005 are listed as 1.3 acres and 0.46 acres, respectively. Although lot 003.000 is 4 acres, only approximately 0.54 acres of this lot is included in the subject property; therefore, the total area of the subject property is approximately 2.3 acres.

The subject property is a parking lot for LIRR's Huntington Station (located southeast of the New York Avenue/Broadway intersection). This Phase I is limited to lots 005.003, 005.005, and the portion of lot 003.000 between the LIRR tracks and Railroad Street. The "Townhouse Road North" portion of lot 003.000 is not included as the subject property, and additional LIRR parking areas are not included in this Phase I investigation.

3.2 Previous Environmental Investigation

Available records did not indicate that previous environmental investigations have been performed at the subject property; however, the Town of Huntington provided EES JV with an Environmental Site Profile (ESP) written by Gannett Fleming that was part of a larger report produced under a Brownfields Opportunity Area (BOA) program application previously submitted to the New York Department of State.

The ESP excerpt is a limited, two-page document that included a review of an environmental database report, a short description of subject property history, and a listing of potential environmental concerns. This ESP does not meet the requirements to be considered an ASTM Phase I ESA. A copy of the ESP, along with other records provided by the Town for this assessment, are included in Appendix C.

3.3 Site and Vicinity General Characteristics

The subject property is located in the area of Huntington known as the Columbia Terrace/Huntington Station Downtown Vicinity. Urban Renewal activities conducted as part of the 1967 General Neighborhood Renewal Plan and the 1989 Huntington Station Revitalization Plan demolished old commercial structures and realigned and extended existing roadways in an effort to redevelop and revitalize the downtown area. As part of these urban renewal efforts, the subject property was developed into a parking area for LIRR commuters travelling to New York City via Huntington Station.

Currently, the parking lot is accessed from Railroad Street. Topography slopes gently to the southeast. According to EDR®, the subject property is not located within the 100- or 500-year flood zones or national or state wetlands. No significant surface water bodies are located within 0.25 miles of the subject property.

3.4 Current Use of the Site

The subject property is used as a parking area for the LIRR Huntington Station.

3.5 Descriptions of Structures, Roads, or Other Improvements on the Site

The subject property is a parking lot for the LIRR Huntington Station. The property is accessed via Railroad Street. The subject property is developed with an asphalt parking lot with vegetated areas at the perimeter of the parking area along Railroad Street and adjacent to the LIRR tracks. There are lampposts located throughout the site, providing lighting to the parking lot.

3.6 Current Use of Adjoining Properties

Railroad Street and New York Avenue bound the subject property to the north and east, respectively. The LIRR tracks are adjacent to the south of the subject property, and the Huntington Community First Aid Squad office and ambulance garage abuts the subject property to the west.

Additional commuter rail parking and the Huntington train station are located further south and west across the railroad tracks and New York Avenue. Public housing is located to the north across Railroad Street and Town House Road. Mixed-use properties consisting of residences, automotive repair businesses, and a sawmill are located further to the west.

4.0 USER PROVIDED INFORMATION

The following sections summarize the information provided to EES JV by Bruce Grant and Joan Cergol from the Huntington Department of Community Development. A copy of the user questionnaire is included in Appendix B.

4.1 Title Records

Ownership records dating back to 1899 were obtained from Assessor's office files and the on-line assessor's database. A summary of property ownership information is outlined in the table below.

Lot	Address	Current Owner	Previous Owner	Book/Page
003.000	New York Ave, New York State	New York State, State Office Bldg. Veterans Hwy Hauppauge, NY 11787	Huntington Urban Renewal Agency	18 Sect 146-151
005.003	Railroad Ave, Huntington Station Town of Huntington	Town of Huntington C/O Comptroller 100 Main Street Huntington NY 11743- 6904	Urban Renewal Disposition Parcels 6 and 24	18 Sect 146-151
005.005	New York Ave/RR, Huntington Station Huntington Urban Renewal Agency	Huntington Urban Renewal Agency 100 Main Street Huntington NY 11743- 6904	Long Island Rail Road	18 Sect 146-151

Copies of the Assessor's property record cards for each lot are included in Appendix C.

EES JV did not identify any environmental liens or activity and use limitations (AULs) for the subject property. Environmental liens and AULs were researched via interviews, municipal file reviews, and federal and state database reviews. EES JV did not conduct a title search because this information was readily available via other sources.

4.2 Environmental Liens or Activity and Use Restrictions

The user is not aware of any environmental cleanup liens against the property that are filed or recorded under federal, tribal, state, or local law. The user is not aware of any AULs that are in

place at the site and/or that have been filed or recorded in a registry under federal, tribal, state, or local law.

4.3 Specialized Knowledge

The user does not have any specialized knowledge or experience related to the property or nearby properties.

4.4 Commonly Known or Reasonably Ascertainable Information

The user provided information on past historical uses, which included a car dealership, a gasoline station, a hotel, and coal storage. The user informed EES JV that it is likely that both the car dealership and gasoline station had USTs associated with the businesses, and that it is unclear whether the USTs have been removed.

4.5 Valuation Reduction for Environmental Issues

The user does not expect valuation reduction due to environmental conditions.

4.6 Owner, Property Manager, and Occupant Information

The Town of Huntington owns and manages the subject property. Automobiles from daily commuters occupy the municipal parking lot on a regular basis.

4.7 Reason for Performing Phase I

The Town of Huntington is performing an environmental assessment to satisfy due diligence requirements prior to redevelopment of the subject property. Proposed redevelopment associated with Area Revitalization Initiatives may include the construction of a boutique-type hotel.

4.8 Other

The user does not know of any obvious indicators that point to the presence or likely presence of contamination at the property.

5.0 RECORDS REVIEW

The following sections document the information gathered during review of available environmental records, physical setting sources, and historical site use information.

5.1 Standard Environmental Record Sources

EES JV reviewed federal and state environmental records in the form of an environmental database report provided by EDR®. A copy of the database report is included as Appendix D. EES JV also obtained additional information from other municipal and state records. As per ASTM E1527-05, the databases reviewed, and the search radius for each database, are listed below.

Database List	Search Distance from Subject Property (miles)
Federal, state, and tribal-equivalent National Priority List (NPL)	1
Federal Delisted NPL	0.5
Federal, state, and tribal-equivalent Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS)	0.5
Federal CERCLIS - No Further Remedial Action Planned (CERCLIS - NFRAP)	0.5
Federal Resource Conservation and Recovery Act (RCRA) corrective action (CORRACTS) facilities	1
Federal RCRA non-CORRACTS treatment, storage or disposal (TSD) facilities	0.5
Federal RCRA generators - small quantity (SQG), large quantity (LQG), and conditionally exempt (CESQG)	Site and adjoining
Federal, state, and tribal-equivalent institutional controls/engineering controls (IC/EC) registries	Site and adjoining
Federal Emergency Response Notification System (ERNS)	Site and adjoining
State and tribal Superfund Sites	0.5
State and tribal landfill and/or solid waste disposal sites	0.5
State and tribal leaking storage tanks (LTANKS)	0.5
State and tribal registered storage tanks	Site and adjoining
State and tribal voluntary cleanup sites	0.5
State and tribal Brownfield sites	0.5

5.1.1 Federal and State Database Search Results

Additional information regarding databases searched during this investigation is included in Appendix D. The following is a summary of significant findings from this review.

5.1.1.1 Subject Property

The subject property was not identified in any of the databases reviewed by EES JV or EDR[®]; however, incomplete, inaccurate, or ambiguous reporting to federal, state, and local agencies may have limited the accuracy of location-based records listed in these databases. Identification of records pertaining to the subject property is made even more difficult by the fact that there is no formal address for the subject property. The following database search results are believed to be associated with the subject property:

- Town Parking Lot 22, Route 110 & Railroad Ave – Closed 7/2002
- Spill Number 0204508, New York Ave/Railroad St – Closed 7/2002

The Town of Huntington sometimes refers to the subject property parking lot as "Lot 22". Both of these listings are included in the NY Spills database, and both listings pertain to the same event where a portable compressor or generator fire caused approximately 15 gallons of diesel to be released from equipment fuel lines.

The "Spill Number 0204508" listing is more detailed than the "Town Lot 22" listing. The Town Lot 22 listing references Spill Number 0204508. The Spill Number 0204508 listing indicates that a tow-behind portable generator leaked diesel fuel onto the roadway (not the subject property parking lot) and into a nearby storm water catch basin. Response activities cleaned the road and removed approximately 2,000 gallons of a water-and-oil mixture, presumably from the storm drain system. According to the NYSDEC, corrective action was taken and the spill number (for both listings) was closed on July 30, 2002 (the same day the spill was reported).

It is unclear whether this release actually occurred within the boundaries of the Town lot or if the release was relegated to the roadway; however, response actions listed under Spill Number 0204508 indicate that the release was to the roadway and not to a parking lot. Due to the response actions completed and the closed site status, these listings are unlikely to have an adverse effect on environmental conditions on the subject property.

5.1.1.2

Adjoining Properties

Several adjoining properties were identified in the databases reviewed by EDR®. However, due to uncertainty associated with the mapping of spills, as discussed above, only one of the abutting properties is believed to have been identified in the database search.

The Huntington Community First Aid Squad, located at 2 Railroad Street, abuts the subject property to the west and is listed in the following databases:

- **LTANKS (Leaking Storage Tanks) database** – A tank test failure prompted inclusion on this list. Piping repaired and retest passed. Spill number closed in April 1991.
- **NY Spills database** – Contamination identified during UST removal, 30 tons of contaminated soil were removed in conjunction with removal of a 550-gallon diesel UST. Spill number closed in March 1999.
- **Manifest** – Disposal of 6 containers of "non-listed ignitable wastes" (solvents).
- **RCRA-Non Gen** – Facility formerly generated hazardous waste, but does not currently generate hazardous waste.
- **FINDS** – Indicates inclusion in the RCRA database, but not necessarily any reported spills or releases.

Based on the response actions taken to address documented releases, environmental testing, and the closed site status for the reported releases, releases from the First Aid Squad property are not likely to adversely impact environmental conditions at the subject property.

Ambiguous, incomplete, or inaccurate reporting to federal, state, and local agencies may have caused EDR® to identify sites as immediate subject property abutters when they are not. The following sites were listed in the NY Spills database and plotted on EDR®'s Radius Map immediately adjacent to the subject property along Railroad Street. However, based on data review, the following spill listings are believed to have occurred across New York Avenue adjacent to/at the Huntington Railroad Station or further east along Broadway.

- **Long Island Train Station, South Parking Garage** – Spill number closed November 1998. Approximately 10 gallons of hydraulic oil spilled onto the parking lot when a street sweeper hydraulic line broke. No drainage structures or soil were affected. Ten bags of granular absorbent were used to absorb the spill, and contamination was removed and disposed off-site.
- **Long Island Railroad, E/O Huntington Station** – Spill number closed October 1988. Diesel fuel was released to the environment when a train struck a backhoe and punctured its fuel tanks; 220 yards of contaminated soil was removed from the railroad right-of-way and the Kleet Lumber property; and 500 to 1,000 gallons of oil and water removed from catch basins and nine soil borings were advanced for additional environmental testing. Continued response actions removed contamination and allowed the spill number to be closed.

This site is plotted as an adjoining property by EDR®; however, EES JV does not consider this site as an abutter based on the spill description. This release affected Kleet Lumber, which is located at Park Avenue at the east end of Broadway. Kleet Lumber is not an adjoining property.

- **Unknown Tennis Club, Huntington Railroad Street/Track** – Spill number closed February 1997. A LIRR employee identified an unknown green material located along the railroad right-of-way. The unknown material was identified as material used for tennis courts and was determined to be from the nearby tennis club.

EES JV believes that the location of this spill was plotted incorrectly by EDR® because the tennis club is located at 100 Broadway, across New York Avenue and beyond the Huntington Train Station.

- **Long Island Railroad, Railroad Ave & Route 110** – Spill number closed March 1991. Approximately 10 gallons of fuel oil leaked from a broken pipe in a basement. Granular absorbent was used to clean up the spill and contaminated debris was removed. No drains are present in the basement and no additional response was needed.

EES JV believes that the location of this spill was plotted incorrectly by EDR® because there are no basements located at the subject property.

- **Unknown, New York Ave/Broadway** – Spill number closed December 2003. Stoppage in a sewer line caused the sewer to overflow. The impacted area was cleaned using chlorine. No further response required.
- **All American Oil Corp, NY Ave & Broadway** – Spill number closed December 1988. Ten gallons of No. 2 fuel oil was released to a concrete basement due to a tank overflow. Spill contained by concrete and areas cleaned. No further action required.

During interviews with the Town of Huntington Department of Community Development, Bruce Grant informed EES JV that several unknown USTs were encountered during construction of the Highview Condominiums. Based on data review and interviews, the following spill listings likely occurred to the northeast of the subject property across the New York Avenue/Broadway intersection at the Highview Condominiums site, but were reported by EDR® as having occurred at the subject property or at an adjoining property.

- **Unknown, Route 110 & Broadway** – Spill number closed December 2001. Unknown oil flowed onto ground and into a storm sewer when a UST was struck during construction site activities. Spill cleaned and no further action required.
- **Long Island Railroad, Broadway & Route 110** – Spill number closed March 1999. An unexpected UST was struck during construction/excavation activities and approximately 3 gallons of No. 2 fuel oil were released to the soil. The 980-gallon UST was removed and contaminated soil was collected into a 55-gallon drum and removed from site.
- **Huntington Commuter Garage, NY Ave & Broadway** – Spill number closed June 1994. A UST was punctured during construction activities, releasing approximately 200 gallons of No. 2 fuel oil. The remaining tank contents were removed, along with contaminated soil.

All of the adjoining property sites reported by EDR®, even those not believed to be adjacent properties, are no longer active according to NYSDEC records (i.e., spill numbers have been

closed). Therefore, the adjoining property sites are unlikely to adversely affect the environmental conditions on the subject property.

5.1.1.3

Sites Located Within the Search Radii

Sites identified in the database search that are not the subject property or direct abutters are identified in this section. Only databases with target properties listed within the search radii, as determined by ASTM, are included in the following sections. For a complete listing of database search results, see the EDR® Radius Map Report provided in Appendix D.

Comprehensive Environmental Response, Compensation, and Liability Information System (CERCLIS). CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies, and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites that are proposed either to or on the NPL and sites that are in the screening and assessment phase for possible inclusion on the NPL.

One CERCLIS facility was identified within a ±0.5-mile radius of the subject property.

- **Huntington Town Landfill, Deposit Road.** The Huntington Town Landfill is located 1,322 feet south-southeast and at a lower elevation to the subject property. According to EDR®, assessment activities have been conducted at this site since 1980; however, this site does not qualify for the NPL. Operations and maintenance (O&M) activities are ongoing as of November 2006. The Huntington Town Landfill is not expected to adversely impact environmental conditions at the subject property.

RCRA Conditionally Exempt Small Quality Generators (CESQG). The RCRA database includes selective information on sites that generate, transport, store, treat, and/or dispose of hazardous waste as defined by RCRA. CESQGs generate less than 100 kilograms (kg) of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list (dated September 10, 2013) identified one CESQG within 0.25 miles of the subject property:

- **Huntington Coach, 81 W 4th Street** – Huntington Coach is located 1,105 feet south-southwest and at a lower elevation than the subject property. No violations were listed for this RCRA generator. Huntington Coach is not expected to adversely impact environmental conditions at the subject property.

State Hazardous Waste Sites (SHWS). The SHWS records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the NYSDEC's Inactive Hazardous waste Disposal Sites in New York State.

One SHWS site was identified within 0.25 miles of the subject property:

- **Statewide Recycling, 1345 New York Ave. (address also includes Lilco and Rotundo).** Statewide Recycling is located 667 feet south-southeast and at a lower elevation than the subject property. Now owned by the Town, Statewide Recycling was a former recycling and transfer station for construction and demolition debris. Other historical operations included truck storage and maintenance.

1345 New York Avenue is also listed in the NY Spills, SWL/LF, Drycleaners, ERP, RGA LF, FINDS, and U.S. Brownfields databases. Although not a direct abutter, Statewide Recycling was located to the south of the railroad tracks and LIRR parking lot that border the subject property to the south.

According to the Phase I report excerpt included in the EDR[®] report, semi-volatile organic compounds (SVOCs), pesticides, and metals exist in buried material and debris piles throughout the site. Soil and groundwater contamination have been identified; however, "the nature and extent of on-site contamination does not pose a significant threat to human health and the environment." The groundwater flow direction reported in the Phase I is toward the northwest, away from the subject property. Based on these factors, it is unlikely that contamination from this site will adversely impact environmental conditions at the subject property.

State and Tribal Active Solid Waste Landfills (SWL). The state and tribal SWL database is a listing of solid waste facilities and landfills, which may also include compost facilities, transfer stations, incinerators, and material recovery facilities.

Two SWLs were identified within a 0.5-mile radius of the subject property:

- **Statewide Recycling**, 1345 New York Avenue. Details in SHWS section, above.
- **White Post Wholesale Growers**, 100 Railroad Street. This site is located 2,379 feet southwest and at a lower elevation to the subject property. According to EDR®, this site processes clean construction and demolition debris (asphalt, brick, concrete, rock, soil).

Due to the nature and location of these facilities, neither of these SWL facilities are expected to have an adverse impact on environmental conditions on the subject property.

State and Tribal Leaking Tank (LTANKS) Database. The Leaking Storage Tank Incident Reports (LTANKS) database lists leaking storage tank incidents reported from 4/1/86 through the most recent update (9/25/2013). This database includes both leaking underground and aboveground storage tanks (USTs and ASTs), and inclusion on this lists are due to tank test failures, tank failures, or tank overfills.

Thirteen LTANKS sites were identified within 0.5 miles of the subject property. Unless otherwise noted, sites were included in the LTANKS database due to tank testing failure.

- **Huntington Community First Aid Squad**, 2 Railroad Street – Resolved 4/1991
- **All American Oil Corp**, New York Avenue and Broadway, Tank Overfill, 10 gallons No. 2 oil confined to concrete and cleaned up – Resolved 12/1988
- **Huntington Intermediate**, 155 Lowndes Avenue – Resolved 2/2002
- **Jiffy Lube**, 1297 New York Ave – Resolved 12/1993
- **Bailey Residence**, 86 Columbia Street, tank failure, 275-gallon heating oil tank on its side underneath kitchen. Contaminated soil excavated. DEC states “Cleanup Satisfactory” – Resolved 2/1993
- **NY Telephone Co.**, 50 West 4th Street – Resolved 12/1991
- **Bell Atlantic**, 50 West 4th Street – Resolved 10/1996

- **1419 New York Avenue Association**, 1419 New York Avenue – Resolved 12/2009
- **Mobil**, 984 New York Avenue, 350 cubic yards of contaminated soil removed during tank removal activities – Resolved 12/1989
- **Garden Stewart Corp**, 200 McKay Road – Resolved 3/1995
- **Huntington Housing Authority**, 5 Lowndes Avenue – Resolved 1/1987
- **Huntington Fleet Service**, 114 Railroad Street – Resolved 1/1987

Leaking lines, pumps, or other system components can often cause tank-testing failures. Failed tank tests do not necessarily indicate a release to the environment. Due to the age of the listed leaking tanks, nature of the failures (failed tests), and resolved status of the incidents, these sites are unlikely to adversely impact the subject property.

State and Tribal Registered Storage Tank List. This database lists registered underground and aboveground storage tanks.

Two UST facilities and one AST facility were identified within 1/8 of a mile of the subject property.

- **Huntington Elementary School**, Lowndes Avenue
- **USA 3 Brothers 1 Corp**, 1290 New York Avenue (both UST and AST site), also listed as USA Gas Station

When appropriately maintained and tested, USTs and ASTs pose a limited threat to the environment.

State and Tribal Brownfields Sites/Local Brownfields Sites. The Brownfields and US Brownfields Sites database reports on the major activities and accomplishments of the various Brownfield grant programs. New York has an additional Environmental Restoration Program (ERP), which is a Brownfields fund.

One ERP and one US Brownfields site were identified within 0.25 miles of the subject property:

- **Statewide Recycling**, 1345 New York Avenue (details in SHWS section above)
- **Rotundo**, 1345 New York Avenue – Rotundo and Statewide Recycling appear to be the same facility.

NY Spills. The NY Spills database lists spills reported to NYSDEC. It includes spills active as of April 1, 1986, as well as spills occurring up to the most recent database update (September 25, 2013).

Twenty-one (21) NY Spills sites have been identified within 0.25 miles of the subject property. All NY Spills sites reported by EDR® have achieved a "closed" status. Most of the NY Spills sites are included in other databases searched by EDR®. The following sites were listed in the NY Spills database:

- **Town Parking Lot 22**, Route 110 & Railroad Avenue – Closed 7/2002
- **Spill Number 0204508**, New York Ave/Railroad Street – Closed 7/2002
- **Huntington Community First Aid Squad**, 2 Railroad Street – Closed 3/1999
- **Long Island Railroad**, Railroad Ave & Route 110 – Closed 3/1991
- **Unknown**, Route 110 & Broadway – Closed 12/2001
- **Long Island Railroad**, Broadway & Route 110 – Closed 3/1999
- **Unknown**, New York Avenue/Broadway – Closed 12/2003
- **Huntington Commuter Garage**, New York Avenue/Broadway – Closed 6/1994
- **Unknown**, 5 Railroad Street – Closed (not reported)
- **Long Island Railroad**, E/O Huntington Station – Closed 10/1988
- **Unknown Tennis Club**, Huntington Railroad Street/Track – Closed 2/1997
- **Residence**, 6 Columbia Street – Closed 6/2010
- **Long Island Train Station**, South Parking Garage – Closed 11/1998
- **Dejesus Residence**, 37 Columbia Street – Closed 7/1994
- **Boozer's Pub (formerly)**, 1268 New York Avenue – Closed 7/2011
- **Jiffy Lube**, 1297 New York Avenue – Closed 7/1986
- **Ifo Residence**, 29 Railroad Avenue – Closed 9/2001
- **Unknown**, 1290 New York Avenue – Closed 6/2005
- **Unknown**, 20 Railroad Street, New York Avenue – Closed 12/1999
- **USA Gas Station**, 1290 New York Avenue – 3 Spills closed 12/2000, 11/1998, 1/2010
- **Lilco**, 1345 New York Avenue and DEP – Closed 6/1998

As stated above, all 21 of the listed NY Spills sites have achieved a "closed" status, and therefore, are not believed to have an impact on environmental conditions at the subject property.

5.1.2 Town of Huntington Municipal Records

Huntington's Department of Community Development provided municipal files for review and information via interview for inclusion in this section. A copy of these records are included in Appendix C.

Assessor's Office. Bruce Grant provided EES JV with copies of files in the Assessor's office. In addition, EES JV reviewed Assessor's office files through the Town's website.

Assessor's files indicate that current subject property owners include the New York State Department of Transportation (Lot 003.000), Town of Huntington (Lot 005.003), and Huntington Urban Renewal Agency (Lot 005.005). Former owners are listed as Huntington Urban Renewal Agency (Lot 003.000), Urban Renewal Disposition Parcel 6 and Parcel 24 (Lot 005.003), and Long Island Rail Road (Lot 005.005).

Building permits tied to the Assessor's files indicate that a permit was pulled in 1964 to erect a one-story masonry store on an existing foundation on Lot 003.000. Building permits tied to lot 005.003 indicate a permit was pulled to erect a one-story brick post office in 1947. No building permit information was tied to Lot 005.005.

Fire Prevention Bureau, Health Department, Building Department Other Municipal Files. According to Bruce Grant, all available municipal records were provided to EES JV for review. No additional information is on file with Fire Prevention, the health or building departments, or other municipal offices.

5.2 Physical Setting Sources

The subject property is located at 40.8525°N and 73.4123°W. The site is located at approximately 212 feet above sea level. The subject property slopes gently toward the southeast. Underlying soil is classified as urban land.

5.3 Historical Use Information on the Site

Sources dating back to 1903 helped EES JV determine historical use at the subject property. Historical use information was generated from interviews with Town officials, municipal file review, and the following historical documents.

5.3.1 Topographic Maps

EES JV reviewed historical topographic maps provided by EDR. Maps included the 1903 Northport quadrangle; the 1904 and 1942 Islip quadrangles; and the 1947, 1954, 1967, and 1979 Huntington quadrangles. Copies of topographic maps are included in Appendix E.

5.3.2 Sanborn® Maps

EES JV reviewed Sanborn® maps provided by EDR® dated 1914, 1922, 1930, 1946, and 1968. Copies of Sanborn® maps are included in Appendix E.

5.3.3 Aerial Photographs

EES JV reviewed aerial photographs provided by EDR® dated 1947, 1953, 1957, 1966, 1974, 1976, 1980, 1985, 1994, 2006, 2008, 2009, and 2011. Copies of the aerial photos are included in Appendix E.

5.3.4 City Directories

EES JV reviewed City directories provided by EDR® for New York Avenue dated 1975, 1980, 1985, 1990, 1995, 1999, 2003, 2008, and 2013 and for Railroad Street dated 1990, 1995, 1999, 2003, 2008, and 2013. Copies of the city directories are included in Appendix E.

5.3.5 Summary of Historical Site Use

In 1914, buildings associated with A.S. Pettit & Sons, Inc. Lumber, Coal, and Feed Company extended onto the subject property from the north and west. Between 1914 and the 1930s, subject property buildings included a livery and a hotel located in the center the property; various sheds, warehouses, and barns located along the northern property boundary; and a water tower,

platforms, and bunk houses associated with the railroad tracks to the south. Coal was continually stored in hoppers and in large piles on the west side of the property.

Throughout the 1920s to 1940s, structures were added to the buildings located along the north and west subject property boundaries. Additional railroad buildings were added along the railroad tracks to the south. Materials stored in the sheds and barns changed from livestock, straw, and wagons to lumber, feed, hardware, wallboard, roofing, and wire. Businesses on the property included the Northside Hotel, a barber, a grocery, a carpenter/woodworking shop, a bank, and other stores and offices. Dwellings (residences) were also present on-site.

By 1946, the old livery and hotel buildings had been demolished and were replaced with a gas station, an automobile garage, and a restaurant building. A 1947 building permit on file with the Assessor's office indicated that a post office was under construction. In the 1950s and 1960s, additional buildings constructed in the vicinity of the filling station building housed a taxi stand, the Urban Renewal Office, and the original Huntington Community First Aid Squad office. (First Aid Squad eventually moved off-site to their current location immediately west of the subject property.)

In the late 1960s, the introduction of the 1967 General Neighborhood Renewal Plan began to reshape the area around subject property. Sections of Lowndes Avenue, Columbia Place, Railroad Street, and Broadway were either eliminated or realigned to create the intersections and street layout in use today. Area buildings and structures including the Urban Renewal Office, the old First Aid Squad building, the taxi stand, old A.S. Pettit & Sons buildings, and railroad structures were demolished to make way for a municipal parking lot to service the LIRR train station located to the east of New York Avenue. (The 1974 aerial photo is the first historical document to show the neighborhood realignment.)

Most notably, the review of historical uses on the subject property indicated use and storage of potentially hazardous materials for site operations. Two 100-gallon gasoline tanks (associated with the line of buildings that ran east-west along the northern property boundary) were identified in the northwest portion of the subject property on the 1914 Sanborn map. One additional gasoline tank, associated with the same line of buildings, was observed on the 1930 and 1946 Sanborn maps. Three gasoline tanks associated with the filling station were observed on the 1946 Sanborn

map. In addition, as previously noted, coal was stored in hoppers or in loose piles along the western property boundary.

5.3.6 Historical Use – Adjoining Properties

Based on the review of historical information sources as discussed above, the following section includes the historical use of adjoining properties.

North: The A.S. Pettit & Sons, Inc. Lumber, Coal, and Feed Company operated to the north (what would eventually be across Railroad Street) of the subject property. Other businesses to the north included a bowling alley, banquet hall, assorted stores, and eventually condominiums/co-op.

Historical businesses to the northeast (across New York Avenue) included the Busse Hotel, Northside Cider Mill, Post Office, and assorted stores (butcher, barber, drugs, grocery, restaurants, storage, Doctor's office, etc.). Underground storage tanks associated with an auto garage were identified on the 1922, 1930, 1946 Sanborn maps. The Highview Condominiums are currently at this location.

East: Long Island Railroad Depot and associated parking were historically located to the east, across New York Avenue.

South: Historical businesses to the south, across the railroad tracks, included the Empire Pickle Works of New York. This area would be used for feed and fertilizer storage and would eventually become parking for the LIRR. One UST was identified at this location on the 1947 Sanborn Map.

The Long Island Company Substation and transfer yard, (also identified as Rotundo and Statewide Recycling) is located further south. Eureka/Gerlich's Hotel, assorted stores, auto garages, and residences were historically located to the southeast. M. Concannon – Hay, Grain and Coal was located to the southwest.

West: A junkyard and the Standard Oil Company of New York were located to the west of the subject property. Standard Oil and the neighboring Texas Company used very large oil tanks for gasoline and fuel oil storage at their site. Several truck filling stations, pump houses, and auto

garages were visible on the 1922 and 1930 Sanborn maps. Huntington Welding and Iron Works had replaced Standard Oil by 1946.

A sawmill, motor freight depot, and auto garage are located at this location, further west of the current Huntington Community First Aid Squad building. A.S. Pettit coal storage and warehouses and clothing manufacturing facilities were also located to the west of the subject property.

6.0 SITE RECONNAISSANCE

A site reconnaissance was performed by EES JV on January 30, 2014. Details of the site reconnaissance are provided in the following sections.

6.1 Methodology and Limiting Conditions

Ms. Patty Nichols of EES JV visited the subject property on January 30, 2014 to observe general subject property conditions. General site features are shown on Figure 2. The parking lot was full and snow piles were present at the subject property during the site inspection. Site photographs are provided in Appendix F.

6.2 General Site Setting

The subject property is developed as a Town-owned parking lot for the nearby LIRR Huntington Station, in the downtown area of Huntington, New York. The surrounding area is occupied by the adjacent ambulance garage and the LIRR. The area to the south is largely commercial, with auto repair garages, retail stores, a church, and Huntington community offices. The area to the north, west, and northeast is largely residential, with houses, community housing, and condominiums.

6.3 Exterior Observations

The subject property consists of a paved parking lot and associated landscaped areas along Railroad Street and New York Avenue. EES JV did not observe any groundwater monitoring wells, surficial staining, or any other indication of contamination. EES JV observed one pole-mounted transformer located on a telephone pole along New York Avenue. This transformer appears to be in good condition and it is unknown if the unit contains any oil.

6.4 Interior Observations

Buildings are not present at the subject property. A covered walkway bridge connects the subject property to Huntington Station across New York Avenue. Bridge construction is concrete and steel with glass windows and a metal roof.

7.0 INTERVIEWS

Interviews performed for preparation of this Phase I ESA are provided below.

7.1 Interview with Owner

Details of the Owner interview are included in Section 4.0 and Section 5.1.2.

7.2 Interview with Site Manager

The subject property does not have a site manager because it is developed as a parking lot/business (no site building present).

7.3 Interviews with Occupants

The subject property does not have site occupants because it is developed as a parking lot (no site building/business present).

7.4 Interviews with Local Government Officials

The results of interviews and research at local government offices are discussed in Section 5.1.2.

7.5 Interviews with Others

EES JV did not conduct interviews with other local government officials.

8.0 FINDINGS

EES JV presents the following findings for the Phase I ESA completed for the subject property located southwest of the New York Avenue and Railroad Street intersection in Huntington, New York:

- The subject property is a Town-owned parking lot that serves Long Island Railroad's Huntington Station, which is located southeast of the New York Avenue/Broadway intersection. No buildings exist on the site. A covered walkway bridge connects the subject property to Huntington Station across New York Avenue. The subject property is comprised of lots 005.003, 005.005, and a portion of lot 003.000, as identified on tax map 0400-147.00-01.00. The site area totals approximately 2.3 acres.
- The subject property was not identified in any of the databases reviewed by EES JV or EDR®; however, incomplete, inaccurate, or ambiguous reporting to federal, state, and local agencies may have limited the accuracy of location-based records listed in these databases for the subject property and some adjoining properties.
 - Two spills reports listed in the NY spills database refer to one spill event near the subject property where 15 gallons of diesel were released due to a tow-behind compressor or generator fire. One of the two spill reports refers to Town Parking Lot 22, which is an unofficial name historically used for the subject property. The other report (Spill Number 0204508) indicates that the spill occurred in the roadway. Because the Town Parking Lot 22 report is vague, ambiguous, and references the second spill report, and because the second spill report is more detailed, it is likely that the spill occurred on New York Avenue/Railroad Street and not the subject property. Response actions contained and cleaned the release and allowed the NYDEC spill number to be closed on the same day.
 - Several sites in the NY Spills database with ambiguous location information are likely associated with incidents to the east of the subject property, along New York Avenue and Broadway, or at the LIRR site across New York Avenue. According to EDR®, spill numbers associated with these sites have been closed after appropriate actions cleaned and eliminated associated environmental hazards.

- Several adjoining properties, including Huntington Community First Aid Squad (west), LIRR Huntington Station (east across New York Avenue), Highview Condominiums, and the roadway spills discussed above were listed in environmental databases. In general, spill incidents on file at the NYSDEC for spills occurring at adjoining properties have been closed and are not likely to impact the environmental conditions at the subject property.
- Statewide Recycling was located south of the railroad tracks and LIRR parking lot, southeast of the subject property. This site was a former recycling and transfer station for construction and demolition debris and other historical operations included truck storage and maintenance. This site, located at 1345 New York Avenue, is listed in the NY Spills, SHWS, SWL/LF, Drycleaners, ERP, RGA LF, FINDS, and U.S. Brownfields databases.
- Underground storage tanks were identified in historical documents. EES JV did not identify any information documenting UST removal, closure, or abandonment in place.
- Historical operations at adjoining properties include the A.S. Pettit & Sons, Inc. Lumber, Coal, and Feed Company (north); the LIRR (east); the Long Island Co. Sub Station and transfer yard (south – also identified as Rotundo and Statewide Recycling); and a junkyard, the Standard Oil Company of New York, Texas Co., and Huntington Welding and Iron Works (west).
- Recognized environmental conditions are present at the subject property due to the historical uses of the property and the presence of underground storage tanks, which may still be present on the property.

9.0 OPINION

Based on review of the documentation available for the preparation of this Phase I ESA and the observations made on the property, it is the opinion of the Environmental Professionals who prepared this assessment that the following RECs exist on the subject property:

- Presence of USTs associated with former operations at the subject property with no/unavailable records of proper UST removal, closure, or abandonment on file.
- Historical use of the subject property as a taxi stand, car dealership, and gasoline station.
- Historical coal stockpiling on the subject property.

EES JV recommends Phase II investigations, including soil and groundwater sampling, to investigate the RECs identified in this Phase I report.

10.0 CONCLUSIONS

In accordance with ASTM Practice E 1527-05 requirements, the Environmental Professionals that prepared this Phase I ESA provide the following Statement of Conclusion:

We have performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527 of the subject property located southwest of the intersection of Railroad Street and New York Avenue. Any exceptions to, or deletions from, this practice are described in Section 2.4 and Section 11.0 of this report. This assessment has revealed evidence of historic or current *recognized environmental conditions* in connection with historical use of the property, as well as unavailable closure records for USTs known to exist or formerly exist at the site.

EES JV recommends Phase II investigations, including soil and groundwater sampling, to investigate the RECs identified in this Phase I report.

11.0 DEVIATIONS

No substantive deviations from ASTM E 1527-05 were encountered during performance of this Phase I ESA. Limitations of this Phase I ESA are discussed in Appendix A.

12.0 ADDITIONAL SERVICES

Additional Services are assessments, recommendations, or other details beyond the scope of ASTM Practice E 1527-05. No additional services were performed.

13.0 REFERENCES

13.1 Sources Consulted

- Environmental Data Resources[®], Inc. Environmental Database Report, Inquiry Number 3836178 dated January 23, 2014 and associated historical documents including:
 - Sanborn Fire Insurance Map Report
 - Historic Topographic Maps
 - Historic Aerial Photographs
 - City Directory Report

- Town Of Huntington, New York: <http://www.huntingtonny.gov/>

- New York State Department of Environmental Conservation – Environmental Site Database Search: <http://www.dec.ny.gov/chemical/8437.html>

13.2 Agencies Consulted

Town of Huntington Assessor's Office

Town of Huntington Department of Community Development

14.0 QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS

This section presents the qualifications of the Environmental Professionals that performed the assessment of the subject property. The following attestations are presented to satisfy the requirements of the All Appropriate Inquiries (AAI) Rule (40 CFR Part 312):

We declare that, to the best of our professional knowledge and belief, we meet the definition of Environmental Professional as defined in §312.10 of this part. We have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. We have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

A copy of the Checklist for Phase I Site Assessments Conducted using EPA Brownfields Assessment Grant Funds is provided in Appendix G of this report. This form will be filled out and signed by the grantee upon their review of this document, and included in the final version of this report.

Jeff Brunelle
Project Geologist

Technical lead with over 14 years of experience conducting hazardous building materials inspections, site investigations, and remediation activities at petroleum and other contaminated properties throughout the Northeastern U.S.

Experience includes remedial action oversight; UST/AST removal; contaminated soil removal and management; active and chemical soil and groundwater remediation; drilling and well installation; and groundwater, soil, and other contaminated media sampling.

Inspection experience includes hazardous materials and building surveys (asbestos, regulated materials, radon, mold), as well as oversight of lead, asbestos, and hazardous materials inspection and abatement contractors.

Performed numerous Phase I ESAs and other environmental projects involving research, investigation, and data assessment of historical and current site conditions on current or former residential, commercial, and industrial properties. Investigations have included identification, assessment, and delineation of petroleum and hazardous materials released to the environment or with the potential for release to the environment.

Patricia Nichols, PE
Project Engineer

Project Engineer with over 3 years of experience conducting site investigations and remediation activities at petroleum and other contaminated properties throughout New England. Experience includes UST removal; contaminated soil removal and management; drilling and well installation; and groundwater, soil, and other contaminated media sampling.

Performed several Phase I ESAs and other environmental projects involving research, investigation, and data assessment of historical and current site conditions on current or former residential and commercial properties.

Stephen Vetere, PE, LSP, LEP
Project Manager

Environmental Professional with 15 years of experience providing a variety of environmental engineering services throughout the Northeastern U.S. including site assessment, remediation, long-term monitoring, and five-year reviews.

Manages and performs site assessments, remedial investigations, and risk assessments, and develops remedial action plans. Designs and manages a variety of site remediation programs including contaminated soil excavation, groundwater recovery and treatment systems, *in situ* bioremediation systems, and enhanced natural attenuation remedial systems. Manages long-term monitoring programs at landfills and other closed facilities.

F I G U R E S

Path: \\ms-..._Pack2_Plan_Storage\BAC Work Assignments\84001 Targeted BP Assessments\Huntington Station TBA\05\Figures\1_Huntington_Locus.mxd Date Printed: 2/23/2014



USGS Topographic Map
Huntington, New York
Revised 1979

0 500 1,000 2,000
Feet
1 inch = 2,000 feet



FIGURE 1	
LOCUS MAP HUNTINGTON STATION TBA HUNTINGTON, NEW YORK	
PREPARED BY: JH	CHECKED BY: JB
PROJECT NO: 84001.02	DATE: FEBRUARY 2014

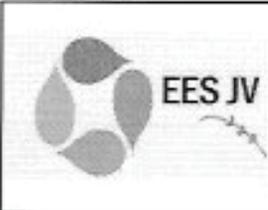
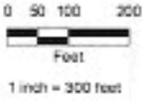
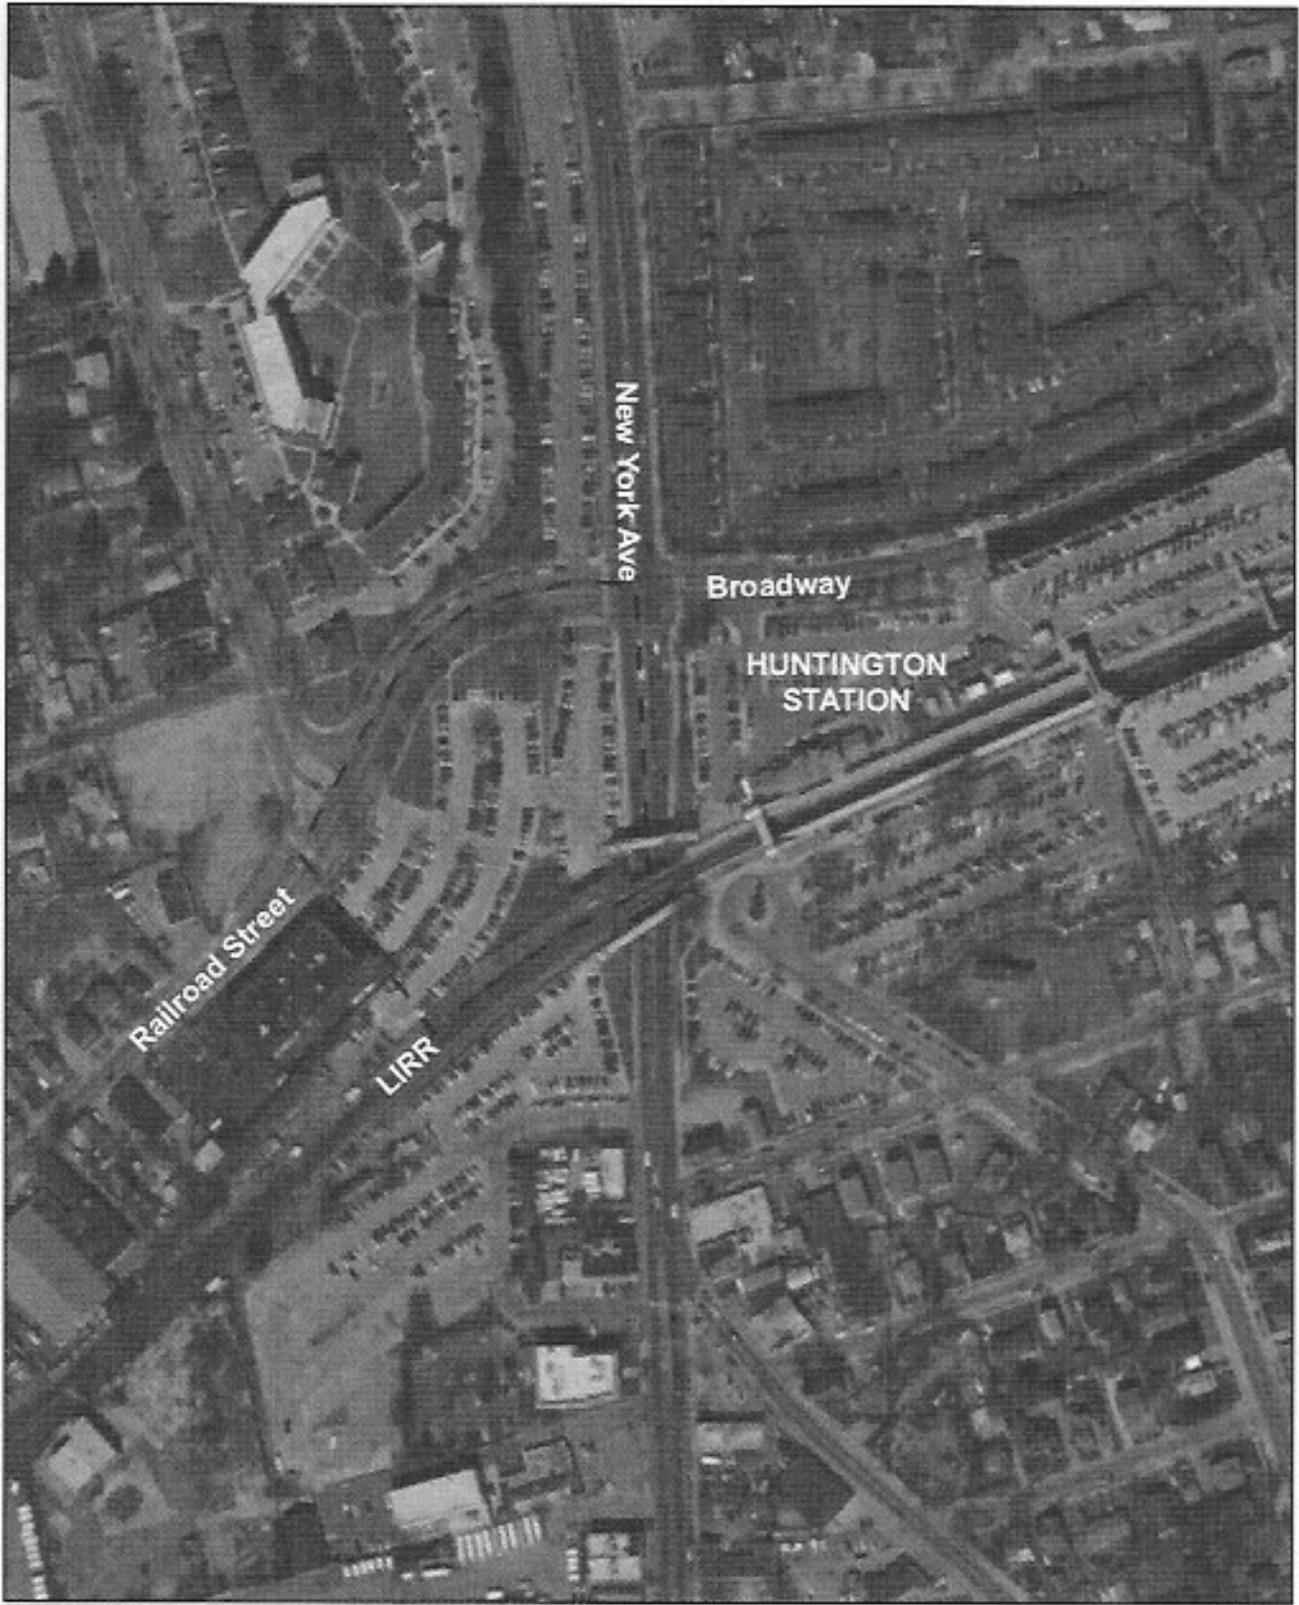


FIGURE 2	
SITE PLAN HUNTINGTON STATION TBA HUNTINGTON, NEW YORK	
PREPARED BY: JH	CHECKED BY: JB
PROJECT NO. 84001.02	DATE: FEBRUARY 2014

A
P
P
E
N
D
I
X

A

LIMITATIONS

- 1) This Environmental Site Assessment was performed in accordance with generally accepted practices of other consultants undertaking similar assessments at the same time and in the same geographical area. The results of this assessment are based on our professional judgment and are not scientific certainties. Specifically, Engineering and Environmental Solutions Joint Venture (EES JV) does not and cannot represent that the site contains no hazardous wastes or other latent conditions beyond those observed during this preliminary assessment. No other warranty, express or implied, is made.
- 2) The observations and conclusions presented in this report were made solely on the basis of conditions described thereon and not on scientific tasks or procedures beyond the scope of described services or the budgetary and time constraints imposed by the client. The work described in this report was performed in general accordance with the terms and conditions described in Work Assignment No. 001-SION-0200; our *Work Plan for Targeted Brownfields Assessments* dated September 21, 2012; and our work assignment dated December 12, 2013. No other warranty, express or implied, is made.
- 3) Observations were made of the site as indicated in this report. The subject property parking lot was full and snow piles were present on-site at the time of the inspection. Where access to portions of the site was unavailable or limited, EES JV renders no opinion as to the presence of hazardous wastes or the presence of indirect evidence of hazardous wastes in those portions of the site.
- 4) No property boundary, site feature, or topographic surveys of the site were performed by EES JV.
- 5) Our services did not include assessments for the presence of pesticides, herbicides, urea-formaldehyde foam insulation (UFFI), or lead in drinking water at the site. In addition, no air quality monitoring or chemical analyses of soil, surface water, or groundwater were performed as part of this assessment. The site was not assessed for compliance with the Clean Air Act. Our services did not include an assessment for typical non-friable asbestos-containing materials such as floor tiles, exterior siding, and roofing materials.
- 6) The purpose of this screen was to preliminarily screen the physical characteristics of the subject site with respect to the presence of hazardous wastes in the environment within the context of ASTM E 1527-05, "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process". No attempt was made to check the compliance of present or past owners of the site with federal, state, or local laws.
- 7) This assessment has been prepared for the exclusive use of the Town of Huntington solely for use in an environmental evaluation of the site. Reliance by others on the information and opinions contained herein is strictly prohibited without prior written consent of EES JV.

A
P
P
E
N
D
I
X

B

ASTM E 1527-13 PHASE I ENVIRONMENTAL SITE ASSESSMENT

USER QUESTIONNAIRE

Section 1 - General

The information requested in this section is intended to assist the environmental professional but is not necessarily required to qualify for use of the Landowner Liability Protections (See Section 2).

(1.) Why is the Phase I Environmental Site Assessment required?

DUE DILIGENCE PRIOR TO PROPERTY REDEVELOPMENT

(2.) What is the type of property and type of property transaction (sale, purchase, exchange, etc.)?

MUNICIPAL PURCHASE W/ FOR LEASE

PROPERTY W/ BE SUB/EXCHANGED FOR REDEVELOPMENT (HOTEL)

(3.) What is the complete and correct address of the property?

NO REAL ADDRESS - PROPERTY LOCATED @ INTERSECTION

"TOWN LOT 22" OF NY AVE ; RA STREET

(4.) What is the scope of services desired for the Phase I?

As described in the contract / work scope. Yes No

If No, please explain.

Are any considerations beyond the requirements of Practice E 1527 to be addressed?

Yes No

If Yes, please explain.

(5.) Please identify all parties who will rely on the Phase I report.

TOWN OF HUNTINGTON, NY

(6.) Please identify the title contact and how the title contact can be reached.

BRUCE GRANT
DEPUTY DIRECTOR
HUNTINGTON DEPARTMENT OF COMMUNITY
DEVELOPMENT

(7.) Are there any special terms and conditions that must be agreed upon by the environmental professional?

No

(8.) Do you have any knowledge or experience with the property that may be pertinent to the environmental professional (i.e. environmental reports, documents, correspondence, etc. concerning the environmental condition of the property). Attach additional notes if required.

'ENVIRONMENTAL SITE REPORT' PROVIDED BY GARRETT FLEMING PROVIDED TO NOBIS. ESP GENERATED AS PART OF A BOA GRANT

(9.) Does the user intend to retain a title professional to review records accessible title and judicial records for environmental liens or activity and use limitations (AULs)?

Yes No THROUGH THIS PHASE 1

If Yes, will the results of the review be provided to the environmental professional?

Yes No

Section 2 - Landowner Liability Protections

In order to qualify for one of the Landowner Liability Protections (LLPs) offered by the Small Business Liability Relief and Brownefields Revitalization Act of 2001 (the "Brownefields Amendments"), the user must provide the following information (if available) to the environmental professional. Failure to provide this information could result in a determination that "all appropriate inquiry" is not complete.

(1.) Environmental cleanup liens that are filed or recorded against the site (40 CFR 312.25).

Are you aware of any environmental cleanup liens against the property that are filed or recorded under federal, state, or local law?

No

1. Landowner Liability Protections, or LLPs, is the user used to describe the date type of personal defense to Supplemental Liability in FPA's Manual Guidance Regarding Certain Landowner Must Meet in Order to Qualify for Such Protection. Copyright Property Owners of National Landowner Liability on CERCLA Liability ("Common Sense" Guide) issued on March 8, 2003.

(2.) Activity and land use limitations that are in place on the site or that have been filed or recorded in a registry (40 CFR 312.26).

Are you aware of any ALEs, such as engineering controls, land use restrictions or institutional controls that are in place at the site and/or have been filed or recorded in a registry under federal, tribal, state or local law?

No

(3.) Specialized knowledge or experience of the person seeking to qualify for the LUP (40 CFR 312.28).

As the user of this ESA, do you have any specialized knowledge or experience related to the property or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the property or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business? If "yes", please explain.

No

(4.) Relationship of the purchase price to the fair market value of the property if it were not contaminated (40 CFR 312.29).

Does the purchase price being paid for this property reasonably reflect the fair market value of the property? If you conclude that there is a difference, how you considered whether the lower purchase price is because contamination is known or believed to be present at the property?

Yes

(5.) Commonly known or reasonably ascertainable information about the property (40 CFR 312.30).

Are you aware of commonly known or reasonably ascertainable information about the property that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example, as user,

(a.) Do you know the past uses of the property?

YES - CAR OWNERSHIP
HOTEL
COMM STRUCTURE

(b.) Do you know of specific chemicals that are present or once were present at the property?

GASOLINE

COAL

UNK MAINTENANCE PRODUCTS (OIL, FUEL, GREASE, ETC.)

(c.) Do you know of spills or other chemical releases that have taken place at the property?

No

(d.) Do you know of any environmental cleanup that have taken place at the property?

No

(6.) The degree of effectiveness of the presence of likely presence of contamination at the property, and the ability to detect the contamination by appropriate investigation (40 CFR 312.31).

As the user of this ESA, based on your knowledge and experience related to the property are there any obvious indicators that point to the presence or likely presence of contamination at the property?

No

POSSIBLE PAST USES?

User Signature

I have answered the above questions in good faith and based on my knowledge of the property.

Printed Name BRUCE GRANT Title DEPUTY DIRECTOR

Signature VIA ABOVE IMPRESSION Date 1/16/14

N/A

Question	Yes	No	NA	Comments if applicable	Environmental description
16. Has the owner or occupier of the property been notified of the requirements or environmental conditions with respect to the property if the facility located on the property?	Yes	<input checked="" type="radio"/>	No		
17. Does the owner or occupier of the property have any knowledge of any environmental site assessment of the property or facility that indicated the presence of hazardous substances or petroleum products on, or contamination of, the property or environmental site assessment of the property?	Yes	<input checked="" type="radio"/>	No		
18. Has the owner or occupier of the property been notified, personally, or pending results of subsequent proceedings concerning a release or threatened release of any hazardous substance or petroleum product involving the property by an owner or occupier of the property?	Yes	<input checked="" type="radio"/>	No		
19. Does the property have any environmental (not including wetlands) made or state water table or adjacent to the property and/or has a storm water system?	Yes	<input checked="" type="radio"/>	No		
20. Does the property have any wetlands made or state water table or adjacent to the property and/or has a storm water system?	Yes	<input checked="" type="radio"/>	No		
21. Has any release occurred or do you have any information that any release of hazardous substances, petroleum products, or other waste materials, toxic substances or pollutants, or any other waste materials have been dumped above ground, buried and/or stored on the property?	Yes	<input checked="" type="radio"/>	No		
22. Is there a determination, approval or any regulatory requirement or other state or any federal regarding the presence of PCBs?	Yes	<input checked="" type="radio"/>	No		

The major questionnaires completed were 150-01 and 150-02/03/04/05/06/07/08/09/10/11/12/13/14/15/16/17/18/19/20/21/22/23/24/25/26/27/28/29/30/31/32/33/34/35/36/37/38/39/40/41/42/43/44/45/46/47/48/49/50/51/52/53/54/55/56/57/58/59/60/61/62/63/64/65/66/67/68/69/70/71/72/73/74/75/76/77/78/79/80/81/82/83/84/85/86/87/88/89/90/91/92/93/94/95/96/97/98/99/100/101/102/103/104/105/106/107/108/109/110/111/112/113/114/115/116/117/118/119/120/121/122/123/124/125/126/127/128/129/130/131/132/133/134/135/136/137/138/139/140/141/142/143/144/145/146/147/148/149/150/151/152/153/154/155/156/157/158/159/160/161/162/163/164/165/166/167/168/169/170/171/172/173/174/175/176/177/178/179/180/181/182/183/184/185/186/187/188/189/190/191/192/193/194/195/196/197/198/199/200/201/202/203/204/205/206/207/208/209/210/211/212/213/214/215/216/217/218/219/220/221/222/223/224/225/226/227/228/229/230/231/232/233/234/235/236/237/238/239/240/241/242/243/244/245/246/247/248/249/250/251/252/253/254/255/256/257/258/259/260/261/262/263/264/265/266/267/268/269/270/271/272/273/274/275/276/277/278/279/280/281/282/283/284/285/286/287/288/289/290/291/292/293/294/295/296/297/298/299/300/301/302/303/304/305/306/307/308/309/310/311/312/313/314/315/316/317/318/319/320/321/322/323/324/325/326/327/328/329/330/331/332/333/334/335/336/337/338/339/340/341/342/343/344/345/346/347/348/349/350/351/352/353/354/355/356/357/358/359/360/361/362/363/364/365/366/367/368/369/370/371/372/373/374/375/376/377/378/379/380/381/382/383/384/385/386/387/388/389/390/391/392/393/394/395/396/397/398/399/400/401/402/403/404/405/406/407/408/409/410/411/412/413/414/415/416/417/418/419/420/421/422/423/424/425/426/427/428/429/430/431/432/433/434/435/436/437/438/439/440/441/442/443/444/445/446/447/448/449/450/451/452/453/454/455/456/457/458/459/460/461/462/463/464/465/466/467/468/469/470/471/472/473/474/475/476/477/478/479/480/481/482/483/484/485/486/487/488/489/490/491/492/493/494/495/496/497/498/499/500/501/502/503/504/505/506/507/508/509/510/511/512/513/514/515/516/517/518/519/520/521/522/523/524/525/526/527/528/529/530/531/532/533/534/535/536/537/538/539/540/541/542/543/544/545/546/547/548/549/550/551/552/553/554/555/556/557/558/559/560/561/562/563/564/565/566/567/568/569/570/571/572/573/574/575/576/577/578/579/580/581/582/583/584/585/586/587/588/589/590/591/592/593/594/595/596/597/598/599/600/601/602/603/604/605/606/607/608/609/610/611/612/613/614/615/616/617/618/619/620/621/622/623/624/625/626/627/628/629/630/631/632/633/634/635/636/637/638/639/640/641/642/643/644/645/646/647/648/649/650/651/652/653/654/655/656/657/658/659/660/661/662/663/664/665/666/667/668/669/670/671/672/673/674/675/676/677/678/679/680/681/682/683/684/685/686/687/688/689/690/691/692/693/694/695/696/697/698/699/700/701/702/703/704/705/706/707/708/709/710/711/712/713/714/715/716/717/718/719/720/721/722/723/724/725/726/727/728/729/730/731/732/733/734/735/736/737/738/739/740/741/742/743/744/745/746/747/748/749/750/751/752/753/754/755/756/757/758/759/760/761/762/763/764/765/766/767/768/769/770/771/772/773/774/775/776/777/778/779/780/781/782/783/784/785/786/787/788/789/790/791/792/793/794/795/796/797/798/799/800/801/802/803/804/805/806/807/808/809/810/811/812/813/814/815/816/817/818/819/820/821/822/823/824/825/826/827/828/829/830/831/832/833/834/835/836/837/838/839/840/841/842/843/844/845/846/847/848/849/850/851/852/853/854/855/856/857/858/859/860/861/862/863/864/865/866/867/868/869/870/871/872/873/874/875/876/877/878/879/880/881/882/883/884/885/886/887/888/889/890/891/892/893/894/895/896/897/898/899/900/901/902/903/904/905/906/907/908/909/910/911/912/913/914/915/916/917/918/919/920/921/922/923/924/925/926/927/928/929/930/931/932/933/934/935/936/937/938/939/940/941/942/943/944/945/946/947/948/949/950/951/952/953/954/955/956/957/958/959/960/961/962/963/964/965/966/967/968/969/970/971/972/973/974/975/976/977/978/979/980/981/982/983/984/985/986/987/988/989/990/991/992/993/994/995/996/997/998/999/1000

Name: BRUCE GRANT / JOAN CERVAL
 Title: DIRECTORS
 Company: HUNTINGTON DEPT. OF COMMUNITY DEVEL
 Address: HUNTINGTON, NY
 Date: 1/16/14
 Number of years at the site: Community Devel.
 Relationship to use (for example, principal, employee, agent, consultant): PRINCIPAL

Name: SAME AS OWNER
 Title: TOWN OF HUNTINGTON, NY
 Date: 1/16/14
 Number of years at the site: DIRECTORS
 Relationship to use (for example, principal, employee, agent, consultant): PRINCIPAL

A
P
P
E
N
D
I
X
C

1000	TENS		UNIT		BLOCK NUMBER		UNITS		HUNDREDS		TENS		UNITS		LOT NUMBER	
			SEC		V 171										0514080	
	NAME OF MAP		New York Ave		LOCATION		HUNTINGTON STATION		BLOCK							
	MAP A		ALLISON E. LOWNDES						MAP NO.		15					
	NAME OF OWNER		NEW YORK STATE		MAP NO.		15		FILED		JULY 15, 1899					
	DEPARTMENT OF TRANSPORTATION				SECTION		0400-147-01-003									
	SCHOOL DISTRICT		3		LOT NUMBERS		EAST 85' of lots 36 to 43 & 67 R. p.c.								FR-3M	
	Map 400 Parcels 435/436 Rec. 8/15/72		ACREAGE 4		CODE 104		FULL VALUE OF LAND ONLY 6000		AMOUNT OF EXEMPTION 6000		ELIGIBLE LAND LESS EXEMPTION		APPORTIONMENTS			
	FORMER OWNER		Huntington Urban Renewal Agency													
	LIGHT DISTRICT NO.		1 2		WATER DISTRICT NO.				SEWER DIST. NO.		1 2 3 4		FIRE DIST. NO.		653 012100	
	BOARD OF ASSESSORS				TOWN OF HUNTINGTON								NEW YORK			
	ON LIGHT DISTRICT NO.				ON WATER DISTRICT NO.				ON SEWER DIST. NO.				ON FIRE DIST. NO.			

Proposed by Arc Wideman

Town of Huntington
 Tax Map # 0400-147.00-01.00-003.000
 Parcel Id 28824
 NEW YORK AVE
 NEW YORK STATE Since Mar 1900
 STATE OFFICE BLDG
 VETERANS HWY
 HAUPPAUGE, NY 11787

Class	653 Parking Lots:	Roll Section	8 Wholly Exempt
Book No	18 Sect 146-151	Property Type	9 Exempt
Nbhd	90041 90041	School District	472603 Huntington
Zoning	r3m R3M	Zoning2	r3m R3M
Zoning3	r3m R3M	Tax Code	125 Tax District - 125
Size Total	4 Acres		
FY	2013	L M B	
		Method Use	C.A.M.A.
		Appr. Value	\$309,278

Mail Index (TAX)

Name/Address	Type Owner	Loan Number	Active/Inact. Active	From	Until
NEW YORK STATE STATE OFFICE BLDG VETERANS HWY HAUPPAUGE, NY 11787					

Tax Assessment

CURRENT YEAR INFO 2013

Land Value	Improvements	Total Value	Tax Rate	True Taxes	Total Taxes
\$6,000		\$6,000		\$0.00	

PRIOR YEAR INFO 2012

Land Value	Improvements	Total Value	Total Taxes
\$6,000	\$0	\$6,000	\$0.00

Tax Levy Maintenance

Levy No	Levy Desc	Levy Type	Exemptions	Taxable Val.	Tax Rate	Taxes
sc003	School Dist - Huntington	School District	6,000		0	
ld003	Library Dist - Huntington	Library District	6,000		0	
d006	County	County District	6,000		0	
d008	County Police District	Police District	6,000		0	
d096	Out of County Tuition	Town District	6,000		0	
d007	Town/Pt. Town	Town District	6,000		0	
d009	Highway Tax	Highway	6,000		0	
d020	Lighting Dist. - Town Wide	Light District	6,000		0	
d005	NYS Real Property Tax Law	County District	6,000		0	
d022	Open Space Bonds II & III	Open Space	6,000		0	
d023	New York State MTA Tax	County District	6,000		0	
gd018	Refuse District	Special District			0	
d016	Fd - Huntington Manor	Fire District	6,000		0	
d091	Ambulance Dist - Hunt	Ambulance District	6,000		0	

TOTAL

Tax Exemptions

Exempt No	Exempt Desc	Start Date	End Date	Amount	Tax Rate	Net Amount
40026	N.Y.S. - Generally			\$6,000	100.00	\$0.00

Town of Huntington
 Tax Map # 0400-147.00-01.00-003.000
 Parcel Id 28824
 NEW YORK AVE
 NEW YORK STATE Since Mar 1900
 STATE OFFICE BLDG
 VETERANS HWY
 HAUPPAUGE, NY 11787

Class	653 Parking Lots:	Roll Section	8 Wholly Exempt
Book No	18 Sect 146-151	Property Type	9 Exempt
Nbhd	90041 90041	School District	472603 Huntington
Zoning	r3m R3M	Zoning2	r3m R3M
Zoning3	r3m R3M	Tax Code	125 Tax District - 125
Size Total	4 Acres		
FY	2013		
L M B		Method Use	CAMA,
		Appr. Value	\$309,278

Multimedia Information

Description
 LanDisk Images

Sub Code

Entry Date
 2/19/2000

Bldg Permits

Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred Data	A19500000930 1/1/1950	001027 1/1/1950			
	Purpose New History Appl New New History Phase New History Unit				
Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred Data	A19550001787 1/1/1955	001237 1/1/1955			
	Purpose Demo History Appl Demo Demo History Phase Demo History Unit				
Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred Data	A19580001153 1/1/1958	004062 1/1/1958			
	Purpose Add History Appl Add Add History Phase Add History Unit				
Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred Data	A19580001154 1/1/1958	004588 1/1/1958			
	Purpose Alt History Appl Alt Alt History Phase Alt History Unit				
Type	Application	Permit	Certificate	Estimated Cost	Total Fee

Town of Huntington
 Tax Map # 0400-147.00-01.00-003.000
 Parcel Id 28824
 NEW YORK AVE
 NEW YORK STATE Since Mar 1900
 STATE OFFICE BLDG
 VETERANS HWY
 HAUPPAUGE, NY 11787

Class	653 Parking Lots:	Roll Section	8 Wholly Exempt
Book No	18 Sect 146-151	Property Type	9 Exempt
Nbhd	90041 90041	School District	472603 Huntington
Zoning	r3m R3M	Zoning2	r3m R3M
Zoning3	r3m R3M	Tax Code	125 Tax District - 125
Size Total	4 Acres		
FY	2013		

L M B

Method Use
 Appr. Value
 C.A.M.A.
 \$309,276

Transferred Date	A19620001056	005752			
	1/1/1962	1/1/1962			

Purpose
 Demo History Appl Demo
 Demo History Phase
 Demo History Unit

Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred Date	A19450000277	006098			
	1/1/1945	1/1/1945			

Purpose
 Alt History Appl/Alt
 Alt History Phase
 Alt History Unit

Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred Date	A19620001057	006123			
	1/1/1962	1/1/1962			

Purpose
 New History Appl New
 New History Phase
 New History Unit

Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred Date	A19620001058	006246			
	1/1/1962	1/1/1962			

Purpose
 Fire History Appl Fire
 Fire History Phase
 Fire History Unit

Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred Date	A19460000670	006341			
	1/1/1946	1/1/1946			

Purpose
 Alt History Appl/Alt
 Alt History Phase
 Alt History Unit

Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred Date	A19620001059	009442			

Town of Huntington
 Tax Map # 0400-147.00-01.00-003.000
 Parcel Id 28824
 NEW YORK AVE
 NEW YORK STATE Since Mar 1900
 STATE OFFICE BLDG
 VETERANS HWY
 HAUPPAUGE, NY 11787

Class	653 Parking Lots:	Roll Section	8 Wholly Exempt
Book No	18 Sect 146-151	Property Type	9 Exempt
Nbhd	900-41 900-41	School District	472803 Huntington
Zoning	r3m R3M	Zoning2	r3m R3M
Zoning3	r3m R3M	Tax Code	125 Tax District - 125
Size Total	4 Acres		
FY	2013		

L M B

Method Use
 Appr. Value C.A.M.A.
 \$309,278

1/1/1962 1/1/1962

Purpose
 Demo History Appl Demo
 Demo History Phase
 Demo History Unit

Type Transferred	Application Date	Permit	Certificate	Estimated Cost	Total Fee
	A19530001491 1/1/1953	018859 1/1/1953			

Purpose
 Demo History Appl Demo
 Demo History Phase
 Demo History Unit

Type Transferred	Application Date	Permit	Certificate	Estimated Cost	Total Fee
	A1964 1/1/1964	011173 5/24/1964	026173 2/5/1965		

Purpose
 Erect 1 Story Masonry Store On Existing Foundation 24' X 85'

Activities	Started Date	Completion On	Status	Ref #
Certificate of Occupancy - Conv	2/5/1965		Certificate of Occupancy - Conv	400

Type Transferred	Application Date	Permit	Certificate	Estimated Cost	Total Fee
	A19530001490 1/1/1953	000950 7/15/1953	EXPIRED	\$1,500.00	\$0.00

Purpose
 Install New Store Front
 New History Appl New
 New History Phase
 New History Unit

Type Transferred	Application Date	Permit	Certificate	Estimated Cost	Total Fee
	A19460000351 1/1/1946	006415 2/27/1946	expired		

Purpose
 Change Existing Store Front & Remove Partition After Steel Beam Is Erected

Misc. Structure Info.


Muse Grade	Price	Units Yr. Built, Act	DT	Dpr %	Condition	Overall Adj.	Final Adj.	Value
------------	-------	----------------------	----	-------	-----------	--------------	------------	-------

Town of Huntington
 Tax Map # 0400-147.00-01.00-003.000
 Parcel Id 28824
 NEW YORK AVE
 NEW YORK STATE Since Mar 1900
 STATE OFFICE BLDG
 VETERANS HWY
 HAUPPAUGE, NY 11787

Class	653 Parking Lots	Roll Section	8 Wholly Exempt
Book No	18 Sect 146-151	Property Type	9 Exempt
Nbhd	90041 90041	School District	472603 Huntington
Zoning	r3m R3M	Zoning2	r3m R3M
Zoning3	r3m R3M	Tax Code	125 Tax District - 125
Size Total	4 Acres	Method Use	CAMA
FY	2013	Appr. Value	\$309,270

L M B

MULTIMEDIA IMAGING

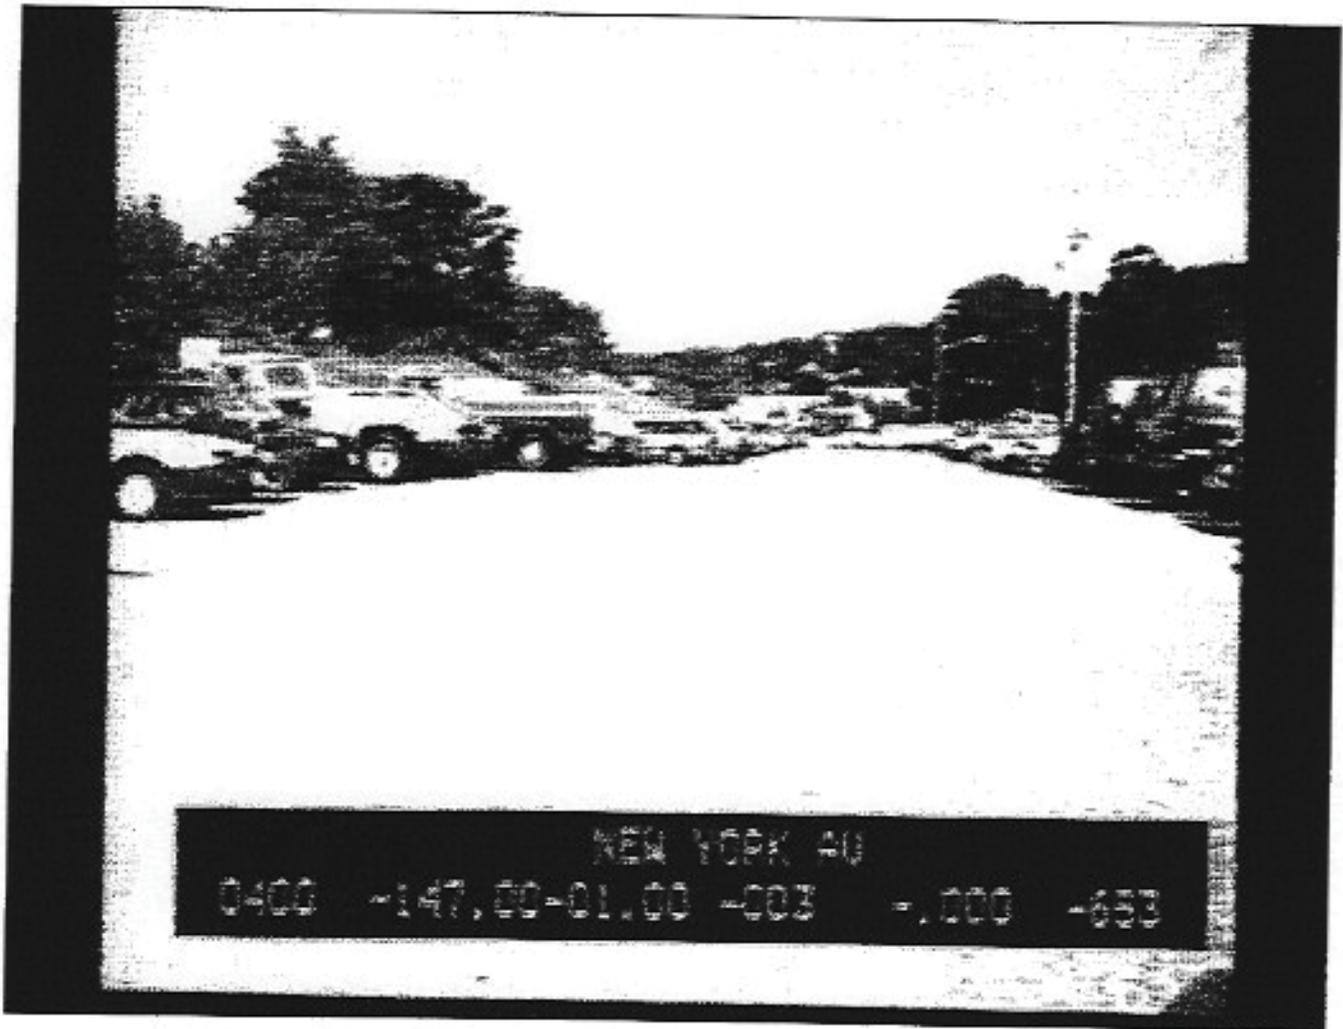

1	7		4		2		1		7		4		2		1		7		4		2		1												
THOUSANDS										HUNDREDS										TENS				UNITS											
Railroad Ave. SEC VIII										ALPHABETICAL NAME CODE										505-11				A-B											
NAME OF OWNER TOWN OF HUNTINGTON										LOCATION HUNTINGTON STATION										SCHOOL DIST NO 3				ASSESSMENT CHANGES											
<i>1/2 Confrontment</i>										NAME CODE NUMBER																									
<i>100 Main St</i>																																			
<i>Huntington NY 11742</i>																																			
DESCRIPTION										0400-147-01-005,003																									
NORTH RAILROAD STREET																																			
EAST NEW YORK AVENUE																																			
SOUTH MTA																				C-6 zone															
WEST TOWN OF HUNTINGTON																																			
ACREAGE										CODE										FULL VALUE OF LAND ONLY				AMOUNT OF EXEMPTION				TAXES & LAND LESS EXEMPTION				APPORTIONMENTS			
1.346										104										1300				1300				1300							
FORMER OWNER										URBAN RENEWAL DISPOSITION PARCELS 6 and 24																									
<i>Pol 6 - Line 7626 Page 236</i>										<i>Pol 24 - Line 7626 Page 236</i>										<i>5/13/74</i>															
LIGHT DISTRICT NO.										WATER DISTRICT NO.										SEWER DIST. NO.				FIRE DIST. NO.											
1 2																				1 2 3 4				653				0.13500							
BOARD OF ASSESSORS										TOWN OF HUNTINGTON										NEW YORK															
ON LIGHTING DIST										ON WATER DIST										ON SEWER DIST				ON FIRE DIST											
1 2 3 4 5 6 7 8 9 10 11 12										1 2 3 4 5 6 7 8 9 10 11 12										1 2 3 4				1 2 3 4 5 6 7 8 9 10 11 12											

954 - Pol 6
 392 - Pol 24
 1.346

Prior to this parcel was known as
 147-1-32. Included online
 147-1-32. Parcels were retired
 & combined & are now known as
 147-1-32. (See lot 15(27) to)

Town of Huntington
 Tax Map # 0400-147.00-01.00-005.003
 Parcel Id 28826
 RAILROAD AVE, HUNTINGTON STATION
 TOWN OF HUNTINGTON Since Mar 1900
 C/O COMPTROLLER
 100 MAIN ST
 HUNTINGTON NY 11743-6904

Class	653 Parking Lots	Roll Section	8 Wholly Exempt
Book No	18 Sect 146-151	Property Type	9 Exempt
Nbhd	900-41 90041	School District	472603 Huntington
Zoning	c6 C6	Zoning?	c6 C6
Zoning3	c6 C6	Tax Code	125 Tax District - 125
Size Total	1.3 Acres		
FY	2013	L M B	
		Method Use	C.A.M.A.
		Appr. Value	\$67,010

Mail Index (TAX)

Name/Address	Type	Loan Number	Active/Inact	From	Until
TOWN OF HUNTINGTON C/O COMPTROLLER 100 MAIN ST HUNTINGTON NY 11743-6904	Owner		Active		

Tax Assessment

CURRENT YEAR INFO 2013

Land Value	Improvements	Total Value	Tax Rate	True Taxes	Total Taxes
\$1,300		\$1,300		\$0.00	

PRIOR YEAR INFO 2012

Land Value	Improvements	Total Value	Tax Rate	True Taxes	Total Taxes
\$1,300	\$0	\$1,300		\$0.00	\$0.00

Tax Levy Maintenance

Levy No	Levy Desc	Levy Type	Exemptions	Taxable Val.	Tax Rate	Taxes
sc003	School Dist - Huntington	School District	1,300		0	
ld003	Library Dist - Huntington	Library District	1,300		0	
d006	County	County District	1,300		0	
d000	County Police District	Police District	1,300		0	
d096	Out of County Tuition	Town District	1,300		0	
d007	Town/Pt. Town	Town District	1,300		0	
d009	Highway Tax	Highway	1,300		0	
d020	Lighting Dist -Town Wide	Light District	1,300		0	
d005	NYS Real Property Tax Law	County District	1,300		0	
d022	Open Space Bonds II & III	Open Space	1,300		0	
d023	New York State MTA Tax	County District	1,300		0	
ga010	Refuse District	Special District			0	
d016	Fd - Huntington Manor	Fire District	1,300		0	
d091	Ambulance Dist - Hunt	Ambulance District	1,300		0	

TOTAL

Tax Exemptions

Exempt No	Exempt Desc	Start Date	End Date	Amount	Tax Rate	Net Amount
40125	T.O.H.- Generally			\$1,300	100.00	\$0.00

Town of Huntington
Tax Map # 0400-147.00-01.00-005.003
Parcel Id 28826
RAILROAD AVE, HUNTINGTON STATION
TOWN OF HUNTINGTON Since Mar 1900
C/O COMPTROLLER
100 MAIN ST
HUNTINGTON NY 11743-6904

Class	653 Parking Lots:	Roll Section	8 Wholly Exempt
Book No	18 Sect 146-151	Property Type	9 Exempt
Nbhd	90041 90041	School District	472603 Huntington
Zoning	c6 C6	Zoning2	c6 C6
Zoning3	c6 C6	Tax Code	125 Tax District - 125
Size Total	1.3 Acres		
FY	2013	L M B	
		Method Use	C.A.M.A.
		Appr. Value	\$67,010

Multimedia Information

Description	Sub Code	Entry Date
LenDisk Images		2/19/2000

Bldg Permits

Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred	Date				
	A19450000141	005678	4-20-49		
	1/1/1945	3/28/1945	4/20/1949		

Purpose
Diner

Type	Application	Permit	Certificate	Estimated Cost	Total Fee
Transferred	Date				
	A19470000369	001711	6-25-48	\$26,000.00	\$0.00
	1/1/1947	11/26/1947	6/25/1948		

Purpose
Erect A 1 Story Brick Building For Post Office.

Misc. Structure Info.

Muse	Price	Units	DT	Dpr %	Condition	Overall Adj.	Final Adj.	Value
Grade		Yr. Built Act						
lp4 Paving, Asphalt		(51000 x 4)	204000	Multiplier (1)	3 Normal			
c.Average		1980						
lt4 Streetlight, Incand			20	Multiplier (20)	3 Normal			
c.Average		1980						

MISCELLANEOUS VALUE

Town of Huntington

Tax Map # 0400-147.00-01.00-005.005

Parcel Id 70107

NEW YORK AV/R R, HUNTINGTON STATION

HUNTINGTON URBAN RENEWAL AGENCY Since Mar 1900

100 Main St

Huntington, NY 11743-6904

Class	653 Parking Lots:	Roll Section	8 Wholly Exempt
Book No	16 Sect 146-151	Property Type	9 Exempt
Nbhd	u Unknown	School District	472603 Huntington
Zoning	u Unknown	Zoning2	u Unknown
Zoning3	u Unknown	Tax Code	125 Tax District - 125
Size Total	0.46 Acres		
FY	2013		

Mail Index (TAX)

Name/Address	Type	Loan Number	Active/Inact	From	Until
HUNTINGTON URBAN RENEWAL AGENCY 100 Main St Huntington, NY 11743-6904	Owner		Active		

Tax AssessmentCURRENT YEAR INFO 2013

Land Value	Improvements	Total Value	Tax Rate	True Taxes	Total Taxes
\$450		\$450		\$0.00	

PRIOR YEAR INFO 2012

Land Value	Improvements	Total Value	Tax Rate	True Taxes	Total Taxes
\$450	\$0	\$450		\$0.00	\$0.00

Tax Levy Maintenance

Levy No	Levy Desc	Levy Type	Exemptions	Taxable Val.	Tax Rate	Taxes
sc003	School Dist - Huntington	School District	450		0	
ls003	Library Dist - Huntington	Library District	450		0	
d006	County	County District	450		0	
d008	County Police District	Police District	450		0	
d096	Out of County Tuition	Town District	450		0	
d007	Town/Pt. Town	Town District	450		0	
d009	Highway Tax	Highway	450		0	
d020	Lighting Dist - Town Wide	Light District	450		0	
d005	NYS Real Property Tax Law	County District	450		0	
d022	Open Space Bonds II & III	Open Space	450		0	
d023	New York State MTA Tax	County District	450		0	
gs018	Refuse District	Special District			0	
d016	Fd - Huntington Menor	Fire District	450		0	
d091	Ambulance Dist - Hunt	Ambulance District	450		0	

TOTALTax Exemptions

Exempt No	Exempt Desc	Start Date	End Date	Amount	Tax Rate	Net Amount
40125	T.O.H.- Generally			\$450	100.00	\$0.00

Environmental Site Profiles

An environmental site assessment of the site was conducted, which consisted of a review of historical land uses described on Sanborn® Fire Insurance Maps, aerial photographs and maps and other information reviewed from Town historical documents, information provided by the Town, a Phase I Environmental Database Report produced by Toxics Targeting (copy of parts 1 and 2 attached), 2009, Suffolk County Land Information iMap site information, visual site inspections and the New York State Department of Environmental Conservation Database of Environmental Remediation Sites and Spill Incidents.

Prior to the 1960's urban renewal campaign, the Long Island Railroad station approach consisted of an entry court with a landscaped circle that formed part of the central business hub of the area. This area was formed by the diagonal intersections of Lincoln Avenue (now Broadway), Lenox Road and New York Avenue. After the urban renewal, not only were all of the commercial buildings razed, the roadways were realigned. Lenox Road on the north side of the tracks was completely removed and Lincoln Avenue was extended in a straight line, cutting off a major portion of the LIRR station's approach area, to create a new perpendicular intersection with New York Avenue.

On the west side of New York Avenue, early maps show Lowndes Avenue extending south to the railroad tracks and then turning towards New York Avenue. The area that is currently the Parking Lot site and the eastern terminus of Railroad Avenue was the site of the North Side Hotel, and the A.S. Pettit and Son's Lumber Coal and Feed Co. The hotel was a large Queen Anne style rooming house that primarily served the LIRR riders. This structure was demolished in the 1930's. The A.S. Pettit and Son's Co. was a building materials storage and transfer facility which handled such materials as lumber, metal sheeting, masonry products as well as coal. A coal pile was located on the site and coal was apparently transferred from the pile to equipment and transport vehicles for offsite delivery. There were several other commercial businesses located directly west of the existing parking lot site including Standard Oil Co., The Texas Co. and a junk yard. Additional businesses located on the parking lot site included the Lockhart Lincoln Mercury car dealership, a Gulf service station and the Trolley Car Diner (later Boyles' Diner). After urban renewal, sometime between the 1967 General Neighborhood Renewal Plan and the 1989 Huntington Station Revitalization Plan, all of these structures were cleared and a parking lot was constructed. Lowndes Avenue was terminated at Railroad Avenue, which was extended to meet the realigned Broadway at New York Avenue, creating a typical four-leg intersection.

Potential Environmental Issues of Concern: Based on the information resources reviewed for this assessment, no significant environmental issues of concern were noted. However, it is possible that the former site activities have impacted the site; for example, there may remain on the site coal remnants from the coal handling operations or materials associated with automobile servicing from the car dealership and service station. In addition, it is not known how on-site underground storage tanks were closed; how debris from the demolition of former on-site structures was managed and if any of those materials may have been used to

fill basements and other low spots on the site; whether stormwater and groundwater containing contaminated residuals from the adjacent properties could have flowed onto and beneath the site; and whether soil vapor could have been affected at the site from any of these issues. Further, the site is currently a parking lot which appears from visual observations to contain stormwater drains discharging to on-site drywells. Offsite storm drainage may also be able to flow onto other onsite areas. Although no petroleum releases have been reported to the NYSDEC, there is the potential that the site stormwater discharge areas may contain petroleum and other fluid residuals possibly leaking from automobiles parked in the lot.

A Phase II Environmental Site Assessment, which involves soil, groundwater and soil vapor sampling and subsurface assessment to define potential buried materials, would be required to determine if any of these issues are of concern and if any remediation is required to be incorporated into redevelopment plans for the site. This work could possibly be conducted under a Step 3 BOA grant.




STATION

New York Ave

Broadway

LIRR

Railroad St

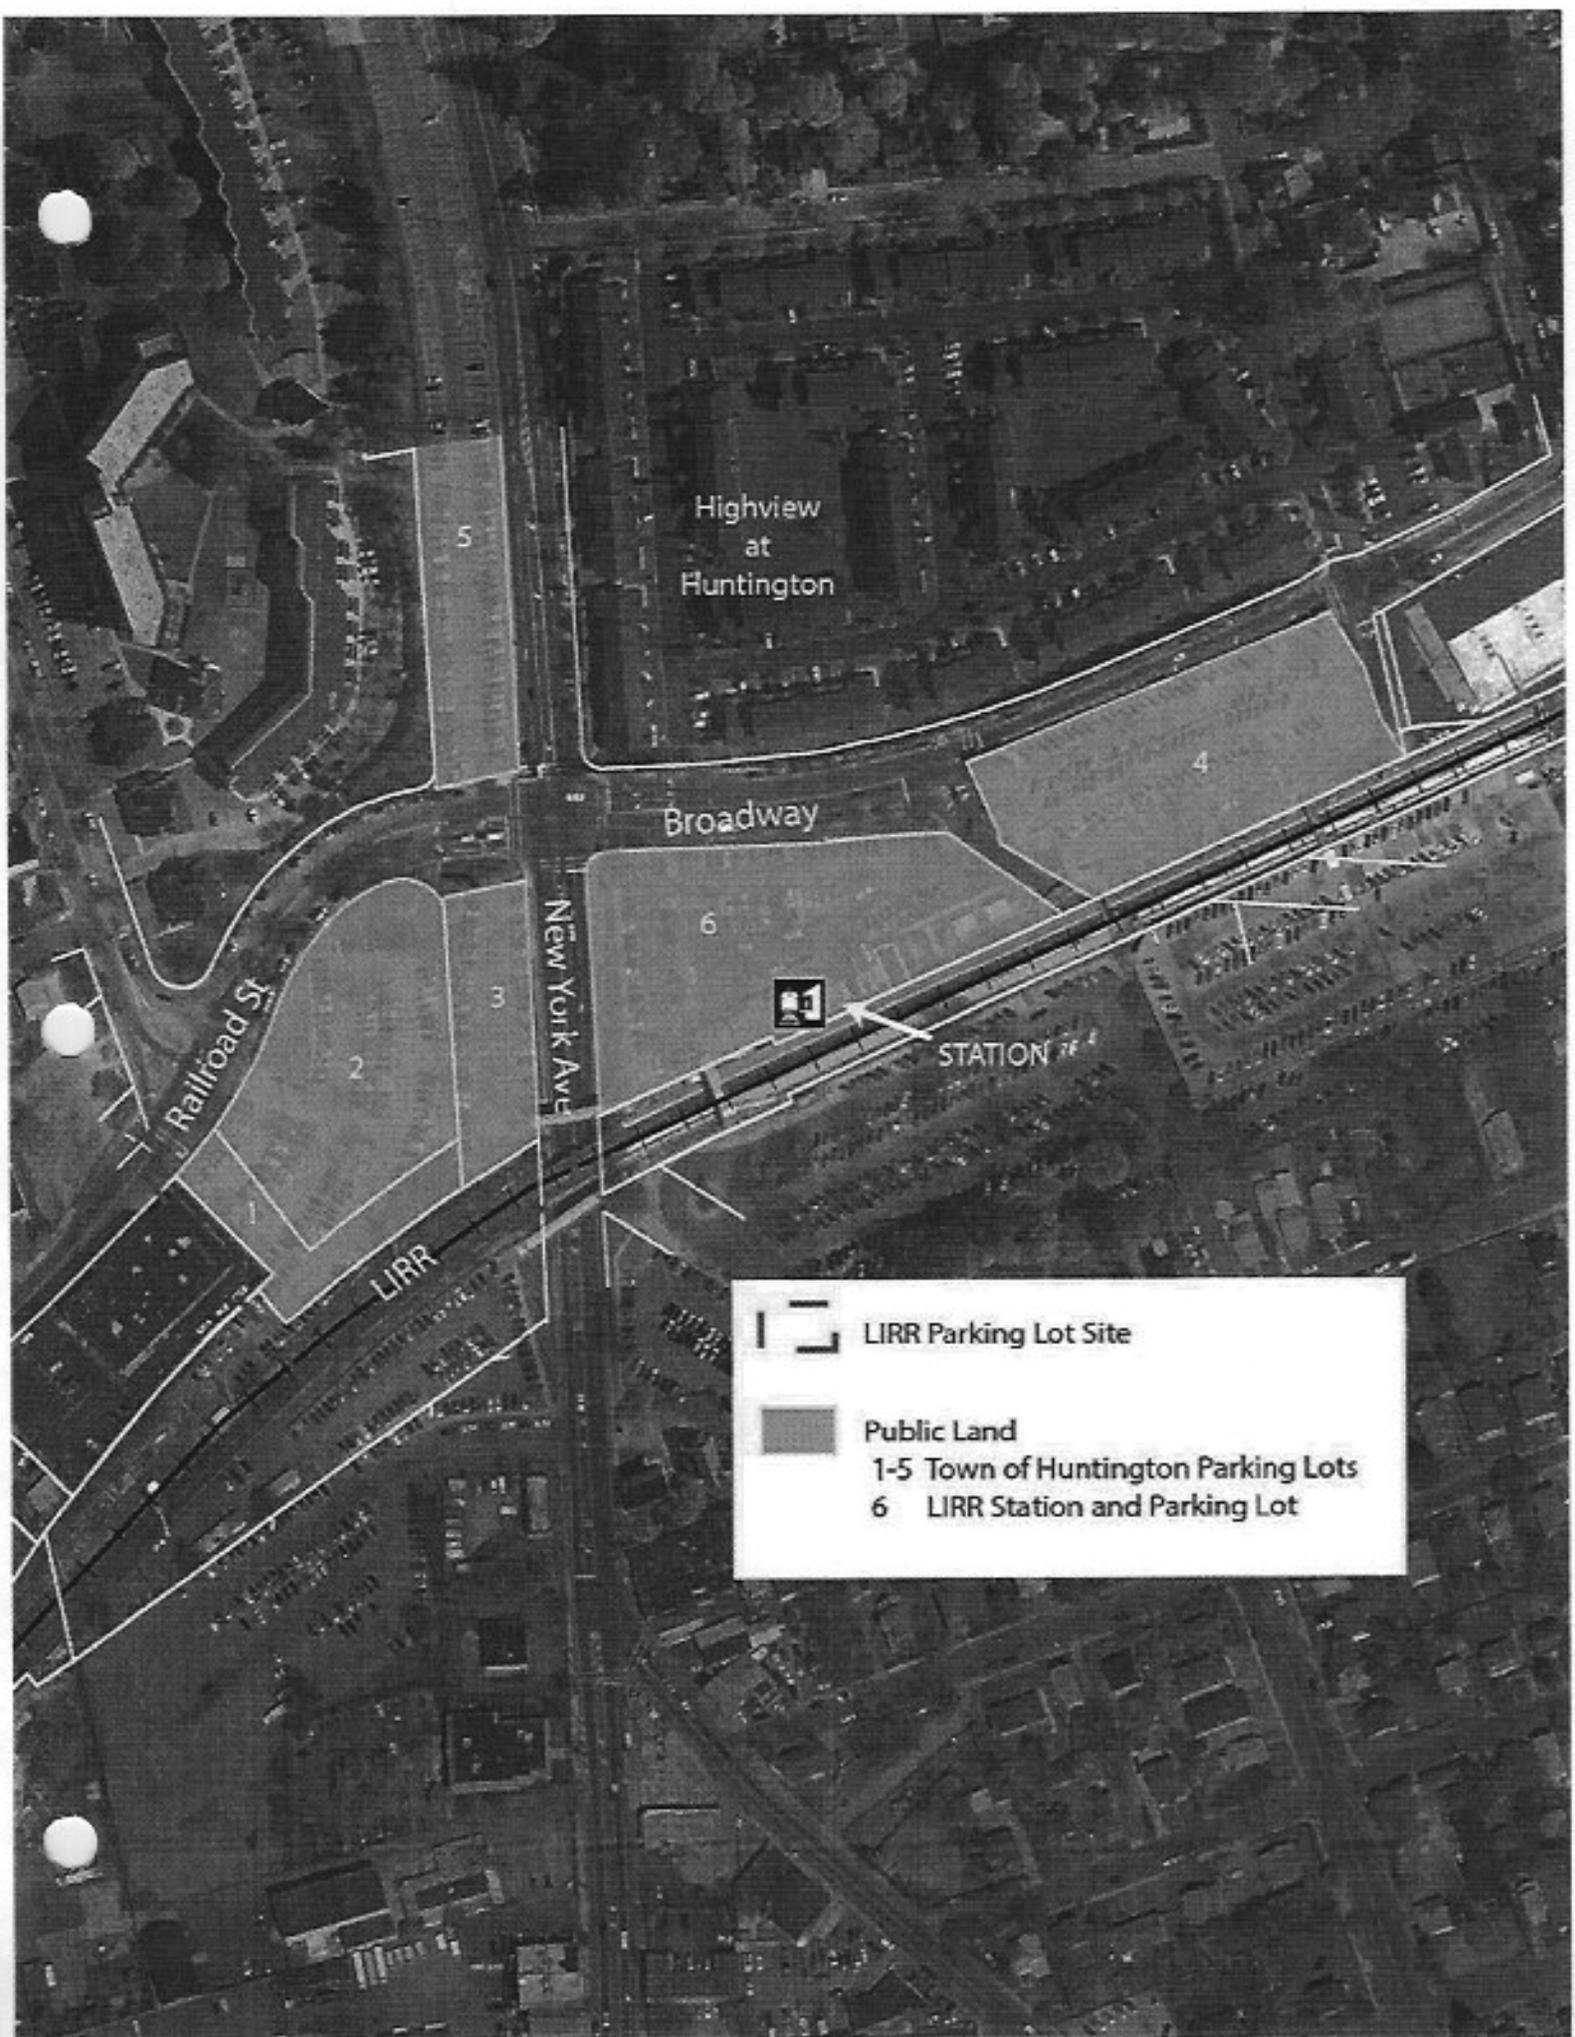

Highview
at
Huntington

Broadway

Railroad St

New York Ave

LIRR


STATION

 LIRR Parking Lot Site

 Public Land

1-5 Town of Huntington Parking Lots

6 LIRR Station and Parking Lot

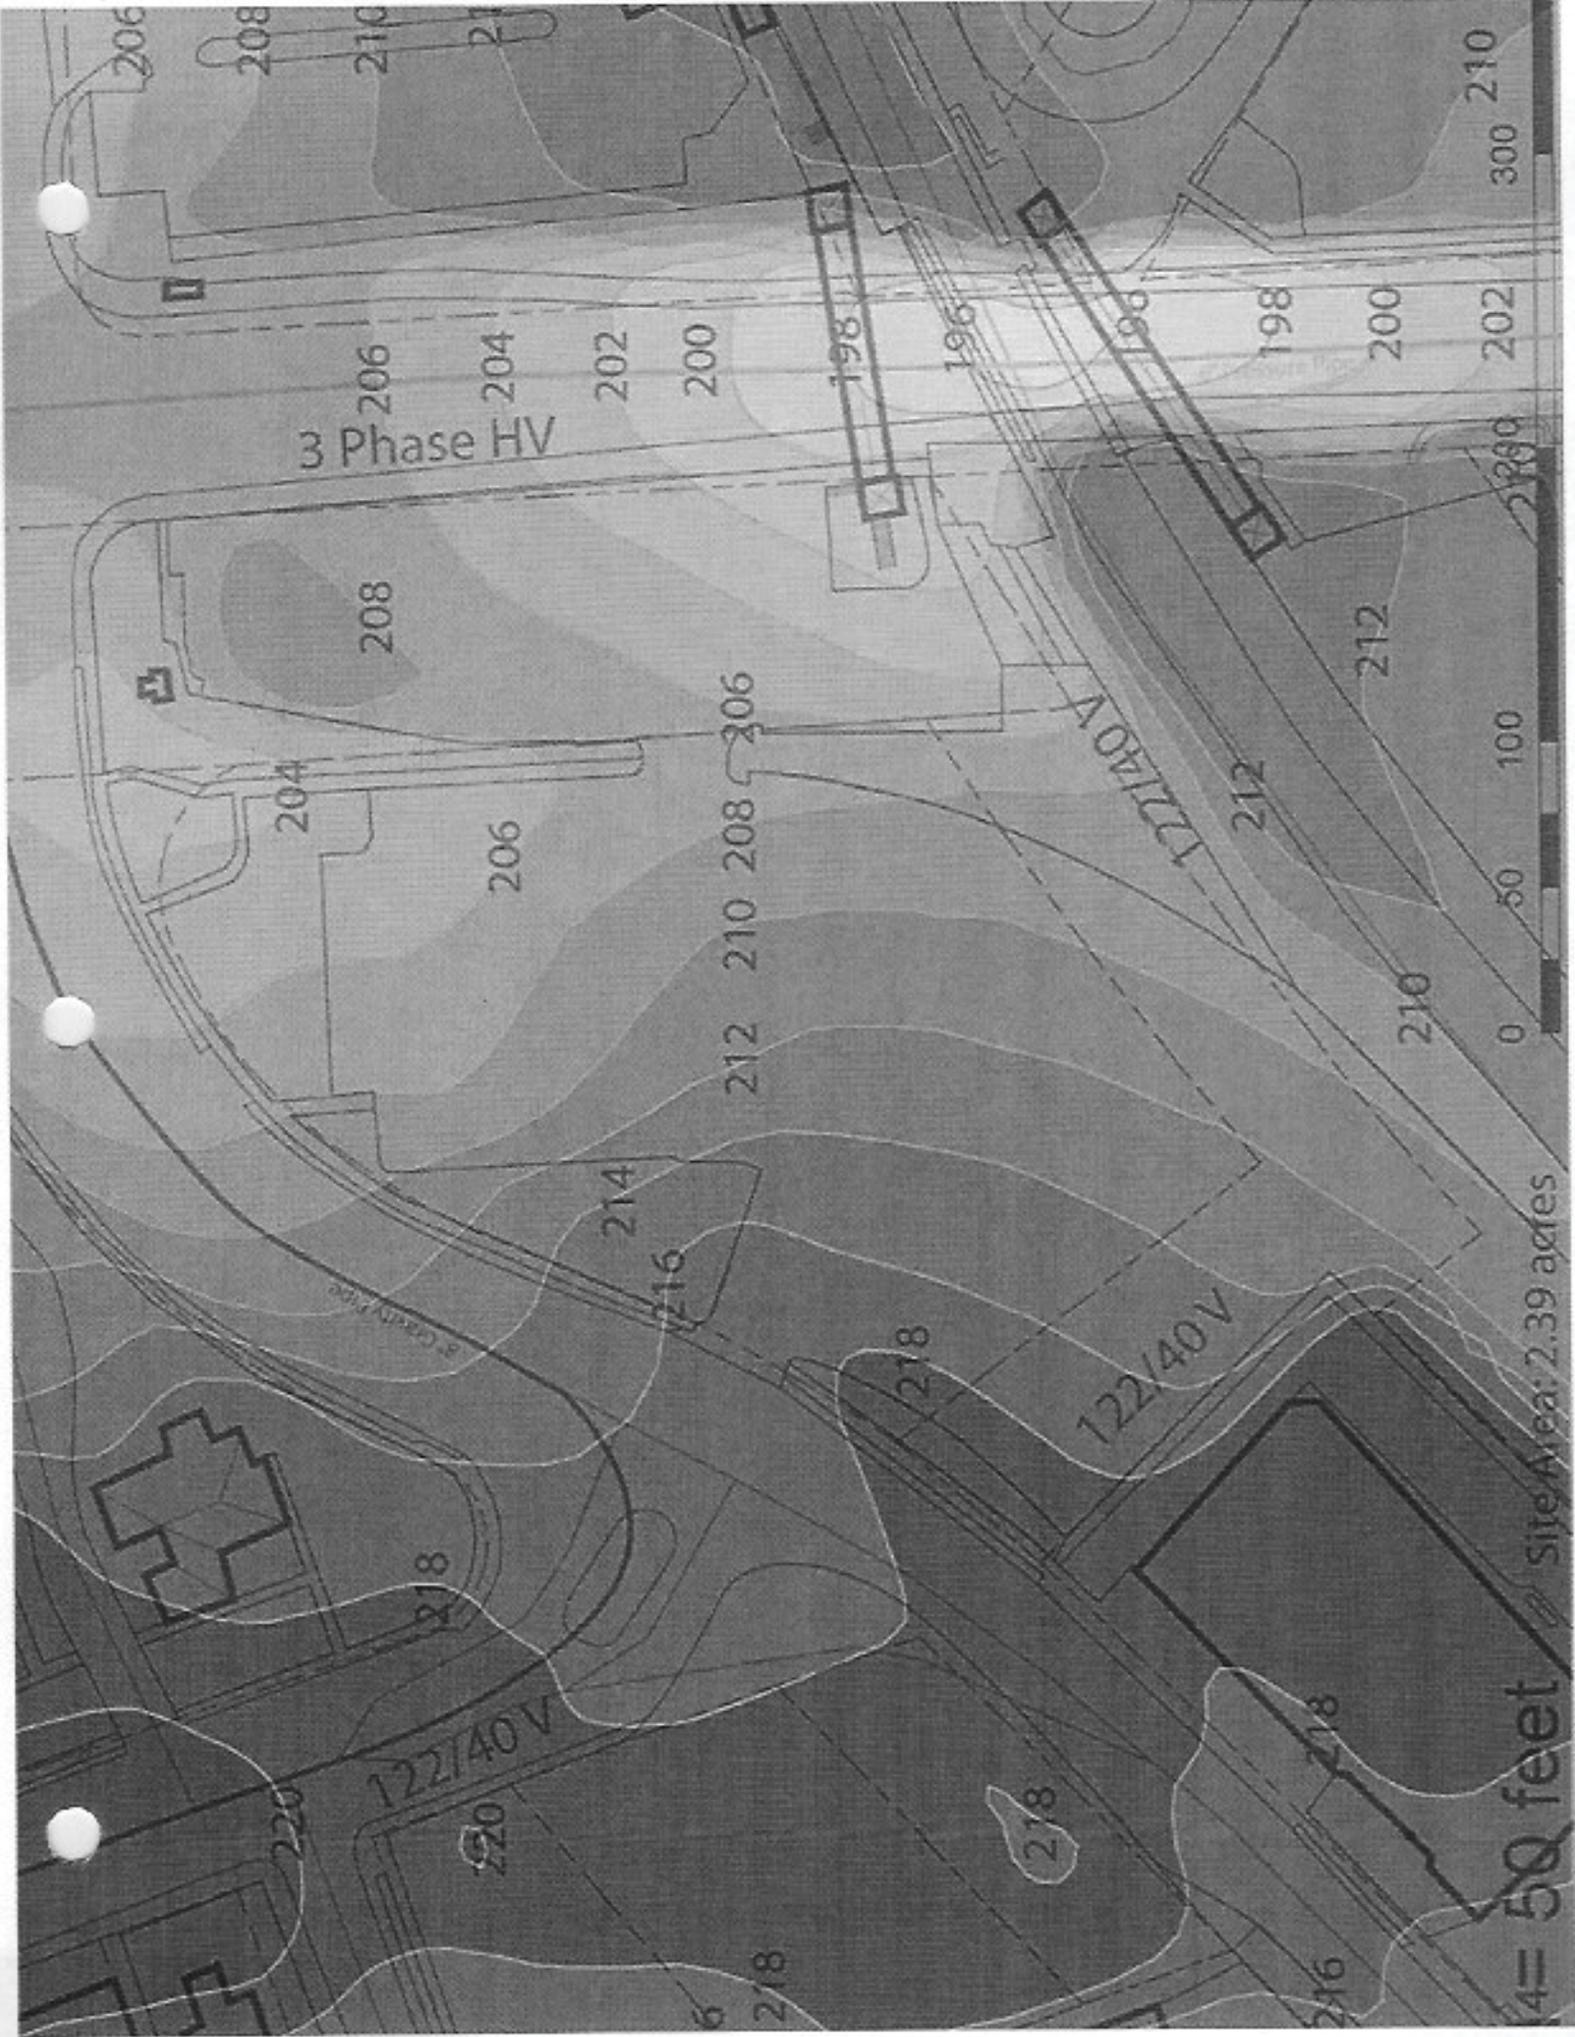

3 Phase HV

122/40 V

122/40 V

Site Area: 2.39 acres

1" = 50 feet

Columbia Terrace

Area Revitalization Initiatives

3

Revitalization initiatives in the Columbia Terrace/Huntington Station Downtown vicinity


Based upon top voted ideas gathered through Source the Station and resulting market feasibility studies, a community driven, comprehensive revitalization strategy for Huntington Station has been developed & adopted.



1 Recently completed Gateway Plaza at NY Ave & Olive Street




4 Proposed veterans residences

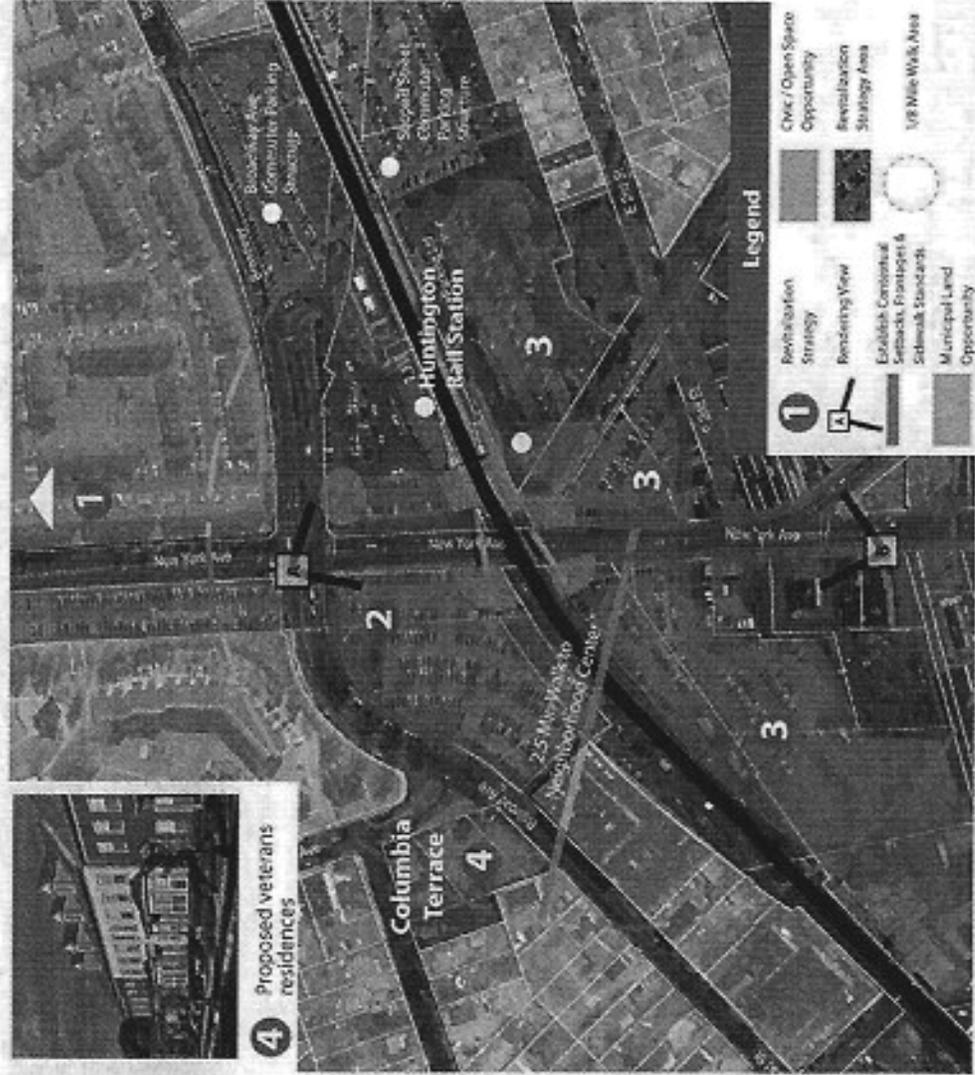


2 Proposed site for a Boutique Hotel



3 Connected network of streets and sidewalks with mixed-use buildings, active frontages, and outdoor dining

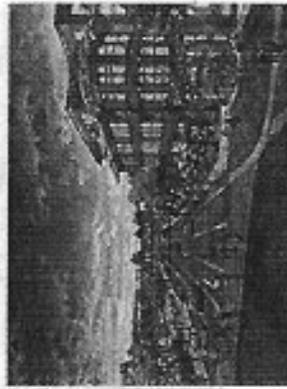

A Rendering of potential new station improvements and hotel with ground floor restaurants and shops at NY Ave & Railroad Street

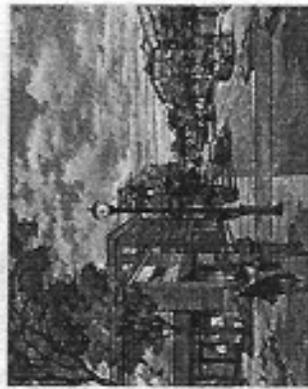

B Rendering of potential infill opportunities and streetscape improvements along NY Ave with on-street parking

All cost, schedule & development projections are based upon a series of assumptions that require Town of Huntington verification.

A
P
P
E
N
D
I
X

D

New York Ave and Railroad Street
New York Ave and Railroad Street
Huntington Station, NY 11746

Inquiry Number: 3836178.1s
January 23, 2014

The EDR Radius Map™ Report with GeoCheck®



440 Wheelers Farms Road
Milford, CT 06461
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	146
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-13
Physical Setting Source Map Findings	A-15
Physical Setting Source Records Searched	A-11

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2014 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

NEW YORK AVE AND RAILROAD STREET
HUNTINGTON STATION, NY 11746

COORDINATES

Latitude (North): 40.8525000 - 40° 51' 9.00"
Longitude (West): 73.4123000 - 73° 24' 44.28"
Universal Transverse Mercator: Zone 18
UTM X (Meters): 633831.3
UTM Y (Meters): 4523385.0
Elevation: 212 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 40073-G4 HUNTINGTON, NY
Most Recent Revision: 1989

AERIAL PHOTOGRAPHY IN THIS REPORT

Photo Year: 2011
Source: USDA

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL..... National Priority List

EXECUTIVE SUMMARY

Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

FEDERAL FACILITY..... Federal Facility Site Information listing

Federal CERCLIS NFRAP site List

CERC-NFRAP..... CERCLIS No Further Remedial Action Planned

Federal RCRA CORRACTS facilities list

CORRACTS..... Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF..... RCRA - Treatment, Storage and Disposal

Federal RCRA generators list

RCRA-LQG..... RCRA - Large Quantity Generators

RCRA-SQG..... RCRA - Small Quantity Generators

Federal institutional controls / engineering controls registries

US ENG CONTROLS..... Engineering Controls Sites List

US INST CONTROL..... Sites with Institutional Controls

LUCIS..... Land Use Control Information System

Federal ERNS list

ERNS..... Emergency Response Notification System

State- and tribal - equivalent CERCLIS

VAPOR REOPENED..... Vapor Intrusion Legacy Site List

State and tribal leaking storage tank lists

HIST LTANKS..... Listing of Leaking Storage Tanks

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

TANKS..... Storage Tank Facility Listing

CBS UST..... Chemical Bulk Storage Database

MOSF UST..... Major Oil Storage Facilities Database

CBS AST..... Chemical Bulk Storage Database

MOSF AST..... Major Oil Storage Facilities Database

CBS..... Chemical Bulk Storage Site Listing

EXECUTIVE SUMMARY

MOSF..... Major Oil Storage Facility Site Listing
INDIAN UST..... Underground Storage Tanks on Indian Land
FEMA UST..... Underground Storage Tank Listing

State and tribal institutional control / engineering control registries

ENG CONTROLS..... Registry of Engineering Controls
INST CONTROL..... Registry of Institutional Controls
RES DECL..... Restrictive Declarations Listing

State and tribal voluntary cleanup sites

VCP..... Voluntary Cleanup Agreements
INDIAN VCP..... Voluntary Cleanup Priority Listing

State and tribal Brownfields sites

BROWNFIELDS..... Brownfields Site List

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

ODI..... Open Dump Inventory
DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations
SWTIRE..... Registered Waste Tire Storage & Facility List
SWRCY..... Registered Recycling Facility List
INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US CDL..... Clandestine Drug Labs
DEL SHWS..... Delisted Registry Sites
US HIST CDL..... National Clandestine Laboratory Register

Local Lists of Registered Storage Tanks

HIST UST..... Historical Petroleum Bulk Storage Database
HIST AST..... Historical Petroleum Bulk Storage Database

Local Land Records

LIENS 2..... CERCLA Lien Information
LIENS..... Spill Liens Information

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System
NY Hist Spills..... SPILLS Database
SPILLS 80..... SPILLS 80 data from FirstSearch
SPILLS 90..... SPILLS 90 data from FirstSearch

Other Ascertainable Records

DOT OPS..... Incident and Accident Data

EXECUTIVE SUMMARY

DOD.....	Department of Defense Sites
FUDS.....	Formerly Used Defense Sites
CONSENT.....	Superfund (CERCLA) Consent Decrees
ROD.....	Records Of Decision
UMTRA.....	Uranium Mill Tailings Sites
US MINES.....	Mines Master Index File
TRIS.....	Toxic Chemical Release Inventory System
TSCA.....	Toxic Substances Control Act
FTTS.....	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
HIST FTTS.....	FIFRA/TSCA Tracking System Administrative Case Listing
SSTS.....	Section 7 Tracking Systems
ICIS.....	Integrated Compliance Information System
PADS.....	PCB Activity Database System
MLTS.....	Material Licensing Tracking System
RADINFO.....	Radiation Information Database
FINDS.....	Facility Index System/Facility Registry System
RAATS.....	RCRA Administrative Action Tracking System
RMP.....	Risk Management Plans
HSWDS.....	Hazardous Substance Waste Disposal Site Inventory
UIC.....	Underground Injection Control Wells
SPDES.....	State Pollutant Discharge Elimination System
AIRS.....	Air Emissions Data
E DESIGNATION.....	E DESIGNATION SITE LISTING
INDIAN RESERV.....	Indian Reservations
SCRD DRYCLEANERS.....	State Coalition for Remediation of Drycleaners Listing
PRP.....	Potentially Responsible Parties
US AIRS.....	Aerometric Information Retrieval System Facility Subsystem
LEAD SMELTERS.....	Lead Smelter Sites
EPA WATCH LIST.....	EPA WATCH LIST
Financial Assurance.....	Financial Assurance Information Listing
2020 COR ACTION.....	2020 Corrective Action Program List
COAL ASH.....	Coal Ash Disposal Site Listing
PCB TRANSFORMER.....	PCB Transformer Registration Database
COAL ASH EPA.....	Coal Combustion Residues Surface Impoundments List
US FIN ASSUR.....	Financial Assurance Information
COAL ASH DOE.....	Steam-Electric Plant Operation Data

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP..... EDR Proprietary Manufactured Gas Plants

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS..... Recovered Government Archive State Hazardous Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

EXECUTIVE SUMMARY

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property. Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal CERCLIS list

CERCLIS: The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 04/26/2013 has revealed that there is 1 CERCLIS site within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>HUNTINGTON TOWN LF</i>	<i>DEPOSIT RD</i>	<i>SSE 1/4 - 1/2 (0.250 mi.)</i>	<i>J59</i>	<i>119</i>

Federal RCRA generators list

RCRA-CESQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list, as provided by EDR, and dated 09/10/2013 has revealed that there is 1 RCRA-CESQG site within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>HUNTINGTON COACH</i>	<i>81 W 4TH ST</i>	<i>SSW 1/8 - 1/4 (0.209 mi.)</i>	<i>49</i>	<i>94</i>

State- and tribal - equivalent CERCLIS

SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the SHWS list, as provided by EDR, and dated 11/13/2013 has revealed that there is 1 SHWS

EXECUTIVE SUMMARY

site within approximately 1 mile of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>Not reported</i>	1345 NEW YORK AVE.	SSE 1/8 - 1/4 (0.126 mi.)	H40	79

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the list.

A review of the SWF/LF list, as provided by EDR, and dated 10/08/2013 has revealed that there are 2 SWF/LF sites within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>Not reported</i>	1345 NEW YORK AVE.	SSE 1/8 - 1/4 (0.126 mi.)	H40	79
<i>Not reported</i>	100 RAILROAD STREET	SW 1/4 - 1/2 (0.451 mi.)	N63	141

State and tribal leaking storage tank lists

LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the LTANKS list, as provided by EDR, and dated 09/25/2013 has revealed that there are 13 LTANKS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUNTINGTON COMM FIRST AID Spill Number/Closed Date: 9010426 / 4/24/1991 Spill Number/Closed Date: 9010441 / 4/24/1991	2 RAILROAD STREET	WSW 0 - 1/8 (0.021 mi.)	B8	16
ALL AMERICAN OIL CORP Spill Number/Closed Date: 8807750 / 12/31/1988	NY AVENUE & BROADWAY	NE 0 - 1/8 (0.038 mi.)	C12	24
HUNTINGTON INTERMEDIATE Spill Number/Closed Date: 0111100 / 12/28/2009	155 LOWNDES AVENUE	NW 0 - 1/8 (0.119 mi.)	F37	78
Lower Elevation	Address	Direction / Distance	Map ID	Page
JIFFY LUBE Spill Number/Closed Date: 9307366 / 12/7/1993	1297 NEW YORK AVE	SSE 0 - 1/8 (0.079 mi.)	E20	36
BAILEY RESIDENCE Spill Number/Closed Date: 9201883 / 2/3/1993	86 COLUMBIA STREET	WSW 1/8 - 1/4 (0.158 mi.)	43	85
NY TELEPHONE CO Spill Number/Closed Date: 9110160 / 11/6/1992	50 WEST 4TH STREET	SSW 1/8 - 1/4 (0.161 mi.)	I45	87
BELL ATLANTIC Spill Number/Closed Date: 9605936 / 10/3/1996	50 WEST 4TH STREET	S 1/8 - 1/4 (0.208 mi.)	I48	91
1419 NEW YORK AVENUE ASSO Spill Number/Closed Date: 9710970 / 12/10/2009	1419 NEW YORK AVENUE	S 1/8 - 1/4 (0.231 mi.)	K51	99
MOBIL Spill Number/Closed Date: 8600874 / 12/18/1989	984 NEW YORK AVENUE	N 1/4 - 1/2 (0.341 mi.)	60	121

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
GARDEN STEWART CORP Spill Number/Closed Date: 9208116 / 3/15/1995	200 MCKAY ROAD	SW 1/4 - 1/2 (0.393 mi.)	61	135
HUNTINGTON HOUSING AUTHORITY Spill Number/Closed Date: 8603290 / 1/8/1987	5 LOWNDES AVE	NNW 1/4 - 1/2 (0.427 mi.)	62	137
HUNTINGTON FLEET SERVICE Spill Number/Closed Date: 8702159 / 7/17/1987	114 RAILROAD STREET	SW 1/4 - 1/2 (0.480 mi.)	N64	142
APT BLDG Spill Number/Closed Date: 9103772 / 7/26/1991	1585 NY AVE & E10 & E11	S 1/4 - 1/2 (0.488 mi.)	65	144

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the UST list, as provided by EDR, and dated 11/13/2013 has revealed that there are 2 UST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUNTINGTON ELEMENTARY SCHOOL	LOWNDES AVE	NW 0 - 1/8 (0.117 mi.)	F36	74
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
USA 3 BROTHERS 1 CORP	1290 NEW YORK AVE	SSE 0 - 1/8 (0.096 mi.)	E29	54

AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the AST list, as provided by EDR, and dated 11/13/2013 has revealed that there is 1 AST site within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
USA 3 BROTHERS 1 CORP	1290 NEW YORK AVE	SSE 0 - 1/8 (0.096 mi.)	E30	68

State and tribal Brownfields sites

ERP: In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a \$200 million Environmental Restoration or Brownfields Fund as part of the \$1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

A review of the ERP list, as provided by EDR, and dated 11/13/2013 has revealed that there is 1 ERP

EXECUTIVE SUMMARY

site within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>Not reported</i>	1345 NEW YORK AVE.	SSE 1/8 - 1/4 (0.126 mi.)	H40	79

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: The EPA's listing of Brownfields properties from the Cleanups in My Community program, which provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

A review of the US BROWNFIELDS list, as provided by EDR, and dated 09/24/2013 has revealed that there is 1 US BROWNFIELDS site within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
ROTUNDO	1345 NEW YORK AVENUE	SSE 1/8 - 1/4 (0.126 mi.)	H41	82

Records of Emergency Release Reports

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 09/25/2013 has revealed that there are 21 NY Spills sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
UNK TENNIS CLUB Spill Number/Closed Date: 9403996 / 2/4/1997	HUNTINGTON R/R ST TRACK	NNW 0 - 1/8 (0.002 mi.)	A1	8
TOWN PARKING LOT 22 Spill Number/Closed Date: 0225156 / 7/30/2002	RTE 110 & RAILROAD AVE	WSW 0 - 1/8 (0.003 mi.)	B2	9
LIRR Spill Number/Closed Date: 9012724 / 3/13/1991	RAILROAD AVE & RTE 110	WSW 0 - 1/8 (0.003 mi.)	B3	10
UNKNOWN Spill Number/Closed Date: 9907204 / 12/18/2001	RTE 110 & BROADWAY	NNE 0 - 1/8 (0.008 mi.)	A4	11
LIRR Spill Number/Closed Date: 9713516 / 3/17/1999	BROADWAY/RTE 110	NNE 0 - 1/8 (0.008 mi.)	A5	12
SPILL NUMBER 0204508 Spill Number/Closed Date: 0204508 / 7/30/2002	NEW YORK AVE/RAILROAD S	NNE 0 - 1/8 (0.009 mi.)	A6	13
UNKNOWN Spill Number/Closed Date: 0310671 / 12/16/2003	NEW YORK AVE/BROADWAY	NNE 0 - 1/8 (0.009 mi.)	A7	14
HUNTINGTON COMM FIRST AID Spill Number/Closed Date: 9808068 / 3/16/1999	2 RAILROAD STREET	WSW 0 - 1/8 (0.021 mi.)	B8	16
HUNTINGTON COMMUTER GARAGE Spill Number/Closed Date: 9302940 / 6/14/1994	NY AVE & BROADWAY	NE 0 - 1/8 (0.037 mi.)	C10	21

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
RESIDENCE Spill Number/Closed Date: 1001386 / 6/7/2010	6 COLUMBIA STREET	WNW 0 - 1/8 (0.036 mi.)	B11	23
UNKNOWN Spill Number/Closed Date: 1215818 / Not Reported	5 RAILROAD ST	WSW 0 - 1/8 (0.039 mi.)	B13	25
DEJESUS RESIDENCE Spill Number/Closed Date: 9213876 / 7/8/1994	37 COLUMBIA STREET	W 0 - 1/8 (0.089 mi.)	23	44
LIRR Spill Number/Closed Date: 8804613 / 10/31/1988	E/O HUNTINGTON STATION	E 0 - 1/8 (0.107 mi.)	G34	71
LONG ISLAND TRAIN STATION Spill Number/Closed Date: 9806401 / 11/17/1998	SOUTH PARKING GARAGE	E 0 - 1/8 (0.107 mi.)	G35	73
Lower Elevation	Address	Direction / Distance	Map ID	Page
BOOZER'S PUB (FORMERLY) Spill Number/Closed Date: 1007783 / 7/18/2011	1268 NEW YORK AVE	SSE 0 - 1/8 (0.068 mi.)	E19	35
JIFFY LUBE Spill Number/Closed Date: 8802253 / 7/30/1986	1297 NEW YORK AVE	SSE 0 - 1/8 (0.079 mi.)	E20	36
I/O RESIDENCE Spill Number/Closed Date: 0105193 / 9/27/2001	29 RAILROAD AVENUE	SW 0 - 1/8 (0.084 mi.)	D22	43
UNKNOWN Spill Number/Closed Date: 9903435 / 6/8/2005	1290 NEW YORK AVENUE	SSE 0 - 1/8 (0.091 mi.)	E24	45
UNKNOWN Spill Number/Closed Date: 9807418 / 12/2/1999	20 RAILROAD ST/NY AVENU	SW 0 - 1/8 (0.093 mi.)	D25	46
USA GAS STATION Spill Number/Closed Date: 0010095 / 12/7/2000 Spill Number/Closed Date: 9808502 / 11/17/1998 Spill Number/Closed Date: 0908214 / 1/5/2010	1290 NEW YORK AVE	SSE 0 - 1/8 (0.096 mi.)	E28	51
LILCO Spill Number/Closed Date: 9400980 / 6/8/1998	1345 NEW YORK AVE & DEP	SSW 0 - 1/8 (0.119 mi.)	38	77

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 09/10/2013 has revealed that there are 9 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUNTINGTON FIRST AID SQUAD INC	2 RAILROAD ST	WSW 0 - 1/8 (0.021 mi.)	B9	19
Lower Elevation	Address	Direction / Distance	Map ID	Page
CENTURY COLLISION OF HUNT CORP	12 RAILROAD ST	WSW 0 - 1/8 (0.062 mi.)	D16	28
JIFFY LUBE	1297 NEW YORK AVE	SSE 0 - 1/8 (0.079 mi.)	E20	36

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CARMEL COLLISION	8 DEPOT RD	SSE 0 - 1/8 (0.095 mi.)	E26	47
BELL ATLANTIC	50 W 4TH ST	SSW 1/8 - 1/4 (0.186 mi.)	I46	88
R B HAMILTON HAULING & RIGGING	44 RAILROAD ST	SW 1/8 - 1/4 (0.198 mi.)	47	90
NORTHGATE ELECTRIC CORP	63 DEPOT RD	SE 1/8 - 1/4 (0.223 mi.)	J50	98
CLARUS CLEANERS CORP	1044 NEW YORK AVE	N 1/8 - 1/4 (0.232 mi.)	L52	100
PIERPONT PAINT STORE	1425 NEW YORK AVE	S 1/8 - 1/4 (0.242 mi.)	K57	117

MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the MANIFEST list, as provided by EDR, and dated 11/01/2013 has revealed that there are 9 MANIFEST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUNTINGTON FIRST AID SQUAD INC	2 RAILROAD ST	WSW 0 - 1/8 (0.021 mi.)	B9	19

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CENTURY COLLISION OF HUNT CORP	12 RAILROAD ST	WSW 0 - 1/8 (0.062 mi.)	D16	28
JIFFY LUBE	1297 NEW YORK AVE	SSE 0 - 1/8 (0.079 mi.)	E20	36
CARMEL COLLISION	8 DEPOT RD	SSE 0 - 1/8 (0.095 mi.)	E26	47
BELL ATLANTIC	50 WEST 4TH STREET	S 1/8 - 1/4 (0.208 mi.)	I48	91
HUNTINGTON COACH	81 W 4TH ST	SSW 1/8 - 1/4 (0.209 mi.)	49	94
CLARUS CLEANERS CORP	1044 NEW YORK AVE	N 1/8 - 1/4 (0.232 mi.)	L52	100
COMMERCIAL REAL ESTATE	32 WEST PULASKI ROAD	S 1/8 - 1/4 (0.239 mi.)	M56	116
PIERPONT PAINT STORE	1425 NEW YORK AVE	S 1/8 - 1/4 (0.242 mi.)	K57	117

DRYCLEANERS: A listing of all registered drycleaning facilities.

A review of the DRYCLEANERS list, as provided by EDR, and dated 10/17/2013 has revealed that there are 2 DRYCLEANERS sites within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>Not reported</i>	1345 NEW YORK AVE.	SSE 1/8 - 1/4 (0.126 mi.)	H40	79
ORGANIC STATION/CLARUS CLEANER	1044 NEW YORK AVE.	N 1/8 - 1/4 (0.232 mi.)	L53	114

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR US Hist Auto Stat: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk

EXECUTIVE SUMMARY

Historical Records*, or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR US Hist Auto Stat list, as provided by EDR, has revealed that there are 13 EDR US Hist Auto Stat sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
Not reported	5 RAILROAD ST	WSW 0 - 1/8 (0.039 mi.)	B14	26
Not reported	160 LOWNDES AVE	NW 0 - 1/8 (0.105 mi.)	F33	71
Not reported	81 TOWER ST	W 1/8 - 1/4 (0.238 mi.)	55	116
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
Not reported	12 RAILROAD ST	WSW 0 - 1/8 (0.062 mi.)	D17	33
Not reported	1291 NEW YORK AVE	SSE 0 - 1/8 (0.063 mi.)	E18	34
Not reported	1297 NEW YORK AVE	SSE 0 - 1/8 (0.079 mi.)	E21	43
Not reported	8 DEPOT RD	SSE 0 - 1/8 (0.095 mi.)	E27	50
Not reported	1290 NEW YORK AVE	SSE 0 - 1/8 (0.096 mi.)	E31	70
Not reported	10 DEPOT RD	SSE 0 - 1/8 (0.105 mi.)	E32	70
Not reported	25 RAILROAD ST	SW 0 - 1/8 (0.120 mi.)	39	78
Not reported	69 FAIRGROUND AVE	ESE 1/8 - 1/4 (0.157 mi.)	42	84
Not reported	53 DEPOT RD	SSE 1/8 - 1/4 (0.167 mi.)	44	86
Not reported	52 W PULASKI RD	SSW 1/8 - 1/4 (0.250 mi.)	M58	119

EDR US Hist Cleaners: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR US Hist Cleaners list, as provided by EDR, has revealed that there are 2 EDR US Hist Cleaners sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
Not reported	207 LOWNDES AVE	NW 0 - 1/8 (0.045 mi.)	15	27
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
Not reported	1044 NEW YORK AVE	N 1/8 - 1/4 (0.232 mi.)	L54	114

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA LF: The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists.

A review of the RGA LF list, as provided by EDR, has revealed that there are 2 RGA LF sites within

EXECUTIVE SUMMARY

approximately 0.5 miles of the target property.



<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>Not reported</i>	1345 NEW YORK AVE.	SSE 1/8 - 1/4 (0.126 mi.)	H40	79
<i>Not reported</i>	100 RAILROAD STREET	SW 1/4 - 1/2 (0.451 mi.)	N63	141

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 40 records.

Site Name	Database(s)
UNKNOWN	SPILLS 90
PORT DOCK & STONE CORP	MOSF
AMOCO	RCRA NonGen / NLR, FINDS, MANIFEST
NEW YORK STATE DOT	MANIFEST
VERIZON NEW YORK INC	MANIFEST
COMBINE CAMERA STORES INC	RCRA NonGen / NLR, FINDS, MANIFEST
BELL ATLANTIC NY	MANIFEST
BELL ATLANTIC NY	MANIFEST
MTA LIRR HUNTINGTON STATION	RCRA-CESQG, FINDS, MANIFEST
LONG ISLAND RAILROAD	MANIFEST
S.C.W.A. WELLFIELD - HUNTINGTON	SHWS
GULF	UST
HUNTINGTON COUNTRY CLUB	UST
NEXT GAS CORP	UST
ANJON OF GREENLAWN DBA GULF S/S	UST, AST
SUNOCO S/S #00130799	AST
VALERO S/S	AST
ACE TOWING SERVICE	AST
GULF	AST
HUNTINGTON COUNTRY CLUB	AST
NEXT GAS CORP	AST
SUNOCO SERVICE STATION	AST
WALGREENS #3470	RCRA-SQG
LONG ISLAND POWER AUTH HALESITE SU	RCRA NonGen / NLR, FINDS
VERIZON NEW YORK INC	RCRA NonGen / NLR
UNKNOWN	NY Spills
HALESITE SUBSTATION	NY Spills
FORMER COCOS	NY Spills
ROADWAY	NY Spills
IN ROADWAY	NY Spills
UNKNOWN	NY Spills
D&F AUTO BODY	NY Spills
UNKNOWN	NY Spills
UNKNOWN	NY Spills
HUNTINGTON SUBSTATION	NY Spills
ROADWAY	NY Spills
ROAD SIDE AUTO PARTS	NY Spills
HUNTINGTON MANOR FD	NY Spills
GETTY GAS	NY Spills
MANOR FUEL FACILITY	NY Spills

OVERVIEW MAP - 3836178.1s

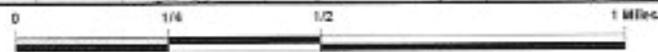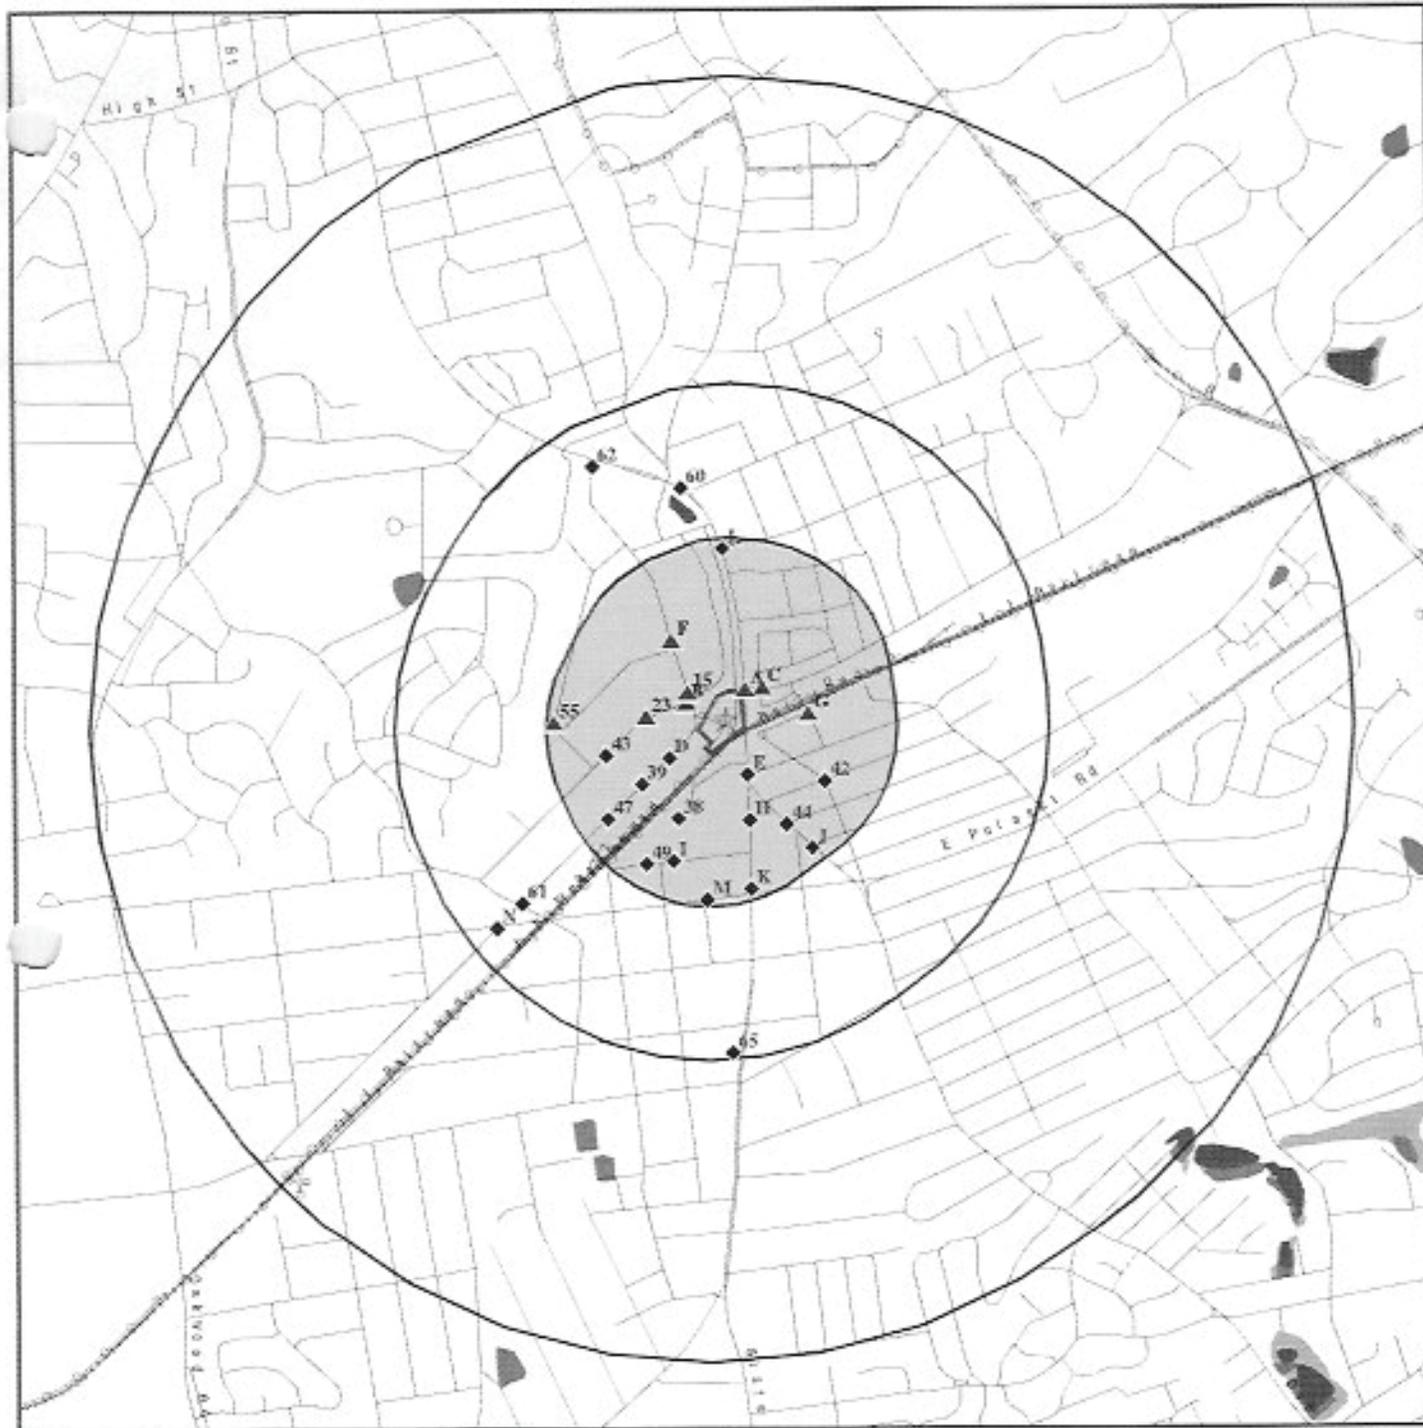


- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- Power transmission lines
- Oil & Gas pipelines from USGS
- 100-year flood zone
- 500-year flood zone
- National Wetland Inventory
- State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: New York Ave and Railroad Street
 ADDRESS: New York Ave and Railroad Street
 Huntington Station NY 11746
 LAT/LONG: 40.8525 / 73.4123

CLIENT: Nobis Engineering, Inc.
 CONTACT: Jeff Brunelle
 INQUIRY #: 3836178.1s
 DATE: January 23, 2014 6:33 pm

DETAIL MAP - 3836178.1s

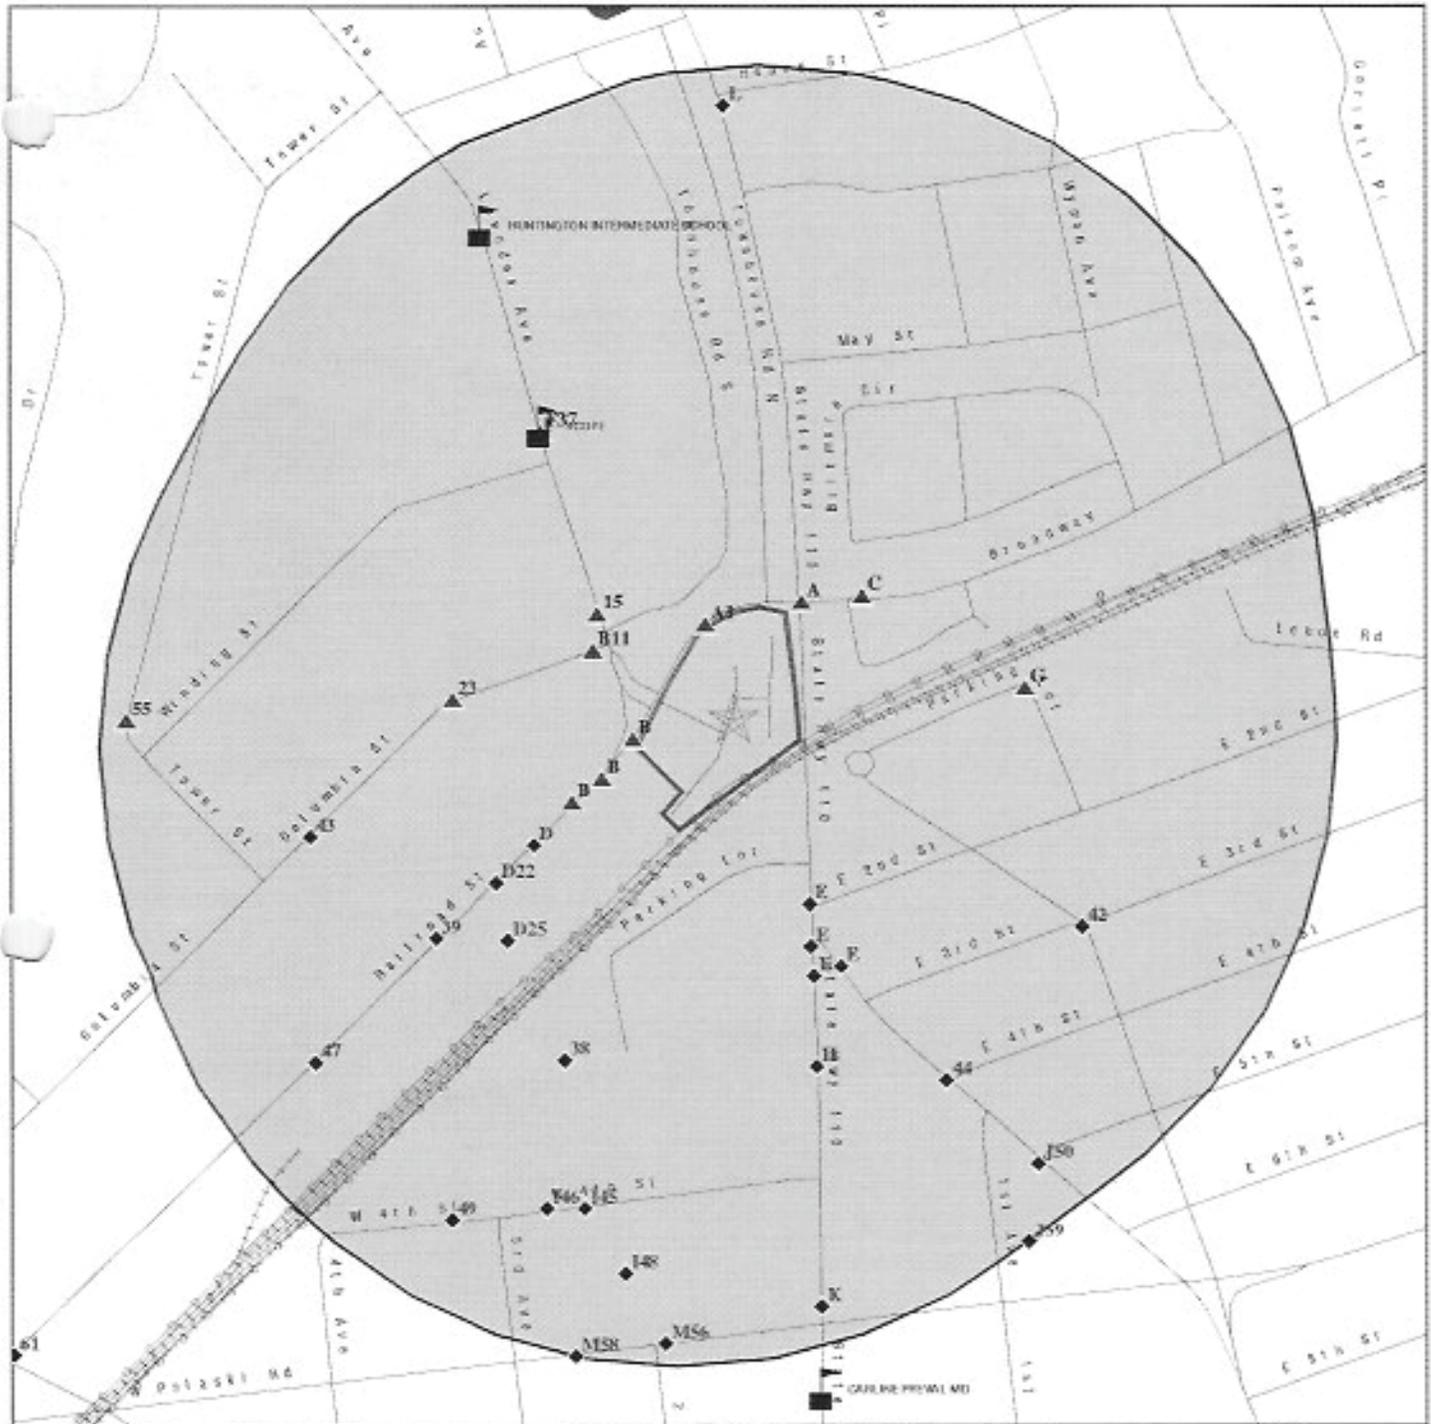

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- Sensitive Receptors
- National Priority List Sites
- Dept. Defense Sites

- Indian Reservations BIA
- Power transmission lines
- Oil & Gas pipelines from USGS
- 100-year flood zone
- 500-year flood zone



This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: New York Ave and Railroad Street
 ADDRESS: New York Ave and Railroad Street
 Huntington Station NY 11746
 LAT/LONG: 40.8525 / 73.4123

CLIENT: Nobis Engineering, Inc.
 CONTACT: Jeff Brunelle
 INQUIRY #: 3836178.1s
 DATE: January 23, 2014 6:35 pm

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
<i>Federal NPL site list</i>								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	TP		NR	NR	NR	NR	NR	0
<i>Federal Delisted NPL site list</i>								
Delisted NPL	1.000		0	0	0	0	NR	0
<i>Federal CERCLIS list</i>								
CERCLIS	0.500		0	0	1	NR	NR	1
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
<i>Federal CERCLIS NFRAP site List</i>								
CERC-NFRAP	0.500		0	0	0	NR	NR	0
<i>Federal RCRA CORRACTS facilities list</i>								
CORRACTS	1.000		0	0	0	0	NR	0
<i>Federal RCRA non-CORRACTS TSD facilities list</i>								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
<i>Federal RCRA generators list</i>								
RCRA-LQG	0.250		0	0	NR	NR	NR	0
RCRA-SQG	0.250		0	0	NR	NR	NR	0
RCRA-CESQG	0.250		0	1	NR	NR	NR	1
<i>Federal institutional controls / engineering controls registries</i>								
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROL	0.500		0	0	0	NR	NR	0
LUCIS	0.500		0	0	0	NR	NR	0
<i>Federal ERNS list</i>								
ERNS	TP		NR	NR	NR	NR	NR	0
<i>State- and tribal - equivalent CERCLIS</i>								
SHWS	1.000		0	1	0	0	NR	1
VAPOR REOPENED	1.000		0	0	0	0	NR	0
<i>State and tribal landfill and/or solid waste disposal site lists</i>								
SWF/LF	0.500		0	1	1	NR	NR	2
<i>State and tribal leaking storage tank lists</i>								
LTANKS	0.500		4	4	5	NR	NR	13
HIST LTANKS	0.500		0	0	0	NR	NR	0
INDIAN LUST	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
State and tribal registered storage tank lists								
TANKS	0.250		0	0	NR	NR	NR	0
UST	0.250		2	0	NR	NR	NR	2
CBS UST	0.250		0	0	NR	NR	NR	0
MOSF UST	0.500		0	0	0	NR	NR	0
AST	0.250		1	0	NR	NR	NR	1
CBS AST	0.250		0	0	NR	NR	NR	0
MOSF AST	0.500		0	0	0	NR	NR	0
CBS	0.250		0	0	NR	NR	NR	0
MOSF	0.500		0	0	0	NR	NR	0
INDIAN UST	0.250		0	0	NR	NR	NR	0
FEMA UST	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
ENG CONTROLS	0.500		0	0	0	NR	NR	0
INST CONTROL	0.500		0	0	0	NR	NR	0
RES DECL	0.125		0	NR	NR	NR	NR	0
State and tribal voluntary cleanup sites								
VCP	0.500		0	0	0	NR	NR	0
INDIAN VCP	0.500		0	0	0	NR	NR	0
State and tribal Brownfields sites								
ERP	0.500		0	1	0	NR	NR	1
BROWNFIELDS	0.500		0	0	0	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	1	0	NR	NR	1
Local Lists of Landfill / Solid Waste Disposal Sites								
ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
SWTIRE	0.500		0	0	0	NR	NR	0
SWRCY	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US CDL	TP		NR	NR	NR	NR	NR	0
DEL SHWS	1.000		0	0	0	0	NR	0
US HIST CDL	TP		NR	NR	NR	NR	NR	0
Local Lists of Registered Storage Tanks								
HIST UST	0.250		0	0	NR	NR	NR	0
HIST AST	TP		NR	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Local Land Records								
LIENS 2	TP		NR	NR	NR	NR	NR	0
LIENS	TP		NR	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	TP		NR	NR	NR	NR	NR	0
NY Spills	0.125		21	NR	NR	NR	NR	21
NY Hist Spills	0.125		0	NR	NR	NR	NR	0
SPILLS 80	0.125		0	NR	NR	NR	NR	0
SPILLS 90	0.125		0	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		4	5	NR	NR	NR	9
DOT OPS	TP		NR	NR	NR	NR	NR	0
DOD	1.000		0	0	0	0	NR	0
FUDS	1.000		0	0	0	0	NR	0
CONSENT	1.000		0	0	0	0	NR	0
ROD	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
TSCA	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
HIST FTTS	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
ICIS	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
RADINFO	TP		NR	NR	NR	NR	NR	0
FINDS	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
RMP	TP		NR	NR	NR	NR	NR	0
HSWDS	0.500		0	0	0	NR	NR	0
UIC	TP		NR	NR	NR	NR	NR	0
MANIFEST	0.250		4	5	NR	NR	NR	9
DRYCLEANERS	0.250		0	2	NR	NR	NR	2
SPDES	TP		NR	NR	NR	NR	NR	0
AIRS	TP		NR	NR	NR	NR	NR	0
E DESIGNATION	0.125		0	NR	NR	NR	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
PRP	TP		NR	NR	NR	NR	NR	0
US AIRS	TP		NR	NR	NR	NR	NR	0
LEAD SMELTERS	TP		NR	NR	NR	NR	NR	0
EPA WATCH LIST	TP		NR	NR	NR	NR	NR	0
Financial Assurance	TP		NR	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
COAL ASH	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	TP		NR	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

<u>Database</u>	<u>Search Distance (Miles)</u>	<u>Target Property</u>	<u>< 1/8</u>	<u>1/8 - 1/4</u>	<u>1/4 - 1/2</u>	<u>1/2 - 1</u>	<u>> 1</u>	<u>Total Plotted</u>
US FIN ASSUR	TP		NR	NR	NR	NR	NR	0
COAL ASH DOE	TP		NR	NR	NR	NR	NR	0
<u>EDR HIGH RISK HISTORICAL RECORDS</u>								
<i>EDR Exclusive Records</i>								
EDR MGP	1.000		0	0	0	0	NR	0
EDR US Hist Auto Stat	0.250		9	4	NR	NR	NR	13
EDR US Hist Cleaners	0.250		1	1	NR	NR	NR	2
<u>EDR RECOVERED GOVERNMENT ARCHIVES</u>								
<i>Exclusive Recovered Govt. Archives</i>								
RGA LF	0.500		0	1	1	NR	NR	2
RGA HWS	1.000		0	0	0	0	NR	0

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

A1
NNW
< 1/8
0.002 mi.
9 ft

UNK TENNIS CLUB
HUNTINGTON R/R ST TRACK 1
HUNTINGTON STATION, NY

NY Spills S102567777
N/A

Site 1 of 5 in cluster A

Relative:
Higher

Actual:
219 ft.

SPILLS:

Facility ID: 9403996
DER Facility ID: 207049
Facility Type: ER
Site ID: 252766
DEC Region: 1
Spill Date: 11/11/1993
Spill Number/Closed Date: 9403996 / 2/4/1997
Spill Cause: Deliberate
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Wiling Responsible Party. Corrective action taken.

SWIS:

Investigator: NJACAMPO
Referred To: Not reported
Reported to Dept: 6/21/1994
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered in Computer: 6/22/1994
Spill Record Last Update: 2/5/1997
Spiller Name: Not reported
Spiller Company: TENNIS CLUB
Spiller Address: BROADWAY
Spiller City,St,Zip: HUNTINGTON STATION, ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ACAMPORA"10/10/95: This is additional information about material spilled from the translation of the old spill file: GRANULAR SUBSTANCE.NO ADDITIONAL ACTIONS POSSIBLE

Remarks:

LIRR EMPLOYEE FOUND SPILLAGE ALONG LIRR R.O.W, SPILLAGE IS UNK, GREEN MATERIAL USED FOR TENNIS COURTS, SPILLAGE COMING FROM CLUB W/O TRACKS, SAMPLE RESULTS TO FOLLOW

Material:

Site ID: 252766
Operable Unit ID: 997828
Operable Unit: 01
Material ID: 384150
Material Code: 0086A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EOR ID Number
EPA ID Number

UNK TENNIS CLUB (Continued)

S102567777

Resource Affected: Not reported
Oxygenate: False

Tank Test:

B2
WSW
< 1/8
0.003 mi.
16 ft.

TOWN PARKING LOT 22
RTE 110 & RAILROAD AVE
HUNTINGTON STATION, NY

NY Spills S106006091
N/A

Site 1 of 7 in cluster B

Relative:
Higher

Actual:
216 ft.

SPILLS:

Facility ID: 0225156
DER Facility ID: 247391
Facility Type: ER
Site ID: 306286
DEC Region: 1
Spill Date: 7/30/2002
Spill Number/Closed Date: 0225156 / 7/30/2002
Spill Cause: Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

SWIS:

Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 7/30/2002
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Police Department
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 7/30/2002
Spill Record Last Update: 7/31/2002
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City, St, Zip: ***Update***, ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Remarks:

"NONE"***SAME AS 0204508 (RECEIVED WHILE TAKING THIS CALL)***
FUEL OIL SPILL FROM A COMPRESSOR FIRE (ON VEHICLE? VEHICLE IS GONE?).
SPILLAGE IS SUPPOSEDLY IN A PARKING LOT. ***SAME AS 0204508 (RECEIVED
WHILE TAKING THIS CALL)***

Material:

Site ID: 306286
Operable Unit ID: 866572
Operable Unit: 01
Material ID: 512860
Material Code: 0001A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TOWN PARKING LOT 22 (Continued)

S106006091

Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 15
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

B3
WSW
< 1/8
0.003 mi.
16 ft.

LIRR
RAILROAD AVE & RTE 110
HUNTINGTON STATION, NY

NY Spills S102138727
N/A

Site 2 of 7 in cluster B

Relative:
Higher

Actual:
216 ft.

SPILLS:
Facility ID: 9012724
DER Facility ID: 112771
Facility Type: ER
Site ID: 130874
DEC Region: 1
Spill Date: 3/11/1991
Spill Number/Closed Date: 9012724 / 3/13/1991
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
5226
SWIS:
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 3/12/1991
CID: Not reported
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 3/13/1991
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 3/13/1991
Spill Record Last Update: 11/26/2007
Spiller Name: Not reported
Spiller Company: LIRR
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"NONE"FILE HAS BEEN DESTROYED ACCORDING TO STATE ARCHIVE AND RECORD
ADMINISTRATOR RETENTION/DISPOSAL PROCEDURES**ALL INFORMATION INCLUDED
IN DATABASE**
Remarks: BROKEN PIPE IN BASEMENT, SPEEDI DRY APPLIED, NO DRAINS IN BASEMENT,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LIRR (Continued)

S102138727

TYREE TO REMOVE DEBRIS. NO RESPONSE NEEDED

Material:

Site ID: 130874
Operable Unit ID: 952494
Operable Unit: 01
Material ID: 429190
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 10
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

A4
NNE
< 1/8
0.008 mi.
41 ft.

UNKNOWN
RTE 110 & BROADWAY
HUNTINGTON STATION, NY

NY Spills S104649657
N/A

Site 2 of 5 in cluster A

Relative:
Higher

Actual:
216 ft.

SPILLS:

Facility ID: 9907204
DER Facility ID: 88763
Facility Type: ER
Site ID: 99920
DEC Region: 1
Spill Date: 9/16/1999
Spill Number/Closed Date: 9907204 / 12/18/2001
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Unable/unwilling Responsible Party. Corrective action taken. (ISR)
SWIS: 5226
Investigator: JEHAAS
Referred To: Not reported
Reported to Dept: 9/16/1999
CID: 390
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/16/1999
Spill Record Last Update: 7/1/2010
Spiller Name: UNKNOWN
Spiller Company: UNKNOWN
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN, NY
Spiller Company: 999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

UNKNOWN (Continued)

S104649657

Contact Name: UNK
Contact Phone: (000) 000-0000
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "HAAS" CONSTRUCTION SITE HIT A TANK, OIL COMING OUT INTO ROAD AND IN DRAIN, FIRE CHIEF AND HUNTINGTON ENV CONTRAL ON SCENESPILL CLEANED BY CONTRACTOR RP, NO FURTHER ACTION REQUIRED
Remarks: unk type of oil spill coming out of the ground - going into the storm sewer

Material:
Site ID: 99920
Operable Unit ID: 1081504
Operable Unit: 01
Material ID: 299904
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

A5
NNE
< 1/8
0.008 mi.
41 ft.

LIRR
BROADWAY/RTE 110
HUNTINGTON STATION, NY
Site 3 of 5 in cluster A

NY Spills S103571814
N/A

Relative:
Higher

Actual:
216 ft.

SPILLS:
Facility ID: 9713516
DER Facility ID: 189957
Facility Type: ER
Site ID: 230475
DEC Region: 1
Spill Date: 3/5/1998
Spill Number/Closed Date: 9713516 / 3/17/1999
Spill Cause: Other
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:
Investigator: WJPARISH
Referred To: Not reported
Reported to Dept: 3/5/1998
CID: 322
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

LIRR (Continued)

S103571814

Date Entered In Computer: 3/5/1998
Spill Record Last Update: 3/18/1999
Spiller Name: Not reported
Spiller Company: LIRR
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: WUNDERLICH
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"PARISH"900 GAL UST REMOVED. 1-55 GAL DRUM OF CONT SOIL BOTTOM
SAMPLES OK,NO OTHER ACTION
Remarks: DURING EXCAVATION AN UNEXPECTED TANK WAS HIT AND SOME OIL SPILLED-
SOIL REMOVED & CLEANED UP -SPOKE TO NICK A.

Material:
Site ID: 230475
Operable Unit ID: 1056374
Operable Unit: 01
Material ID: 324531
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 3
Units: Gallons
Recovered: 3
Resource Affected: Not reported
Oxygenate: False

Tank Test:

A6
NNE
< 1/8
0.009 mi.
47 ft.

SPILL NUMBER 0204508
NEW YORK AVE/RAILROAD ST
HUNTINGTON, NY

NY Spills S106006116
N/A

Site 4 of 5 in cluster A

Relative:
Higher

Actual:
216 ft.

SPILLS:
Facility ID: 0204508
DER Facility ID: 98909
Facility Type: ER
Site ID: 113338
DEC Region: 1
Spill Date: 7/30/2002
Spill Number/Closed Date: 0204508 / 7/30/2002
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
SWIS: 5228
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 7/30/2002
CID: 396
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Local Agency

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPILL NUMBER 0204508 (Continued)

S106006116

Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 7/30/2002
Spill Record Last Update: 7/31/2002
Spiller Name: Not reported
Spiller Company: REGATEIRO CONTRACTORS
Spiller Address: 19 CORBIN AVENUE
Spiller City,St,Zip: BAY SHORE, NY 11706-
Spiller Company: 001
Contact Name: MATT GROSS
Contact Phone: (631) 427-6377
DEC Memo:

Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"NONE"AS PER GROSS, TOWN OF HUNTINGTON, HAS DIRECTED RP TO CLEAN,
TOWN WILL STAY ON SITE UNTIL CLEANUP IS COMPLETED. GROSS WILL UPDATE
DEC WHEN COMPLETE, NO RESPONSE REQUIRED. MATT GROSS-TOWN OF
HUNTINGTON-F&N HIRED, PUMPED OUT 2000 GALS OF WATER AND OIL, AND
CLEANED ROAD
Remarks: portable generator that was being towed behind a truck caught on fire
and burst a fuel line...material did get into storm sewer...unk
capacity of tank and unk how much was in it.

Material:
Site ID: 113338
Operable Unit ID: 857285
Operable Unit: 01
Material ID: 518755
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 15
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

A7
NNE
< 1/8
0.009 mi.
47 ft.

UNKNOWN
NEW YORK AVE/BROADWAY
HUNTINGTON, NY

NY Spills: S106125082
N/A

Site 5 of 5 in cluster A

Relative:
Higher

Actual:
216 ft.

SPILLS:
Facility ID: 0310671
DER Facility ID: 253122
Facility Type: ER
Site ID: 313914
DEC Region: 1
Spill Date: 12/16/2003
Spill Number/Closed Date: 0310671 / 12/16/2003
Spill Cause: Equipment Failure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNKNOWN (Continued)

S106125082

Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Unable/unwilling Responsible Party. Corrective action taken. (ISR)

SWIS: 5226

Investigator: UNASSIGNED

Referred To: Not reported

Reported to Dept: 12/16/2003

CID: 444

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 12/16/2003

Spill Record Last Update: 6/9/2011

Spiller Name: Not reported

Spiller Company: HUNTINGTON SEWER DIST

Spiller Address: Not reported

Spiller City,St,Zip: ZZ

Spiller Company: 001

Contact Name: JOHN PAVLIK

Contact Phone: (631) 421-1643

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "NONE"12/16/03 TELECON TO JOHN PAVLIK-HUNTINGTON SEWERESTIMATED 50 GALLONS RELEASED TO ROAD SURFACE, CREWS ARE WASHING THE SEWAGE BACK INTO THE SEWER MANHOLE WITH A MILD BLEACH SOLUTION.NO STORM WATER DRAINS IMPACTED, SCHD NOTIFIED, ATTEMPT TO CONTACT P HARDING AND T LEUNG DEC.NO CONTACT WAS MADE

Remarks: STOPPAGE IN A SEWER LINE CAUSED THE SEWER TO OVERFLOW, CLEANING UP WITH CHLORINE AT THIS TIME, NO RESPONSE IS NECESSARY THEY HAVE IT UNDER CONTROL.. ON THE SCENE.

Material:

Site ID: 313914

Operable Unit ID: 875757

Operable Unit: 01

Material ID: 499519

Material Code: 0062A

Material Name: RAW SEWAGE

Case No.: Not reported

Material FA: Other

Quantity: 10

Units: Gallons

Recovered: No

Resource Affected: Not reported

Oxygenate: False

Tank Test:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

B8 HUNTINGTON COMM FIRST AID
WSW 2 RAILROAD STREET
< 1/8 HUNTINGTON STATION, NY
0.021 mi.
113 ft. Site 3 of 7 in cluster B

LTANKS 1000458156
NY Spills N/A

Relative:
Higher

Actual:
214 ft.

LTANKS:

Site ID: 60612
Spill Number/Closed Date: 9010426 / 4/24/1991
Spill Date: 12/27/1990
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Cleanup Ceased: 4/24/1991
Cleanup Meets Standard: True
SWIS: 5226
Investigator: KMYAGER
Referred To: Not reported
Reported to Dept: 12/27/1990
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 12/28/1990
Spill Record Last Update: 7/27/2009
Spiller Name: JAMES BARKOCY
Spiller Company: HUNTINGTON STA FIRST AID
Spiller Address: Not reported
Spiller City, St, Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 366130
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"DEROSA"04/24/91: PASSED SYSTEM RETEST 1/19/91 AT - 019 AFTER
REPAIRING PIPING. NO FURTHER ACTION.

Remarks:

550 FAILED AT - 66 GPH. BONAFIDE TESTER. NO FURTHER ACTION PLANNED YET
Not reported

Material:

Site ID: 60612
Operable Unit ID: 950781
Operable Unit: 01
Material ID: 430585
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON COMM FIRST AID (Continued)

1000458156

Tank Test:

Site ID: 60612
Spill Tank Test: 1538093
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 60613
Spill Number/Closed Date: 9010441 / 4/24/1991
Spill Date: 12/27/1990
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Cleanup Ceased: 4/24/1991
Cleanup Meets Standard: True
SWIS: 5226
Investigator: KMYAGER
Referred To: Not reported
Reported to Dept: 12/27/1990
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0

Date Entered In Computer: 12/31/1990
Spill Record Last Update: 7/27/2009
Spiller Name: JIM BARKOCY
Spiller Company: HUNTINGTON COMM FIRST AID
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 366130

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"DEROSA"04/24/91: PASSED SYSTEM RETEST AFTER FIXING PETROMETER GAUGE
1/5/91 AT -.017, NO FURTHER ACTION.

Remarks: 2K FAILED AT -0.286. BONAFIDE TESTER. WILL EXCAVATE & RETEST ON 12/31

Material:

Site ID: 60613
Operable Unit ID: 947586
Operable Unit: 01
Material ID: 430599
Material Code: 0001A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON COMM FIRST AID (Continued)

1000458156

Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 60613
Spill Tank Test: 1538096
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

SPILLS:

Facility ID: 9808068
DER Facility ID: 366130
Facility Type: ER
Site ID: 60614
DEC Region: 1
Spill Date: 10/1/1998
Spill Number/Closed Date: 9808068 / 3/16/1999
Spill Cause: Equipment Failure
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
SWIS: 5226
Investigator: MJDARCAN
Referred To: Not reported
Reported to Dept: 10/1/1998
CID: 257
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 10/1/1998
Spill Record Last Update: 4/20/2013
Spiller Name: MS BROOKS
Spiller Company: HUNTINGTON COMMUNITY 1ST AID
Spiller Address: 2 RAILROAD STREET
Spiller City,St,Zip: HUNTINGTON STATION, NY 11746-001
Spiller Company: 001
Contact Name: MS BROOKS
Contact Phone: (516) 421-1253

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON COMM FIRST AID (Continued)

1000458156

DEC Memo: Prior to Sept. 2004 data translation this spill Lead_DEC Field was "DARCANGELO"ROUTINE TANK REMOVALTANKS REMOVED, 30 TONS CONTAMINATED/SOIL EXCAVATED AND DISPOSED OF. ENDPOINT SAMPLES INDENTIFIED PRESENCE OF SEMI VOLITLES. GEOPROBE INVESTIGATION TO DELINEATE EXTENT. SEMI VOLITLES NOT DETECTED IN TCLP EXTRACT OF SOIL SAMPLE 8-12" AT LEVELS ABOVE 20-30 PPB. NO FURTHER ACTION

Remarks: SMALL SPILL AROUND A 550 TANK CLEANUP IS STARTED

Material:
Site ID: 60614
Operable Unit ID: 1065838
Operable Unit: 01
Material ID: 315601
Material Code: 0006
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

B9
WSW
< 1/8
0.021 mi.
113 ft.

HUNTINGTON FIRST AID SQUAD INC
2 RAILROAD ST
HUNTINGTON STATION, NY
Site 4 of 7 in cluster B

RCRA NonGen / NLR 1004757446
FINDS NYD986935146
MANIFEST

Relative:
Higher

RCRA NonGen / NLR:
Date form received by agency: 01/01/2007
Facility name: HUNTINGTON FIRST AID SQUAD INC
Facility address: 2 RAILROAD ST
HUNTINGTON STATION, NY 11746
EPA ID: NYD986935146
Mailing address: RAILROAD ST
HUNTINGTON STATION, NY 11746
Contact: EILEEN BURNS
Contact address: RAILROAD ST
HUNTINGTON STATION, NY 11746
Contact country: US
Contact telephone: (516) 421-1263
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Actual:
214 ft.

Owner/Operator Summary:

Owner/operator name: HUNTINGTON FIRST AID SQUAD INC
Owner/operator address: 2 RAILROAD ST
HUNTINGTON STATION, NY 11746
Owner/operator country: US
Owner/operator telephone: (516) 421-1263
Legal status: Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON FIRST AID SQUAD INC (Continued)

1004757446

Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: HUNTINGTON FIRST AID SQUAD INC
Owner/operator address: 2 RAILROAD ST
HUNTINGTON STATION, NY 11746

Owner/operator country: US
Owner/operator telephone: (516) 421-1263
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: HUNTINGTON FIRST AID SQUAD INC
Classification: Not a generator, verified

Date form received by agency: 02/20/1992
Facility name: HUNTINGTON FIRST AID SQUAD INC
Site name: HUNTINGTON FIRST AID STATION
Classification: Large Quantity Generator

Date form received by agency: 01/04/1991
Facility name: HUNTINGTON FIRST AID SQUAD INC
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004458079

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON FIRST AID SQUAD INC (Continued)

1004757446

corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD986935146
Country: USA
Mailing Name: HUNTINGTON FIRST AID STATION
Mailing Contact: EILEEN BURNS
Mailing Address: RAILROAD AVENUE
Mailing Address 2: Not reported
Mailing City: HUNTINGTON STATION
Mailing State: NY
Mailing Zip: 11746
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 000-000-0000

Document ID: NYB2154834
Manifest Status: Completed copy
Trans1 State ID: PD1011
Trans2 State ID: Not reported
Generator Ship Date: 910222
Trans1 Recv Date: 910222
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910222
Part A Recv Date: 910313
Part B Recv Date: 910307
Generator EPA ID: NYD986935146
Trans1 EPA ID: NYD077444263
Trans2 EPA ID: Not reported
TSD ID: NYD077444263
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00330
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 006
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

C10
NE
< 1/8
0.037 mi.
194 ft.

HUNTINGTON COMMUTER GARAGE
NY AVE & BROADWAY
HUNTINGTON, NY

NY Spills S102097995
N/A

Site 1 of 2 in cluster C

Relative:
Higher

SPILLS:

Facility ID: 9302940
DER Facility ID: 112153
Facility Type: ER
Site ID: 130163
DEC Region: 1
Spill Date: 6/4/1993
Spill Number/Closed Date: 9302940 / 6/14/1994
Spill Cause: Human Error
Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Actual:
215 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON COMMUTER GARAGE (Continued)

S102097995

Willing Responsible Party. Corrective action taken.
SWIS: 5226
Investigator: RDDECAND
Referred To: Not reported
Reported to Dept: 6/4/1993
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 6/14/1994
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 6/8/1993
Spill Record Last Update: 11/18/2008
Spiller Name: Not reported
Spiller Company: FERRAN BROS
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"DECANDIA"UST PUNCTURED THOUGHT TO BE EMPTY, CONT SOIL REMOVED &
DISPOSED OF.
Remarks: CONSTRUCTION IN PROGRESS, TANK WAS PUNCTURED. ATTEMPTING TO ARRANGE
TANK PUMPED OUT, & REMOVEDREQUEST RESPONSE
Material:
Site ID: 130163
Operable Unit ID: 984946
Operable Unit: 01
Material ID: 400048
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 200
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EOR ID Number
EPA ID Number

B11
WNW
< 1/8
0.038 mi.
203 ft.

RESIDENCE
6 COLUMBIA STREET
SOUTH HUNTINGTON, NY

NY Spills S110308672
N/A

Site 5 of 7 in cluster B

Relative:
Higher

Actual:
219 ft.

SPILLS:

Facility ID: 1001386
DER Facility ID: 389313
Facility Type: ER
Site ID: 434435
DEC Region: 1
Spill Date: 5/5/2010
Spill Number/Closed Date: 1001386 / 6/7/2010
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

SWIS:

Investigator: Unassigned
Referred To: Not reported
Reported to Dept: 5/5/2010
CID: Not reported
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/5/2010
Spill Record Last Update: 12/23/2010
Spiller Name: BRUCE GRANT
Spiller Company: HUNTINGTON COMMUNITY DEVELOPMENT AGENCY
Spiller Address: 100 MAIN STREET
Spiller City,St,Zip: HUNTINGTON, NY 11743
Spiller Company: 999
Contact Name: GLEN BONELLI
Contact Phone: Not reported
DEC Memo: 05/05/2010-NH 15:28-Glen Bonelli left for the day spoke with Glen called back 15:34 above ground outside 275 Fuel Oil, Valve leaked spilled onto soil, approx 2' X 2' contractor will be removing the soil next week. Tank has been removed, will call after soil is removed and make appt for an inspection

Remarks:

UNKNOWN AMOUNT SPILLED DUE TO FAULTY VALVE ON TANK. TANK HAS BEEN REMOVED, CLEANUP PENDING.

Material:

Site ID: 434435
Operable Unit ID: 1185263
Operable Unit: 01
Material ID: 2179573
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RESIDENCE (Continued)

S110308672

Resource Affected: Not reported
Oxygenate: False

Tank Test:

C12
NE
< 1/8
0.038 mi.
203 ft.

ALL AMERICAN OIL CORP
NY AVENUE & BROADWAY
HUNTINGTON, NY

LTANKS S102668471
N/A

Site 2 of 2 in cluster C

Relative:
Higher

Actual:
215 ft.

LTANKS:

Site ID: 84903
Spill Number/Closed Date: 8807750 / 12/31/1988
Spill Date: 12/22/1988
Spill Cause: Tank Overfill
Spill Source: Tank Truck
Spill Class: Not reported
Cleanup Ceased: 12/31/1988
Cleanup Meets Standard: True
SWIS: 5226
Investigator: NJACAMPO
Referred To: Not reported
Reported to Dept: 12/22/1988
CID: Not reported
Water Affected: Not reported
Spill Notifier: Affected Persons
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 12/27/1988
Spill Record Last Update: 5/25/2006
Spiller Name: Not reported
Spiller Company: ALL AMERICAN OIL CORP
Spiller Address: 265 ROBINS LANE
Spiller City,St,Zip: SYOSSET, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 78051
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
*ACAMPORA FD*12/27/88: AREA CHECKED ON CONCRETE & CLEANED UP. NO
OTHER ACTION.FILE HAS BEEN DESTROYED ACCORDING TO STATE ARCHIVE AND
RECORD ADMINISTRATOR RETENTION/DISPOSAL PROCEDURES
Remarks: CONCRETE BASEMENT FLOOR AFFECTED. CONTRACTOR TO CLEANUP

Material:

Site ID: 84903
Operable Unit ID: 924308
Operable Unit: 01
Material ID: 456069
Material Code: 0001A
Material Name: #2 Fuel Oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALL AMERICAN OIL CORP (Continued)

S102668471

Case No.: Not reported
Material FA: Petroleum
Quantity: 10
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

B13
WSW
< 1/8
0.039 mi.
207 ft.

UNKNOWN
5 RAILROAD ST
HUNTINGTON STATION, NY 11746

NY Spills S113405167
N/A

Site 6 of 7 in cluster B

Relative:
Higher

SPILLS:

Facility ID: 1215818
DER Facility ID: 434421
Facility Type: ER
Site ID: 479150
DEC Region: 1
Spill Date: 2/25/2013
Spill Number/Closed Date: 1215818 / Not Reported
Spill Cause: Traffic Accident
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Actual:
213 ft.

SWIS:

Investigator: Unassigned
Referred To: Not reported
Reported to Dept: 2/25/2013
CID: Not reported
Water Affected: Not reported
Spill Source: Vessel
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 1
Date Entered In Computer: 2/25/2013
Spill Record Last Update: 3/25/2013
Spiller Name: FRANK NAGLIERI
Spiller Company: NATIONAL GRID/LIPA
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: FRANK NAGLIERI
Contact Phone: (917) 578-0161
DEC Memo: POLE #7
Remarks: Caller reporting a spill of 30 gallons of transformer oil to pavement due to MVA. Clean up pending crew arrival.-----07:27 - Caller states that is has been discovered that 2 sewers and a cesspool was involved.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNKNOWN (Continued)

S113405167

Material:
Site ID: 479150
Operable Unit ID: 1228892
Operable Unit: 01
Material ID: 2226633
Material Code: 0020A
Material Name: TRANSFORMER OIL
Case No.: Not reported
Material FA: Petroleum
Quantity: 30
Units: Gallons
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

B14
WSW
< 1/8
0.039 mi.
207 ft.

5 RAILROAD ST
HUNTINGTON STATION, NY 11746

EDR US Hist Auto Stat 1015520975
N/A

Site 7 of 7 in cluster B

Relative:
Higher

Actual:
213 ft.

EDR Historical Auto Stations:

Name: JO DAN AUTOMOTIVE SPECIALIS
Year: 1999
Address: 5 RAILROAD ST

Name: JO DAN AUTOMOTIVE SPECIALIS
Year: 2000
Address: 5 RAILROAD ST

Name: JO DAN AUTO SPECIALISTS
Year: 2001
Address: 5 RAILROAD ST

Name: JO DAN AUTO SPECIALISTS
Year: 2002
Address: 5 RAILROAD ST

Name: JO DAN AUTOMOTIVE SPCLST
Year: 2003
Address: 5 RAILROAD ST

Name: JO DAN AUTOMOTIVE
Year: 2004
Address: 5 RAILROAD ST

Name: JODAN AUTOMOBILE SPECIALIST
Year: 2005
Address: 5 RAILROAD ST

Name: JODAN AUTOMOBILE SPECIALIST
Year: 2006
Address: 5 RAILROAD ST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

1015520975

Name: JODAN AUTOMOBILE SPECIALIST
Year: 2007
Address: 5 RAILROAD ST

Name: JODAN AUTOMOBILE SPECIALIST
Year: 2008
Address: 5 RAILROAD ST

Name: JODAN AUTOMOBILE SPECIALIST
Year: 2009
Address: 5 RAILROAD ST

Name: JODAN AUTOMOTIVE SPECIALISTS
Year: 2010
Address: 5 RAILROAD ST

Name: JODAN AUTOMOTIVE SPECIALISTS
Year: 2011
Address: 5 RAILROAD ST

Name: JODAN AUTOMOTIVE SPECIALISTS
Year: 2012
Address: 5 RAILROAD ST

15
NW
< 1/8
0.045 mi.
237 ft.

207 LOWNDES AVE
HUNTINGTON STATION, NY 11746

EDR US Hist Cleaners: 1015015597
N/A

Relative:
Higher

EDR Historical Cleaners:

Name: LOWNDES AVENUE LAUNDROMAT
Year: 2000
Address: 207 LOWNDES AVE

Name: LOWNDES AV LAUNDROMAT
Year: 2001
Address: 207 LOWNDES AVE

Name: LOWNDES AV LAUNDROMAT
Year: 2002
Address: 207 LOWNDES AVE

Name: LOWNDES AV LAUNDROMAT
Year: 2003
Address: 207 LOWNDES AVE

Name: ALVAREZ LAUNDRY CORP
Year: 2003
Address: 207 LOWNDES AVE

Name: ALVAREZ LAUNDRY CORP
Year: 2004
Address: 207 LOWNDES AVE

Name: ALVAREZ LAUNDRY CORP
Year: 2005
Address: 207 LOWNDES AVE

Actual:
221 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

(Continued)

1015015597

Name: ALVAREZ LAUNDRY CORP
Year: 2006
Address: 207 LOWNDES AVE

Name: ALVAREZ LAUNDRY CORP
Year: 2007
Address: 207 LOWNDES AVE

Name: ALVAREZ LAUNDRY CORP
Year: 2008
Address: 207 LOWNDES AVE

Name: ALVAREZ LAUNDRY CORP
Year: 2009
Address: 207 LOWNDES AVE

Name: ALVAREZ LAUNDRY CORP
Year: 2010
Address: 207 LOWNDES AVE

Name: ALVAREZ LAUNDRY CORPORATION
Year: 2011
Address: 207 LOWNDES AVE

Name: ALVAREZ LAUNDRY CORPORATION
Year: 2012
Address: 207 LOWNDES AVE

D16
WSW
< 1/8
0.062 mi.
325 ft.

CENTURY COLLISION OF HUNT CORP
12 RAILROAD ST
HUNTINGTON STATION, NY

RCRA NonGen / NLR
FINDS
MANIFEST

1000422542
NYD982184442

Relative:
Lower

Actual:
210 ft.

Site 1 of 4 in cluster D

RCRA NonGen / NLR:

Date form received by agency: 01/01/2007
Facility name: CENTURY COLLISION OF HUNT CORP
Facility address: 12 RAILROAD ST
HUNTINGTON STATION, NY 117481259
EPA ID: NYD982184442
Mailing address: RAILROAD ST
HUNTINGTON STATION, NY 11748
Contact: Not reported
Contact address: RAILROAD ST
HUNTINGTON STATION, NY 11748
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler. Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: DENNIS FRERES
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

CENTURY COLLISION OF HUNT CORP (Continued)

1000422542

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: DENNIS FRERES
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999

Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: CENTURY COLLISION OF HUNT CORP
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: CENTURY COLLISION OF HUNT CORP
Classification: Not a generator, verified

Date form received by agency: 05/27/1987
Facility name: CENTURY COLLISION OF HUNT CORP
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004415543

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTURY COLLISION OF HUNT CORP (Continued)

1000422542

program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD982184442
Country: USA
Mailing Name: CENTURY COLLISION
Mailing Contact: CENTURY COLLISION
Mailing Address: 12 RAILROAD STREET
Mailing Address 2: Not reported
Mailing City: HUNTINGTON STATION
Mailing State: NY
Mailing Zip: 11746
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 516-421-1008

Document ID: NJA0628093
Manifest Status: Completed copy
Trans1 State ID: NJDEPS103
Trans2 State ID: Not reported
Generator Ship Date: 890605
Trans1 Recv Date: 890605
Trans2 Recv Date: Not reported
TSD Site Recv Date: 890606
Part A Recv Date: 890620
Part B Recv Date: 890615
Generator EPA ID: NYD982184442
Trans1 EPA ID: NJD980787147
Trans2 EPA ID: Not reported
TSD ID: NJD002454544
Waste Code: F005 - UNKNOWN
Quantity: 00110
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 89

Document ID: NJA1490860
Manifest Status: Completed copy
Trans1 State ID: NJDEPS103
Trans2 State ID: Not reported
Generator Ship Date: 920707
Trans1 Recv Date: 920707
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920707
Part A Recv Date: 920824
Part B Recv Date: 920717
Generator EPA ID: NYD982184442
Trans1 EPA ID: NJD986608941
Trans2 EPA ID: Not reported
TSD ID: NJD002454544

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTURY COLLISION OF HUNT CORP (Continued)

1000422542

Waste Code: F003 - UNKNOWN
Quantity: 00025
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 92

Document ID: NJA1009450
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: NJDEPS103
Trans2 State ID: Not reported
Generator Ship Date: 900507
Trans1 Recv Date: 900507
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900508
Part A Recv Date: 900711
Part B Recv Date: 900627
Generator EPA ID: NYD982184442
Trans1 EPA ID: NJD980787147
Trans2 EPA ID: Not reported
TSDf ID: NJD002454544
Waste Code: F005 - UNKNOWN
Quantity: 00010
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 90

Document ID: NJA1769502
Manifest Status: Completed copy
Trans1 State ID: NJDEPS103
Trans2 State ID: Not reported
Generator Ship Date: 930914
Trans1 Recv Date: 930914
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930914
Part A Recv Date: 931027
Part B Recv Date: 931001
Generator EPA ID: NYD982184442
Trans1 EPA ID: NJD986608941
Trans2 EPA ID: Not reported
TSDf ID: NJD002454544
Waste Code: F003 - UNKNOWN
Quantity: 00030
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 93

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTURY COLLISION OF HUNT CORP (Continued)

1000422542

Document ID: NYA5747139
Manifest Status: Completed copy
Trans1 State ID: PLATE#
Trans2 State ID: 57745GB
Generator Ship Date: 870605
Trans1 Recv Date: 870605
Trans2 Recv Date: Not reported
TSD Site Recv Date: 870605
Part A Recv Date: 870612
Part B Recv Date: 870629
Generator EPA ID: NYD982184442
Trans1 EPA ID: NYD000824334
Trans2 EPA ID: Not reported
TSD ID: NYD000824334
Waste Code: F003 - UNKNOWN
Quantity: 00055
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 87

Document ID: NJA1159567
Manifest Status: Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID: NJDEPS103
Trans2 State ID: Not reported
Generator Ship Date: 910506
Trans1 Recv Date: 910506
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910507
Part A Recv Date: 910621
Part B Recv Date: 910522
Generator EPA ID: NYD982184442
Trans1 EPA ID: NJD980787147
Trans2 EPA ID: Not reported
TSD ID: NJD002454544
Waste Code: F003 - UNKNOWN
Quantity: 00040
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 91

Document ID: NYA6458193
Manifest Status: Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID: PLATE#
Trans2 State ID: MY7783
Generator Ship Date: 880602
Trans1 Recv Date: 880602
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880602
Part A Recv Date: 880715

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTURY COLLISION OF HUNT CORP (Continued)

1000422542

Part B Recv Date: 880828
Generator EPA ID: NYD982184442
Trans1 EPA ID: NYD000824334
Trans2 EPA ID: Not reported
TSDF ID: NYD000824334
Waste Code: F003 - UNKNOWN
Quantity: 00110
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 88

D17
WSW
< 1/8
0.062 mi.
325 ft.

12 RAILROAD ST
HUNTINGTON STATION, NY 11746

EDR US Hist Auto Stat 1015177589
N/A

Site 2 of 4 in cluster D

Relative:
Lower

EDR Historical Auto Stations:

Actual:
210 ft.

Name: MARKHAM COLLISION INC
Year: 2001
Address: 12 RAILROAD ST

Name: MARKHAM COLLISION INC
Year: 2002
Address: 12 RAILROAD ST

Name: MARKHAM COLLISION INC
Year: 2003
Address: 12 RAILROAD ST

Name: MARKHAM COLLISION INC
Year: 2004
Address: 12 RAILROAD ST

Name: MARKHAM COLLISION INC
Year: 2005
Address: 12 RAILROAD ST

Name: MARKHAM COLLISION & GLASS CORP
Year: 2006
Address: 12 RAILROAD ST

Name: MARKHAM COLLISION & GLASS CORP
Year: 2008
Address: 12 RAILROAD ST

Name: MARKHAM COLLISION INC
Year: 2010
Address: 12 RAILROAD ST

Name: MARKHAM COLLISION INC
Year: 2011
Address: 12 RAILROAD ST

Name: MARKHAM COLLISION INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EPA ID Number
EDR ID Number

(Continued)

1015177589

Year: 2012
Address: 12 RAILROAD ST

E18
SSE
< 1/8
0.063 mi.
335 ft.

1291 NEW YORK AVE
HUNTINGTON STATION, NY 11746

EDR US Hist Auto Stat 1015199284
N/A

Site 1 of 12 in cluster E

Relative:
Lower

EDR Historical Auto Stations:

Actual:
208 ft.

Name:	IMPORT CAR TECHNIK
Year:	2001
Address:	1291 NEW YORK AVE
Name:	IMPORT CAR TECHNIK
Year:	2002
Address:	1291 NEW YORK AVE
Name:	RXR EUROPEAN CAR TECHNIK INC
Year:	2003
Address:	1291 NEW YORK AVE
Name:	RXR EUROPEAN CAR TECHNIK INC
Year:	2004
Address:	1291 NEW YORK AVE
Name:	RXR EUROPEAN CAR TECHNIK INC
Year:	2005
Address:	1291 NEW YORK AVE
Name:	EUROPEAN CAR TECHNIQUES RXR
Year:	2007
Address:	1291 NEW YORK AVE
Name:	EUROPEAN CAR TECHNIQUES RXR
Year:	2008
Address:	1291 NEW YORK AVE
Name:	RXR EUROPEAN CAR TECHNIK INC
Year:	2009
Address:	1291 NEW YORK AVE
Name:	EUROPEAN CAR TECHNIQUE RXR
Year:	2011
Address:	1291 NEW YORK AVE
Name:	JUSTIN BROWN AUTOMOBILE RPR SERVICE
Year:	2012
Address:	1291 NEW YORK AVE

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

E19 BOOZER'S PUB (FORMERLY)
SSE 1268 NEW YORK AVE
< 1/8 HUNTINGTON, NY
0.068 mi.
359 ft. Site 2 of 12 in cluster E

NY Spills S110611553
N/A

Relative:
Lower

SPILLS:

Actual:
208 ft.

Facility ID: 1007783
DER Facility ID: 396262
Facility Type: ER
Site ID: 441231
DEC Region: 1
Spill Date: 10/22/2010
Spill Number/Closed Date: 1007783 / 7/18/2011
Spill Cause: Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

SWIS:

Investigator: TJDEMEO
Referred To: Not reported
Reported to Dept: 10/22/2010
CID: Not reported
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Health Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 10/22/2010
Spill Record Last Update: 8/1/2011
Spiller Name: Not reported
Spiller Company: TOWN OF HUNTINGTON
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported

DEC Memo:

COULD NOT DETERMINE WHETHER THERE ARE ANY PRIOR REPORTS HERE
DR10/22/10 1120 Hrs (A): Bodula called to report the incident- SHE SAID THIS SITE USED TO BE "BOOZER'S PUB", AND THE TOWN IS ACQUIRING IT FOR A COMMUNITY CENTER. 10/22/10 1120 Hrs (B): Aarco removed a previously abandoned 550gal tank, and H2M is on site to take endpoint samples. 10/22/10 1120 Hrs (C): She documented a faint odor and a PID reading of 13ppm in the soil, and inquired whether this needed to be reported. DR told her it should, and directed her to have any soil exhibiting odors excavated before the endpoint samples were taken. DR7/19/11 TJDfile review. SCDOH (Bedula) attended tank removal on 10/22/10 - no holes noted in tank. Less than 1/3 of drum of petroleum impacted soils were reported excavated from tank grave to a clean endpoint under DOH oversight. No disposal documentation has been received. No DEC inspection performed. Less than 5 cu yds of petroleum contaminated soils were excavated during remedial process. No further action is required. Administrative closure.

Remarks:

AARCO REMOVED A PREVIOUSLY ABANDONED 550GAL TANK. BODULA DOCUMENTED A FAINT ODOR AND A PID READING OF 13PPM IN THE SOIL.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOZER'S PUB (FORMERLY) (Continued)

S110611553

Material:
Site ID: 441231
Operable Unit ID: 1191797
Operable Unit: 01
Material ID: 2186991
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

E20
SSE
< 1/8
0.079 mi.
419 ft.

JIFFY LUBE
1297 NEW YORK AVE
HUNTINGTON, NY 11743

Site 3 of 12 in cluster E

Relative:
Lower

Actual:
208 ft.

RCRA NonGen / NLR
Date form received by agency: 01/01/2007
Facility name: JIFFY LUBE
Facility address: 1297 NEW YORK AVE
HUNTINGTON, NY 11743
EPA ID: NYD980775092
Mailing address: 13TH AVE
RONKONKOMA, NY 11779
Contact: Not reported
Contact address: 13TH AVE
RONKONKOMA, NY 11779
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

RCRA NonGen / NLR
FINDS
LTANKS
MANIFEST
NY Spills
1000231206
NYD980775092

Owner/Operator Summary:

Owner/operator name: EMPIRE LUBE INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: EMPIRE LUBE INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

JIFFY LUBE (Continued)

1000231206

Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: JIFFY LUBE
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: JIFFY LUBE
Classification: Not a generator, verified

Date form received by agency: 08/03/1984
Facility name: JIFFY LUBE
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004391505

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

LTANKS:

Site ID: 244489
Spill Number/Closed Date: 9307366 / 12/7/1993
Spill Date: 9/16/1993

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JIFFY LUBE (Continued)

1000231206

Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: No spill occurred. (Not Possible)
Cleanup Ceased: 12/7/1993
Cleanup Meets Standard: True
SWIS: 5200
Investigator: T/T/F
Referred To: Not reported
Reported to Dept: 9/16/1993
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered in Computer: 9/20/1993
Spill Record Last Update: 1/26/2001
Spiller Name: Not reported
Spiller Company: JIFFY LUBE
Spiller Address: Not reported
Spiller City, St, Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 200624
DEC Memo: Not reported
Remarks: 3K FAILED GROSS LEAK, F&N TESTER,

Material:

Site ID: 244489
Operable Unit ID: 988441
Operable Unit: 01
Material ID: 393631
Material Code: 0022
Material Name: Waste Oil/Used Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False
Site ID: 244489
Operable Unit ID: 988441
Operable Unit: 01
Material ID: 393630
Material Code: 0013
Material Name: Lube Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

JIFFY LUBE (Continued)

1000231206

Oxygenate: False

Tank Test:

Site ID: 244489
Spill Tank Test: 1542002
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

NY MANIFEST:

EPA ID: NYD980775092
Country: USA
Mailing Name: JIFFY LUBE
Mailing Contact: RAY HESS
Mailing Address: 1297 NEW YORK AVENUE
Mailing Address 2: Not reported
Mailing City: HUNTINGTON
Mailing State: NY
Mailing Zip: 11746
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 516-423-6006

Document ID: MAG2255210
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: 100E30MD
Trans2 State ID: Not reported
Generator Ship Date: 920618
Trans1 Recv Date: 920618
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920619
Part A Recv Date: Not reported
Part B Recv Date: 920724
Generator EPA ID: NYD980775092
Trans1 EPA ID: MAD039322250
Trans2 EPA ID: Not reported
TSDf ID: MAD053452637
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00015
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92

Document ID: NYA3015674
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

JIFFY LUBE (Continued)

1000231206

Trans1 State ID: 25391GTNY
Trans2 State ID: Not reported
Generator Ship Date: 860623
Trans1 Recv Date: 860623
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860623
Part A Recv Date: 860811
Part B Recv Date: 860702
Generator EPA ID: NYD980775092
Trans1 EPA ID: NYD980526024
Trans2 EPA ID: Not reported
TSD ID: NYD980526024
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00150
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 078
Year: 86

Document ID: NYA3014932
Manifest Status: Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID: 67787GUNY
Trans2 State ID: Not reported
Generator Ship Date: 860604
Trans1 Recv Date: 860604
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860604
Part A Recv Date: 860716
Part B Recv Date: 860618
Generator EPA ID: NYD980775092
Trans1 EPA ID: NYD980526024
Trans2 EPA ID: Not reported
TSD ID: NYD980526024
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00777
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 078
Year: 86

Document ID: NYA3072071
Manifest Status: Completed copy
Trans1 State ID: 20056GTNY
Trans2 State ID: Not reported
Generator Ship Date: 860711
Trans1 Recv Date: 860711
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860718
Part A Recv Date: 860729
Part B Recv Date: 860801
Generator EPA ID: NYD980775092

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

JIFFY LUBE (Continued)

1000231206

Trans1 EPA ID: NYD980526024
Trans2 EPA ID: Not reported
TSD ID: NYD980526024
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00887
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 078
Year: 86

Document ID: NYA3013931
Manifest Status: Completed copy
Trans1 State ID: 20056GTNY
Trans2 State ID: Not reported
Generator Ship Date: 860516
Trans1 Recv Date: 860516
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860516
Part A Recv Date: 860603
Part B Recv Date: 860523
Generator EPA ID: NYD980775092
Trans1 EPA ID: NYD980526024
Trans2 EPA ID: Not reported
TSD ID: NYD980526024
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 01157
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 078
Year: 86

Document ID: NYA3013356
Manifest Status: Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID: 000000000
Trans2 State ID: Not reported
Generator Ship Date: 860421
Trans1 Recv Date: 860421
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860421
Part A Recv Date: 860604
Part B Recv Date: 860425
Generator EPA ID: NYD980775092
Trans1 EPA ID: NYD980526024
Trans2 EPA ID: Not reported
TSD ID: NYD980526024
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00740
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: B Incineration, heat recovery, burning.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

JIFFY LUBE (Continued)

1000231206

Specific Gravity: 078
Year: 86

SPILLS:

Facility ID: 8602253
DER Facility ID: 197575
Facility Type: ER
Site ID: 240264
DEC Region: 1
Spill Date: 7/7/1986
Spill Number/Closed Date: 8602253 / 7/30/1986
Spill Cause: Deliberate
Spill Class: Not reported
SWIS: 5226
Investigator: SCHD
Referred To: SCHD
Reported to Dept: 7/7/1986
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Citizen
Cleanup Ceased: 7/30/1986
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 7/17/1986
Spill Record Last Update: 2/6/2006
Spiller Name: Not reported
Spiller Company: JIFFY LUBE
Spiller Address: Not reported
Spiller City, St, Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo:

Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SCDH FD" // ; REFERRED TO A. YERMAN & SCDH. 10/10/95: This is additional information about material spilled from the translation of the old spill file: ANTI-FREEZE FILE HAS BEEN DESTROYED ACCORDING TO STATE ARCHIVE AND RECORD ADMINISTRATOR RETENTION/DISPOSAL PROCEDURES COMPANY DOES FLUSH & FILLS OF ANTI-FREEZE IN DRAINS ON PROPERTY.

Remarks:

Material:

Tank Test:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

E21
SSE 1297 NEW YORK AVE EDR US Hist Auto Stat 1015199834
< 1/8 HUNTINGTON STATION, NY 11746 N/A

0.079 mi.
419 ft. Site 4 of 12 in cluster E

Relative: EDR Historical Auto Stations:
Lower Name: JIFFY LUBE
Year: 1999
Actual: Address: 1297 NEW YORK AVE
208 ft. Name: JIFFY LUBE
Year: 2000
Address: 1297 NEW YORK AVE

D22 IFO RESIDENCE NY Spills S105141475
SW 29 RAILROAD AVENUE N/A
< 1/8 HUNTINGTON STATION, NY

0.084 mi.
442 ft. Site 3 of 4 in cluster D

Relative: SPILLS:
Lower Facility ID: 0105193
DER Facility ID: 66000
Actual: Facility Type: ER
207 ft. Site ID: 69418
DEC Region: 1
Spill Date: 8/13/2001
Spill Number/Closed Date: 0105193 / 9/27/2001
Spill Cause: Other
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required.
SWIS: 5226
Investigator: HMCIRRI
Referred To: Not reported
Reported to Dept: 8/13/2001
CID: 252
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/13/2001
Spill Record Last Update: 11/4/2009
Spiller Name: UNKNOWN
Spiller Company: UNKNOWN
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN, NY
Spiller Company: 999
Contact Name: MATT GROSS
Contact Phone: (631) 554-3230
DEC Memo: Prior to Sept. 2004 data translation this spill Lead_DEC Field was "CIRRI" AS PER GROSS; OIL ODOR IN THE AIR, HE BELIEVES THAT OIL IS AROUND EDGES OF PUDDLE. ENTIRE ROAD IS FLOODED AND ADJACENT PROPERTIES ARE FLOODED. UNK SOURCE, UNK AMT, CAN'T DO ANYTHING NOW,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

I/O RESIDENCE (Continued)

S105141475

Remarks:

HE HAS LEFT THE SCENE, NO RESPONSE REQUIRED UNABLE TO LOCATE A SOURCE, NO FURTHER ACTION DUE TO RAIN STORM HAPPENING AT THIS TIME AT LEAST 8 HOMES ARE FLOODED I/O OF RESIDENCES- IT IS BELIEVED THAT RAIN MAY BE FLOODING AN UNDERGROUND OIL TANK WHICH IS FORCING OIL UP INTO THE PUDDLE. CALLERS PAGER #631-554-3230.

Material:

Site ID: 69418
Operable Unit ID: 842109
Operable Unit: 01
Material ID: 533670
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

23
West
< 1/8
0.089 mi.
468 ft.

DEJESUS RESIDENCE
37 COLUMBIA STREET
HUNTINGTON STATION, NY

NY Spills S102138768
N/A

Relative:
Higher

Actual:
216 ft.

SPILLS:

Facility ID: 9213878
DER Facility ID: 69713
Facility Type: ER
Site ID: 74221
DEC Region: 1
Spill Date: 3/17/1993
Spill Number/Closed Date: 9213878 / 7/8/1994
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS: 5200
Investigator: KAKISPER
Referred To: Not reported
Reported to Dept: 3/18/1993
CID: Not reported
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: 7/8/1994
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 3/19/1993
Spill Record Last Update: 7/8/1994

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DEJESUS RESIDENCE (Continued)

S102138768

Spiller Name: Not reported
Spiller Company: DEJESUS RESIDENCE
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"KISPERT"07/08/94: AFFECTED SOIL REMOVED, NO NEED FOR FURTHER ACTION,
MR DEJESUS WAS SUPPOSE TO CALL SPILL IN VIA ANS RECOMMENDATION
Remarks:

Material:
Site ID: 74221
Operable Unit ID: 981340
Operable Unit: 01
Material ID: 403629
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

E24 UNKNOWN
SSE 1290 NEW YORK AVENUE
< 1/8 HUNTINGTON, NY

NY Spills S104649201
N/A

0.091 mi.
482 ft.

Site 5 of 12 in cluster E

Relative:
Lower

SPILLS:

Facility ID: 9903435
DER Facility ID: 146575
Facility Type: ER
Site ID: 174239
DEC Region: 1
Spill Date: 6/24/1999
Spill Number/Closed Date: 9903435 / 6/8/2005
Spill Cause: Deliberate
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Actual:
208 ft.

SWIS:
Investigator: BPAUSTIN
Referred To: Not reported
Reported to Dept: 6/24/1999
CID: 207
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Police Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNKNOWN (Continued)

S104649201

UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 6/24/1999
Spill Record Last Update: 4/27/2010
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller Company: 001
Contact Name: SUFFOLK CO PD
Contact Phone: (516) 854-5707
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"AUSTIN"6/25 8:50 UPDATE FROM BA, RESPONDED TO SITE, HAD DRYWELLS
PUMPED OUT, AWAITING ANALYSIS SAMPLES
Remarks: appears a deliberate dumping of unk material into storm drainspd and
fd on scene

Material:
Site ID: 174239
Operable Unit ID: 1078034
Operable Unit: 01
Material ID: 303353
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 110
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

D25 UNKNOWN
SW 20 RAILROAD ST/NY AVENUE
< 1/8 HUNTINGTON STATION, NY
0.093 mi.
489 ft. Site 4 of 4 in cluster D

NY Spills S104647874
NA

Relative: SPILLS:
Lower Facility ID: 9807418
DER Facility ID: 219466
Actual: Facility Type: ER
206 ft. Site ID: 269470
DEC Region: 1
Spill Date: 9/17/1998
Spill Number/Closed Date: 9807418 / 12/2/1999
Spill Cause: Traffic Accident
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
SWIS: 5226
Investigator: BPAUSTIN
Referred To: Not reported
Reported to Dept: 9/17/1998
CID: 255
Water Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

UNKNOWN (Continued)

S104647874

Spill Source: Commercial Vehicle
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/17/1998
Spill Record Last Update: 3/23/2013
Spiller Name: ALFRED
Spiller Company: GEORGE HILDEBRANDT INC
Spiller Address: 412 STONE MILL ROAD
Spiller City,St,Zip: HUDSON, ZZ
Spiller Company: 001
Contact Name: KEITH GUTERMAN
Contact Phone: (516) 427-1629
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
*AUSTIN*CLEANUP COMPLETED BY MEG, MINIMAL SOLID WASTE GENERATED. NO
FURTHER ACTION REQUIRED
Remarks: TRACTOR TRAILER PULLING INTO A LOT RIPPED OPEN SADDLE TANKS - 25GALS
LEFT IN TANK - CONTAINMENT IN PROGRESS - LOCAL TOWN SPILL RESPONSE
NOTIFIED
Material:
Site ID: 289470
Operable Unit ID: 1064982
Operable Unit: 01
Material ID: 318507
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 110
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

E26
SSE
< 1/8
0.095 mi.
503 ft.

CARMEL COLLISION
8 DEPOT RD
HUNTINGTON STATION, NY 11746

RCRA NonGen / NLR 1000297353
FINDS NYD091449157
MANIFEST

Relative:
Lower

RCRA NonGen / NLR:

Date form received by agency: 01/01/2007

Facility name: CARMEL COLLISION

Facility address: 8 DEPOT RD
HUNTINGTON STATION, NY 117461736

EPA ID: NYD091449157

Mailing address: DEPOT RD
HUNTINGTON STATION, NY 11746

Contact: Not reported

Contact address: DEPOT RD

Actual:
208 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CARMEL COLLISION (Continued)

1000297353

HUNTINGTON STATION, NY 11746

Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: SCOTT GOODMAN
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 89999

Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: SCOTT GOODMAN
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 89999

Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: CARMEL COLLISION
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: CARMEL COLLISION
Classification: Not a generator, verified

Date form received by agency: 05/08/1987

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CARMEL COLLISION (Continued)

1000297353

Facility name: CARMEL COLLISION
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004373936

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD091449157
Country: USA
Mailing Name: CARMEL COLLISION
Mailing Contact: CARMEL COLLISION
Mailing Address: 8 DEPOT ROAD
Mailing Address 2: Not reported
Mailing City: HUNTINGTON STATION
Mailing State: NY
Mailing Zip: 11746
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 516-351-9343

Document ID: NJA0950880
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: 00000000
Trans2 State ID: 00000000
Generator Ship Date: 900904
Trans1 Recv Date: 900904
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900905
Part A Recv Date: 901009
Part B Recv Date: 900910
Generator EPA ID: NYD091449157
Trans1 EPA ID: NJD980787147
Trans2 EPA ID: Not reported
TSDf ID: NJD002454544
Waste Code: F005 - UNKNOWN
Quantity: 00090
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 90

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CARMEL COLLISION (Continued)

1000297353

Document ID: NJA0298870
Manifest Status: Completed copy
Trans1 State ID: NJDEPS-10
Trans2 State ID: Not reported
Generator Ship Date: 871028
Trans1 Recv Date: 871028
Trans2 Recv Date: Not reported
TSD Site Recv Date: 871029
Part A Recv Date: 871106
Part B Recv Date: 871105
Generator EPA ID: NYD091449157
Trans1 EPA ID: NJD980787147
Trans2 EPA ID: Not reported
TSD ID: NJD002454544
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00042
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 87

Document ID: NJA0298858
Manifest Status: Completed copy
Trans1 State ID: NJDEPS-10
Trans2 State ID: Not reported
Generator Ship Date: 880426
Trans1 Recv Date: 880426
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880426
Part A Recv Date: 880429
Part B Recv Date: 880503
Generator EPA ID: NYD091449157
Trans1 EPA ID: NJD980787147
Trans2 EPA ID: Not reported
TSD ID: NJD002454544
Waste Code: F005 - UNKNOWN
Quantity: 00055
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 88

E27
SSE
< 1/8
0.095 mi.
503 ft.

8 DEPOT RD
HUNTINGTON STATION, NY 11746

Site 7 of 12 in cluster E

Relative:
Lower

EDR Historical Auto Stations:

Name: TRIPLE G AUTO REPAIR & COLLISION
Year: 1999
Address: 8 DEPOT RD

Actual:
208 ft.

EDR US Hist Auto Stat 1015636391
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EPA ID Number
EDR ID Number

(Continued)

1015636391

Name: TRIPLE G AUTO REPAIR & COLLISION
Year: 2000
Address: 8 DEPOT RD

Name: TRIPLE G AUTO REPAIR & CLSN
Year: 2003
Address: 8 DEPOT RD

Name: TRIPLE G AUTO REPAIR & COLLISION
Year: 2005
Address: 8 DEPOT RD

Name: TRIPLE G AUTO REPAIR & COLLISION
Year: 2006
Address: 8 DEPOT RD

Name: STRICTLY BUSINESS AUTO BODY INC
Year: 2007
Address: 8 DEPOT RD

Name: SKUFFY AUTOBODY INC
Year: 2009
Address: 8 DEPOT RD

Name: SKUFFY AUTOBODY INC
Year: 2010
Address: 8 DEPOT RD

Name: TRIPLE G AUTO REPAIRS & COLLISION
Year: 2011
Address: 8 DEPOT RD

Name: TRIPLE G AUTO REPR & COLLISION
Year: 2012
Address: 8 DEPOT RD

E28 USA GAS STATION
SSE 1290 NEW YORK AVE
< 1/8 HUNTINGTON STATION, NY
0.096 mi.
509 ft. Site 8 of 12 in cluster E

NY Spills S110044305
N/A

Relative: SPILLS:
Lower Facility ID: 0010095
DER Facility ID: 388942
Actual: Facility Type: ER
207 ft. Site ID: 176817
DEC Region: 1
Spill Date: 12/7/2000
Spill Number/Closed Date: 0010095 / 12/7/2000
Spill Cause: Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

SWIS:
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 12/7/2000
CID: 312

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA GAS STATION (Continued)

S110044305

Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/7/2000
Spill Record Last Update: 2/6/2012
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller Company: 001
Contact Name: MIRZA ALIAHMAD
Contact Phone: (631) 673-6436
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"NONE"12/7/00 1325 SPOKE TO MR. ALIAHMAD - COMMERCIAL VAN WITH 2
TANKS, PLATE #DU446F - "GAS TANK STARTED LEAKING" - WAS CONTAINED
W/BUCKET & SORBENTS - NO DRAINS IMPACTED - DRIVER CLAIMED HE TOLD
ATTENDANT NOT TO PUT GAS IN THAT TANK
Remarks: CUSTOMER'S VEH LEAKED IN CALLER'S PARKING LOT - CLEANED UP W/ SPILL
KIT

Material:
Site ID: 176817
Operable Unit ID: 831065
Operable Unit: 01
Material ID: 544016
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 6
Units: Gallons
Recovered: 6
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Facility ID: 9808502
DER Facility ID: 437992
Facility Type: ER
Site ID: 176818
DEC Region: 1
Spill Date: 10/8/1998
Spill Number/Closed Date: 9808502 / 11/17/1998
Spill Cause: Human Error
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
SWIS: 5226
Investigator: BMFORD
Referred To: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA GAS STATION (Continued)

S110044305

Reported to Dept: 10/8/1998
CID: 382
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered in Computer: 10/8/1998
Spill Record Last Update: 6/4/2013
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,SLZip: NY
Spiller Company: 999
Contact Name: MIRZA ALIAHMAD
Contact Phone: (718) 847-7134
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"FORD"10/9/98 12:20 TELECON BD, MIRZA ALIAHMAD, LEFT MESSAGENO
ACTIONS POSSIBLE
Remarks: SUBJ DROVE AWAY WITH NOZZLE IN CAR. SPILL WAS DISPIRSED BY RAIN.

Material:

Site ID: 176818
Operable Unit ID: 1069695
Operable Unit: 01
Material ID: 316006
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 3
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Facility ID: 0908214
DER Facility ID: 369825
Facility Type: ER
Site ID: 420803
DEC Region: 1
Spill Date: 10/21/2009
Spill Number/Closed Date: 0908214 / 1/5/2010
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
SWIS: 5226
Investigator: hmcimt
Referred To: Not reported
Reported to Dept: 10/21/2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA GAS STATION (Continued)

S110044305

CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 10/21/2009
Spill Record Last Update: 1/28/2010
Spiller Name: BORA KALE
Spiller Company: USA GAS
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: BORA KALE
Contact Phone: (631) 871-4575
DEC Memo: ***THERE DO NOT APPEAR TO BE ANY ACTIVE SPILLS HERE*** DR:10/22/09

Remarks: 0835 Hrs (A): As per TD- he called Hall, who responded to the scene. 10/22/09 0835 Hrs (B): THE "HOLDING TANK" IS ACTUALLY THE DISPENSER PAN. The dispenser was shut down pending repairs. 10/22/09 0835 Hrs (C): The spillage was cleaned up. DRNO FURTHER ACTION
Total of 5 gallons : 2 on concrete 3 in holding tank; Clean up complete.

Material:
Site ID: 420803
Operable Unit ID: 1176742
Operable Unit: 01
Material ID: 2169445
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 5
Units: Gallons
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

E29 USA 3 BROTHERS 1 CORP
SSE 1290 NEW YORK AVE
< 1/8 HUNTINGTON STATION, NY 11746
0.096 mi.
509 ft. Site 9 of 12 in cluster E

UST U003537350
N/A

Relative: SUFFOLK CO. UST:
Lower Region: SUFFOLK
Site Ref#: 03070
Actual: Status: ACTIVE
207 ft. Site Type: PBS
Operating Permit Expires: 12/31/2015
Owner/Storage Information: AVAILABLE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Facility Info:

Site Ref#: 03070
Billing Contact: OLSON PROPERTIES LLC
Billing Address: 816 WEST NECK RD
Billing Address: NOBLEBORO
Billing State: ME
Billing Address: 04555
Storage Owner: OLSON PROPERTIES LLC
Storage Owner Address: 816 WEST NECK RD
Storage Owner City: NOBLEBORO
Storage Owner State: ME
Storage Owner Zip: 04555

Tank Info:

Facility ID: 03070
Facility Reference #: Not reported
Official Use: Not reported
Township: Not reported
Tax Map No: Not reported
Region: SUFFOLK
Permit to Operate: Not reported

Tank ID: 1
Tank Key: Not reported
Installed: Not reported
Capacity: 2000 gallons
Content: GASOLINE
Date Removed: Not reported
Construction: STEEL/ IRON
Dispenser: SUCTION
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: REMOVED
Total Capacity: 2000 gallons
Date Permitted: Not reported
Date Closed: 01/01/1983
Internal Protection: NONE
Secondary Containment: NONE
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: Not reported
Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Tank ID: 1
Tank Key: 2354B

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Installed: 48
Capacity: 0000002000
Content: GASOLINE
Date Removed: 010183
Construction: STEEL
Dispenser: SUCTION
Fill Type: GRAVITY
Tank Location: UNDER-OUT
Tank Status: Not reported
Total Capacity: 0000002000
Date Permitted: Not reported
Date Closed: Not reported
Internal Protection: Not reported
Secondary Containment: Not reported
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: GRAVITY
Date Removed: 010183
Year Installed: 48
Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 2
Tank Key: Not reported
Installed: Not reported
Capacity: 3000 gallons
Content: GASOLINE
Date Removed: Not reported
Construction: STEEL/ IRON
Dispenser: SUCTION
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: REMOVED
Total Capacity: 3000 gallons
Date Permitted: Not reported
Date Closed: 01/01/1983
Internal Protection: NONE
Secondary Containment: NONE
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Tank ID: 2
Tank Key: 23549
Installed: 48
Capacity: 000003000
Content: GASOLINE
Date Removed: 010183
Construction: STEEL
Dispenser: SUCTION
Fill Type: GRAVITY
Tank Location: UNDER-OUT
Tank Status: Not reported
Total Capacity: 000003000
Date Permitted: Not reported
Date Closed: Not reported
Internal Protection: Not reported
Secondary Containment: Not reported
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: GRAVITY
Date Removed: 010183
Year Installed: 48
Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 3
Tank Key: Not reported
Installed: Not reported
Capacity: 5000 gallons
Content: GASOLINE
Date Removed: Not reported
Construction: STEEL/ IRON
Dispenser: SUCTION
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: REMOVED
Total Capacity: 5000 gallons
Date Permitted: Not reported
Date Closed: 01/01/1983
Internal Protection: NONE
Secondary Containment: NONE
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: Not reported
Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Tank ID: 3
Tank Key: 23550
Installed: 48
Capacity: 0000005000
Content: GASOLINE
Date Removed: 010183
Construction: STEEL
Dispenser: SUCTION
Fill Type: GRAVITY
Tank Location: UNDER-OUT
Tank Status: Not reported
Total Capacity: 0000005000
Date Permitted: Not reported
Date Closed: Not reported
Internal Protection: Not reported
Secondary Containment: Not reported
External Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: GRAVITY
Date Removed: 010183
Year Installed: 48
Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 4
Tank Key: 23551
Installed: 56
Capacity: 0000002000
Content: GASOLINE
Date Removed: 010183
Construction: STEEL
Dispenser: SUCTION
Fill Type: GRAVITY
Tank Location: UNDER-OUT
Tank Status: Not reported
Total Capacity: 0000002000
Date Permitted: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Date Closed: Not reported
Internal Protection: Not reported
Secondary Containment: Not reported
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: GRAVITY
Date Removed: 010183
Year Installed: 56
Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 4
Tank Key: Not reported
Installed: Not reported
Capacity: 2000 gallons
Content: GASOLINE
Date Removed: Not reported
Construction: STEEL/ IRON
Dispenser: SUCTION
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: REMOVED
Total Capacity: 2000 gallons
Date Permitted: Not reported
Date Closed: 01/01/1983
Internal Protection: NONE
Secondary Containment: NONE
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: Not reported
Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Tank ID: 5
Tank Key: 23552
Installed: 70
Capacity: 0000004000
Content: GASOLINE
Date Removed: 010183

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EOR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Construction: STEEL
Dispenser: SUCTION
Fill Type: GRAVITY
Tank Location: UNDER-OUT
Tank Status: Not reported
Total Capacity: 000004000
Date Permitted: Not reported
Date Closed: Not reported
Internal Protection: Not reported
Secondary Containment: Not reported
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: GRAVITY
Date Removed: 010183
Year Installed: 70
Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 5
Tank Key: Not reported
Installed: Not reported
Capacity: 4000 gallons
Content: GASOLINE
Date Removed: Not reported
Construction: STEEL/ IRON
Dispenser: SUCTION
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: REMOVED
Total Capacity: 4000 gallons
Date Permitted: Not reported
Date Closed: 01/01/1983
Internal Protection: NONE
Secondary Containment: NONE
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: Not reported
Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Tank ID: 6
Tank Key: 23553
Installed: 73
Capacity: 000004000
Content: GASOLINE
Date Removed: 010183
Construction: STEEL
Dispenser: SUCTION
Fill Type: GRAVITY
Tank Location: UNDER-OUT
Tank Status: Not reported
Total Capacity: 000004000
Date Permitted: Not reported
Date Closed: Not reported
Internal Protection: Not reported
Secondary Containment: Not reported
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: GRAVITY
Date Removed: 010183
Year Installed: 73
Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 6
Tank Key: Not reported
Installed: Not reported
Capacity: 4000 gallons
Content: GASOLINE
Date Removed: Not reported
Construction: STEEL/ IRON
Dispenser: SUCTION
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: REMOVED
Total Capacity: 4000 gallons
Date Permitted: Not reported
Date Closed: 01/01/1983
Internal Protection: NONE
Secondary Containment: NONE
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Date Next Tank Test:	Not reported
Fill:	Not reported
Date Removed:	Not reported
Year Installed:	Not reported
Description of drop records:	Not reported
Tank ID:	7
Tank Key:	Not reported
Installed:	Not reported
Capacity:	12000 gallons
Content:	GASOLINE
Date Removed:	Not reported
Construction:	FIBER REINFORCED PLASTIC
Dispenser:	SUCTION
Fill Type:	Not reported
Tank Location:	UNDER - OUT
Tabk Status:	REMOVED
Total Capacity:	12000 gallons
Date Permitted:	Not reported
Date Closed:	04/18/2007
Internal Protection:	NONE
Secondary Containment:	NONE
Extrenal Protection:	Not reported
Leak Detection:	(ATG) IN TANK LEAK DETECTION
Overfill Prevention:	Not reported
Spill Prevention:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe External Protection:	Not reported
Pipe Containment:	Not reported
Pipe Leak Detection:	Not reported
Date Next Tank Test:	Not reported
Fill:	Not reported
Date Removed:	Not reported
Year Installed:	Not reported
Description of drop records:	Not reported
Tank ID:	7
Tank Key:	23554
Installed:	83
Capacity:	0000012000
Content:	GASOLINE
Date Removed:	Not reported
Construction:	FRP
Dispenser:	SUCTION
Fill Type:	GRAVITY
Tank Location:	UNDER-OUT
Tabk Status:	Not reported
Total Capacity:	0000012000
Date Permitted:	Not reported
Date Closed:	Not reported
Internal Protection:	Not reported
Secondary Containment:	Not reported
Extrenal Protection:	Not reported
Leak Detection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: GRAVITY
Date Removed: Not reported
Year Installed: 83
Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 8
Tank Key: Not reported
Installed: Not reported
Capacity: 550 gallons
Content: WASTE OIL
Date Removed: Not reported
Construction: STEEL/ IRON
Dispenser: SUCTION
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: REMOVED
Total Capacity: 550 gallons
Date Permitted: Not reported
Date Closed: 09/11/1996
Internal Protection: NONE
Secondary Containment: NONE
External Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: Not reported
Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Tank ID: 8
Tank Key: 23555
Installed: 48
Capacity: 000000550
Content: WASTE OIL
Date Removed: 091196
Construction: STEEL
Dispenser: SUCTION
Fill Type: GRAVITY
Tank Location: UNDER-OUT
Tank Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Total Capacity: 000000550
Date Permitted: Not reported
Date Closed: Not reported
Internal Protection: Not reported
Secondary Containment: Not reported
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: GRAVITY
Date Removed: 091196
Year Installed: 48
Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 9
Tank Key: Not reported
Installed: Not reported
Capacity: 12000 gallons
Content: GASOLINE
Date Removed: Not reported
Construction: FIBER REINFORCED PLASTIC
Dispenser: SUCTION
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: REMOVED
Total Capacity: 12000 gallons
Date Permitted: Not reported
Date Closed: 04/18/2007
Internal Protection: NONE
Secondary Containment: NONE
Extrenal Protection: Not reported
Leak Detection: (ATG) IN TANK LEAK DETECTION
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: Not reported
Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Tank ID: 9
Tank Key: 23556
Installed: 83
Capacity: 0000012000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s) EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Content:	GASOLINE
Date Removed:	Not reported
Construction:	FRP
Dispenser:	SUCTION
Fill Type:	GRAVITY
Tank Location:	UNDER-OUT
Tank Status:	Not reported
Total Capacity:	0000012000
Date Permitted:	Not reported
Date Closed:	Not reported
Internal Protection:	Not reported
Secondary Containment:	Not reported
Extrenal Protection:	Not reported
Leak Detection:	Not reported
Overfill Prevention:	Not reported
Spill Prevention:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe External Protection:	Not reported
Pipe Containment:	Not reported
Pipe Leak Detection:	Not reported
Date Next Tank Test:	Not reported
Fill:	GRAVITY
Date Removed:	Not reported
Year Installed:	83
Description of drop records:	RECORDS AS OF 09/10/2013
Tank ID:	10
Tank Key:	Not reported
Installed:	Not reported
Capacity:	8000 gallons
Content:	GASOLINE
Date Removed:	Not reported
Construction:	FIBER REINFORCED PLASTIC
Dispenser:	SUCTION
Fill Type:	Not reported
Tank Location:	UNDER - OUT
Tank Status:	REMOVED
Total Capacity:	8000 gallons
Date Permitted:	Not reported
Date Closed:	04/18/2007
Internal Protection:	NONE
Secondary Containment:	NONE
Extrenal Protection:	Not reported
Leak Detection:	(ATG) IN TANK LEAK DETECTION
Overfill Prevention:	Not reported
Spill Prevention:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe External Protection:	Not reported
Pipe Containment:	Not reported
Pipe Leak Detection:	Not reported
Date Next Tank Test:	Not reported
Fill:	Not reported
Date Removed:	Not reported
Year Installed:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)
EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Description of drop records: Not reported

Tank ID: 10
Tank Key: 23557
Installed: 83
Capacity: 0000008000
Content: GASOLINE
Date Removed: Not reported
Construction: FRP
Dispenser: SUCTION
Fill Type: GRAVITY
Tank Location: UNDER-OUT
Tank Status: Not reported
Total Capacity: 0000008000
Date Permitted: Not reported
Date Closed: Not reported
Internal Protection: Not reported
Secondary Containment: Not reported
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: GRAVITY
Date Removed: Not reported
Year Installed: 83
Description of drop records: RECORDS AS OF 09/10/2013

Tank ID: 12
Tank Key: Not reported
Installed: Not reported
Capacity: 12000 gallons
Content: GASOLINE
Date Removed: Not reported
Construction: FIBER REINFORCED PLASTIC
Dispenser: SUBMERSIBLE
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: IN SERVICE
Total Capacity: 12000 gallons
Date Permitted: 05/31/2007
Date Closed: Not reported
Internal Protection: NONE
Secondary Containment: SECONDARY WALL - FIBERGLASS
Extrenal Protection: NONE
Leak Detection: (DWP) ELECTRONIC LEAK PROBES
Overfill Prevention: - Electronic Leak Alarm
Spill Prevention: SPILL/FILL BOX AND/OR SUMP
Pipe Location: UNDERGROUND ONLY
Pipe Type: FIBERGLASS (FRP)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EOR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Pipe External Protection: NONE
Pipe Containment: FIBERGLASS (FRP)
Pipe Leak Detection: ELECTRONIC LEAK PROBE ONLY
Date Next Tank Test: Not reported
Fill: Not reported
Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Tank ID: 13
Tank Key: Not reported
Installed: Not reported
Capacity: 8000 gallons
Content: GASOLINE
Date Removed: Not reported
Construction: FIBER REINFORCED PLASTIC
Dispenser: SUBMERSIBLE
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: IN SERVICE
Total Capacity: 8000 gallons
Date Permitted: 05/31/2007
Date Closed: Not reported
Internal Protection: NONE
Secondary Containment: SECONDARY WALL - FIBERGLASS
External Protection: NONE
Leak Detection: (DWP) ELECTRONIC LEAK PROBES
Overfill Prevention: - Electronic Leak Alarm
Spill Prevention: SPILL/FILL BOX AND/OR SUMP
Pipe Location: UNDERGROUND ONLY
Pipe Type: FIBERGLASS (FRP)
Pipe External Protection: NONE
Pipe Containment: FIBERGLASS (FRP)
Pipe Leak Detection: ELECTRONIC LEAK PROBE ONLY
Date Next Tank Test: Not reported
Fill: Not reported
Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Tank ID: 14
Tank Key: Not reported
Installed: Not reported
Capacity: 4000 gallons
Content: DIESEL
Date Removed: Not reported
Construction: FIBER REINFORCED PLASTIC
Dispenser: SUBMERSIBLE
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: IN SERVICE
Total Capacity: 4000 gallons
Date Permitted: 05/31/2007
Date Closed: Not reported
Internal Protection: NONE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EOR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

U003537350

Secondary Containment:	SECONDARY WALL - FIBERGLASS
Extrenal Protection:	NONE
Leak Detection:	(DWP) ELECTRONIC LEAK PROBES
Overfill Prevention:	- Electronic Leak Alarm
Spill Prevention:	SPILL/FILL BOX AND/OR SUMP
Pipe Location:	UNDERGROUND ONLY
Pipe Type:	FIBERGLASS (FRP)
Pipe External Protection:	NONE
Pipe Containment:	FIBERGLASS (FRP)
Pipe Leak Detection:	ELECTRONIC LEAK PROBE ONLY
Date Next Tank Test:	Not reported
Fill:	Not reported
Date Removed:	Not reported
Year Installed:	Not reported
Description of drop records:	Not reported

E30
SSE
< 1/8
0.096 mi.
509 ft.

USA 3 BROTHERS 1 CORP
1290 NEW YORK AVE
HUNTINGTON STATION, NY 11746

AST A100264746
N/A

Site 10 of 12 in cluster E

Relative:
Lower

AST_SUFFOLK:
Region: SUFFOLK
Site Ref#: 03070
Status: ACTIVE
Site Type: PBS
Operating Permit Expires: 12/31/2015
Owner/Storage Information: AVAILABLE

Actual:
207 ft.

Facility Info:
Site Ref#: 03070
Billing Contact: OLSON PROPERTIES LLC
Billing Address: 816 WEST NECK RD
Billing Address: NOBLEBORO
Billing State: ME
Billing Address: 04555
Storage Owner: OLSON PROPERTIES LLC
Storage Owner Address: 816 WEST NECK RD
Storage Owner City: NOBLEBORO
Storage Owner State: ME
Storage Owner Zip: 04555

Tank Info:
Facility ID: 03070
Facility Reference #: Not reported
Township: Not reported
Tax Map No: Not reported
Region: SUFFOLK

Tank ID: 11
Tank Key: Not reported
Year Installed: Not reported
Content: #2 FUEL OIL
Construction: STEEL/ IRON
Dispenser: SUCTION
Official Use: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USA 3 BROTHERS 1 CORP (Continued)

A100264746

Permit to Operate:	Not reported
Tank Location:	ABOVE - OUT
Tabk Status:	REMOVED
Total Capacity:	275 gallons
Date Permitted:	Not reported
Date Closed:	10/16/2002
Internal Protection:	NONE
Secondary Containment:	NONE
Extrenal Protection:	Not reported
Leak Detection:	Not reported
Overfill Prevention:	Not reported
Spill Prevention:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe External Protection:	Not reported
Pipe Containment:	Not reported
Pipe Leak Detection:	Not reported
Date Next Tank Test:	Not reported
Fill:	Not reported
Date Removed:	Not reported
Tank ID:	11
Tank Key:	23558
Year Installed:	Not reported
Content:	#2 FUEL OIL
Construction:	STEEL
Dispenser:	SUCTION
Official Use:	Removed Tank. 02
Permit to Operate:	Not reported
Tank Location:	ABOVE-OUT
Tabk Status:	Not reported
Total Capacity:	000000275
Date Permitted:	Not reported
Date Closed:	Not reported
Internal Protection:	Not reported
Secondary Containment:	Not reported
Extrenal Protection:	Not reported
Leak Detection:	Not reported
Overfill Prevention:	Not reported
Spill Prevention:	Not reported
Pipe Location:	Not reported
Pipe Type:	Not reported
Pipe External Protection:	Not reported
Pipe Containment:	Not reported
Pipe Leak Detection:	Not reported
Date Next Tank Test:	Not reported
Fill:	GRAVITY
Date Removed:	101602

MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Site

Database(s)

EDR ID Number
 EPA ID Number

E31
 SSE
 < 1/8
 0.096 mi.
 509 ft.

1290 NEW YORK AVE
 HUNTINGTON STATION, NY 11746

Site 11 of 12 in cluster E

EDR US Hist Auto Stat 1015199080
 N/A

Relative:
 Lower

EDR Historical Auto Stations:

Name: AMOCO GAS STATION
 Year: 1999
 Address: 1290 NEW YORK AVE

Actual:
 207 ft.

Name: AMOCO GAS STATION
 Year: 2000
 Address: 1290 NEW YORK AVE

Name: ZAM PETROLEUM
 Year: 2001
 Address: 1290 NEW YORK AVE

Name: ZAM PETROLEUM INC
 Year: 2002
 Address: 1290 NEW YORK AVE

Name: AMOCO GASOLINE STATION
 Year: 2011
 Address: 1290 NEW YORK AVE

Name: AMOCO
 Year: 2012
 Address: 1290 NEW YORK AVE

E32
 SSE
 < 1/8
 0.105 mi.
 552 ft.

10 DEPOT RD
 HUNTINGTON STATION, NY 11746

Site 12 of 12 in cluster E

EDR US Hist Auto Stat 1015116613
 N/A

Relative:
 Lower

EDR Historical Auto Stations:

Name: S & S AUTOMOTIVE REPAIRS
 Year: 2003
 Address: 10 DEPOT RD

Actual:
 207 ft.

Name: S & S AUTOMOTIVE REPAIRS INC
 Year: 2005
 Address: 10 DEPOT RD

Name: S & S AUTOMOTIVE REPAIRS INC
 Year: 2006
 Address: 10 DEPOT RD

Name: S & S AUTOMOTIVE REPAIRS INC
 Year: 2007
 Address: 10 DEPOT RD

Name: S & S AUTOMOTIVE REPAIRS INC
 Year: 2008
 Address: 10 DEPOT RD

MAP FINDINGS

Map ID Direction Distance Elevation	Site	Database(s)	EDR ID Number EPA ID Number
--	------	-------------	--------------------------------

F33
NW
 < 1/8
 0.105 mi.
 557 ft.

EDR US Hist Auto Stat 1015251903
 N/A

160 LOWNDES AVE
HUNTINGTON STATION, NY 11746

Site 1 of 3 in cluster F

Relative: Higher	EDR Historical Auto Stations:	Name: ARCO MANAGEMENT CORPORATION Year: 1999 Address: 160 LOWNDES AVE
Actual: 225 ft.		Name: ARCO MANAGEMENT CORPORATION Year: 2000 Address: 160 LOWNDES AVE
		Name: ARCO MANAGEMENT CORP Year: 2004 Address: 160 LOWNDES AVE
		Name: ARCO MANAGEMENT CORP Year: 2005 Address: 160 LOWNDES AVE
		Name: ARCO MANAGEMENT CORP Year: 2006 Address: 160 LOWNDES AVE

G34
East
 < 1/8
 0.107 mi.
 564 ft.

NY Spills S102091410
 N/A

LIRR
E/O HUNTINGTON STATION
HUNTINGTON, NY

Site 1 of 2 in cluster G

Relative: Higher	SPILLS:	Facility ID: 8804613 DER Facility ID: 149273
Actual: 212 ft.		Facility Type: ER Site ID: 177651 DEC Region: 1 Spill Date: 8/25/1988 Spill Number/Closed Date: 8804613 / 10/31/1988 Spill Cause: Traffic Accident Spill Class: Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
		SWIS: 5226 Investigator: WJPARISH Referred To: Not reported Reported to Dept: 8/25/1988 CID: Not reported Water Affected: Not reported Spill Source: Railroad Car Spill Notifier: Responsible Party Cleanup Ceased: 10/31/1988 Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False UST Trust: False Remediation Phase: 0 Date Entered in Computer: 9/2/1988 Spill Record Last Update: 3/23/2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LIRR (Continued)

S102091410

Spiller Name: Not reported
Spiller Company: LIRR
Spiller Address: 1121 JAMAICA-JAMAICA STA.
Spiller City,St,Zip: JAMAICA, NY 11435
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "PARISH"08/25/88: A: INITIAL REPORT RECEIVED FROM ROBERT VALONIS-LIRR (718-990-8204). TRAIN HIT BACKHOE STUCK AT PARK AVE RAILROAD CROSSING IN HUNTINGTON. 08/25/88: B: 1500-3000 GAL OF DIESEL FUEL SPILLED FROM LOCOMOTIVE'S FUEL TANKS. DEC RESPONSE REQUESTED. 08/25/88: C: DEC (PARISH) ON SITE. TYREE HIRED BY LIRR TO CLEANUP PUDDLES OF DIESEL FUEL. LOCOMOTIVE NEEDS TO BE MOVED TO ALLOW FOR EXCAVATION. (HAVE PHOTOS.)08/25/88: D: BACKHOE OWNER: ANKE CONNICK & HENRY CONNICK, DBA A&H DRAINAGE, 1086 MASTIC RD, MASTIC, NY 11950. BACKHOE TRANSPORTER: HUBBARD EQUIPMENT CO, PO BOX 419, WHISKEY RD, CORAM, NY 11727. 08/29/88: DEC WRITES DISPOSAL LETTER FOR HUNTINGTON LANDFILL FOR 200 CU. YDS. OF CONTAMINATED DEBRIS. 08/30/88: TYREE CONTINUES TO CLEANUP, EXCAVATING CONTAMINATED SOIL AND BALLAST FROM TRACKS AND RAILROAD SIDING. DEC ON SITE TO CHECK PROGRESS. 08/31/88: TYREE CONTINUES TO CLEANUP - DEC CHECKS CLEANUP PROGRESS. 09/02/88: DEC ON SITE WITH LIRR REPRESENTATIVE TO DO 9 SOIL BORINGS FOR ADDITIONAL CLEANUP IN SIDING AREA AT KLEET LUMBER YARD (HAVE SKETCH). 09/07/88: A: LIRR REP REQUESTS DEC TO COME TO SITE - KLEET LUMBER IS PUMPING OUT CATCHBASINS TO SIDING AREA RECENTLY CLEANED UP. 09/07/88: B: SAMPLES TAKEN BY DEC OF 2 PUDDLES IN SIDING AREA AND TAKEN TO PEDNEAULT LABS. KLEET LUMBER CLAIMS LIQUIDS IN CATCHBASINS FROM SPILL/ACCIDENT. CATCHBASINS WERE CLOGGED. 10/05/88: PEDNEAULT SAMPLE RESULTS INDICATE SOME PETROLEUM PRODUCTS. 10/20/88: DEC (O'NEILL) ON SITE. TYREE AND LIRR REMOVING ADDITIONAL SOIL ALONG KLEET LUMBER SIDING. CLEANUP COMPLETED. 10/31/88: SPILL CLOSED IN REGIONAL FILES. NO FURTHER REMEDIAL ACTION REQUIRED AT THIS TIME.500-1000 GALS OIL AND WATER REMOVED & 220 YDS OF SOIL, 10/20/88 WORK FINISHED AT SIDING BY LIRR & TYREE
Remarks: TRAIN HIT BACKHOE ON TRACKS. LOCOMOTIVE FUEL TANK PUNCTURED.

Material:
Site ID: 177651
Operable Unit ID: 919727
Operable Unit: 01
Material ID: 456550
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 3000
Units: Gallons
Recovered: 1000
Resource Affected: Not reported
Oxygenate: False

Tank Test:

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

G35
East
< 1/8
0.107 mi.
564 ft.

LONG ISLAND TRAIN STATION
SOUTH PARKING GARAGE
HUNTINGTON, NY

NY Spills S103483996
N/A

Site 2 of 2 in cluster G

Relative:
Higher

Actual:
212 ft.

SPILLS:

Facility ID: 9806401
DER Facility ID: 81741
Facility Type: ER
Site ID: 89495
DEC Region: 1
Spill Date: 8/24/1998
Spill Number/Closed Date: 9806401 / 11/17/1998
Spill Cause: Equipment Failure
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

SWIS:

Investigator: BMFORD
Referred To: Not reported
Reported to Dept: 8/24/1998
CID: 365
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/24/1998
Spill Record Last Update: 3/11/2013
Spiller Name: MATT GROSS
Spiller Company: TOWN OF HUNTINGTON
Spiller Address: 641 NEW YORK AVENUE
Spiller City,St,Zip: HUNTINGTON, NY
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Remarks:

Material:

Site ID: 89495
Operable Unit ID: 1067595
Operable Unit: 01
Material ID: 317560
Material Code: 0010
Material Name: Hydraulic Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 15
Units: Gallons

"FORD"HYDRAULIC LINE FROM STREET SWEEPER IN PARKING LOT, APPROX 10 GALLONS SPILLED. NO DRAINAGE OR SOIL AFFECTED. 10 BAGS OF SPEEDI DRI USED. SWEEPED UP AND TAKEN BY MATT GROSS (HUNTINGTON ENVIR)8/25/98 14:25 BF TELECON WITH MATT GROSS, CLEANUP COMPLETE, SPEEDI DRI SENT TO INCINERATORNO ADDITIONAL ACTIONS NECESSARY
BROKEN HOSE ON A VEH

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

LONG ISLAND TRAIN STATION (Continued)

5103483996

Recovered: 15
Resource Affected: Not reported
Oxygenate: False

Tank Test:

F36 HUNTINGTON ELEMENTARY SCHOOL
NW LOWNDES AVE
< 1/8 HUNTINGTON STATION, NY 11746
0.117 mi.
619 ft. Site 2 of 3 in cluster F

UST U003844043
N/A

Relative:
Higher

SUFFOLK CO. UST:

Region: SUFFOLK
Site Ref#: 10951
Status: ACTIVE
Site Type: PBS
Operating Permit Expires: 01/31/2015
Owner/Storage Information: AVAILABLE

Actual:
226 ft.

Facility Info:

Site Ref#: 10951
Billing Contact: HUNTINGTON UFSD
Billing Address: PO BOX 1500
Billing Address: HUNTINGTON
Billing State: NY
Billing Address: 11743
Storage Owner: HUNTINGTON UFSD
Storage Owner Address: PO BOX 1500
Storage Owner City: HUNTINGTON
Storage Owner State: NY
Storage Owner Zip: 11743

Tank Info:

Facility ID: 10951
Facility Reference #: Not reported
Official Use: Not reported
Township: Not reported
Tax Map No: Not reported
Region: SUFFOLK
Permit to Operate: Not reported

Tank ID: 1
Tank Key: Not reported
Installed: Not reported
Capacity: 15000 gallons
Content: #2 FUEL OIL
Date Removed: Not reported
Construction: STEEL/ IRON
Dispenser: SUCTION
Fill Type: Not reported
Tank Location: UNDER - OUT
Tank Status: IN SERVICE
Total Capacity: 15000 gallons
Date Permitted: Not reported
Date Closed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON ELEMENTARY SCHOOL (Continued)

U003844043

Internal Protection: NONE
Secondary Containment: NONE
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: 12/31/2017
Fill: Not reported
Date Removed: Not reported
Year Installed: Not reported
Description of drop records: Not reported

Tank ID: 1
Tank Key: 20178
Installed: 69
Capacity: 0000015000
Content: #2 FUEL OIL
Date Removed: Not reported
Construction: STEEL
Dispenser: SUCTION
Fill Type: PUMPED
Tank Location: UNDER-OUT
Tank Status: Not reported
Total Capacity: 0000015000
Date Permitted: Not reported
Date Closed: Not reported
Internal Protection: Not reported
Secondary Containment: Not reported
Extrenal Protection: Not reported
Leak Detection: Not reported
Overfill Prevention: Not reported
Spill Prevention: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe External Protection: Not reported
Pipe Containment: Not reported
Pipe Leak Detection: Not reported
Date Next Tank Test: Not reported
Fill: PUMPED
Date Removed: Not reported
Year Installed: 69
Description of drop records: RECORDS AS OF 09/10/2013

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F37
NW
< 1/8
0.119 mi.
626 ft.

HUNTINGTON INTERMEDIATE
155 LOWNDES AVENUE
HUNTINGTON, NY

LTANKS S105995246
N/A

Site 3 of 3 in cluster F

Relative:
Higher

Actual:
225 ft.

LTANKS:

Site ID: 180607
Spill Number/Closed Date: 0111100 / 12/28/2009
Spill Date: 2/21/2002
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 5226
Investigator: T/T/F
Referred To: Not reported
Reported to Dept: 2/21/2002
CID: 398
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered in Computer: 2/21/2002
Spill Record Last Update: 1/5/2010
Spiller Name: PAUL RISPOLI
Spiller Company: HUNTINGTON UNION FREE SD BUILDINGS & GROUNDS
Spiller Address: PO BOX 1500
Spiller City,St,Zip: HUNTINGTON, ZZ
Spiller County: 001
Spiller Contact: PAUL RISPOLI
Spiller Phone: (631) 673-2127
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 151490
DEC Memo: 2/22/02 11:00 TELECON TO JOHN LEDDY, TEST WAS A SYSTEM TEST, PAUL RISPOLI IS HEAD OF BUILDING & GROUNDS FOR THE HUNTINGTON SDTANK PASSED IN 2002 & 2007, ACCORDING TO SCHD RECORDS, NO INFO ON FAILURE POSSIBLE PROBLEM WITH VENT LINE. NO CALL BACK.
Remarks:

Material:

Site ID: 180607
Operable Unit ID: 848179
Operable Unit: 01
Material ID: 528702
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EOR ID Number
EPA ID Number

HUNTINGTON INTERMEDIATE (Continued)

S105995246

Tank Test:
Site ID: 180607
Spill Tank Test: 1526888
Tank Number: 3
Tank Size: 15000
Test Method: 03
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Homer EZ Check I or II

38
SSW
< 1/8
0.119 mi.
627 ft.

LILCO
1345 NEW YORK AVE & DEPOT
HUNTINGTON STATION, NY

NY Spills S102139526
N/A

Relative:
Lower

Actual:
204 ft.

SPILLS:
Facility ID: 9400980
DER Facility ID: 129697
Facility Type: ER
Site ID: 152797
DEC Region: 1
Spill Date: 4/20/1994
Spill Number/Closed Date: 9400980 / 6/9/1998
Spill Cause: Equipment Failure
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
SWIS:
Investigator: BPAUSTIN
Referred To: Not reported
Reported to Dept: 4/20/1994
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/21/1994
Spill Record Last Update: 6/9/1998
Spiller Name: Not reported
Spiller Company: LILCO
Spiller Address: Not reported
Spiller City, St, Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo:
Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"AUSTIN"CLEANUP BY LILCO,NO OTHER ACTION
Remarks:
SPILL CONTAINED ON BLACKTOP DRIVEWAY - LILCO CREW ON SITE - WOULD
LIKE CALL BACK.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LILCO (Continued)

S102139526

Material:

Site ID: 152797
Operable Unit ID: 998359
Operable Unit: 01
Material ID: 384753
Material Code: 0017A
Material Name: PCB OIL
Case No.: Not reported
Material FA: Petroleum
Quantity: 80
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

39
SW
< 1/8
0.120 mi.
634 ft.

25 RAILROAD ST
HUNTINGTON STATION, NY 11746

EDR US Hist Auto Stat 1015362081
N/A

Relative:
Lower

Actual:
201 ft.

EDR Historical Auto Stations:

Name: ALBERTOS AUTO SERVICE
Year: 2001
Address: 25 RAILROAD ST

Name: ALBERTSONS AUTO SERVICE
Year: 2005
Address: 25 RAILROAD ST

Name: ALBERTSONS AUTO SERVICE
Year: 2006
Address: 25 RAILROAD ST

Name: ALBERTSONS AUTO SERVICE
Year: 2007
Address: 25 RAILROAD ST

Name: ALBERTSONS AUTO SERVICE
Year: 2008
Address: 25 RAILROAD ST

Name: ALBERTSONS AUTO SERVICE
Year: 2009
Address: 25 RAILROAD ST

Name: ALBERTOS AUTO SVC
Year: 2010
Address: 25 RAILROAD ST

Name: ALBERTOS AUTOMOBILE SERVICE
Year: 2011
Address: 25 RAILROAD ST

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

1015362081

Name: ALBERTOS AUTOMOBILE SERVICE
Year: 2012
Address: 25 RAILROAD ST

H40
SSE
1/8-1/4
0.126 mi.
667 ft.

1345 NEW YORK AVE.
HUNTINGTON STATION, NY

Site 1 of 2 in cluster H

SHWS S110247116
ERP N/A
SWF/LF
DRYCLEANERS
RGA LF

Relative:
Lower

Actual:
206 ft.

SHWS:
Program: HW
Site Code: 401207
Classification: N
Region: 1
Acres: 2.130
HW Code: 152220
Record Add: 07/15/2008
Record Upd: 01/06/2010
Updated By: MOBARRIE

Site Description:

This site is comprised of a 2-acre parcel, designated as Section 141, Block 3, Lot 1. 2.0-acre. The site, which is owned by the Town of Huntington, immediately south of the Long Island Rail Road. East of the site is a Long Island Rail Road commuter parking lot. To the south and west are parking lots, part of a school bus depot. The site is currently vacant and was previously used for truck storage and maintenance shop by New York Avenue Properties, LLP. From approximately 1988 to 1998, the property operated as a C&D recycling and transfer station and as a short term C&D storage and transfer station from 1998 to 2001. The material was weighed and stored for shipment to the appropriate disposal facility. During that time, there was several non-compliance and violation issues raised by the Department. In 2002, the Town took title of the property for failure to pay property taxes. The site is paved with concrete and has several subsurface drainage structures to handle storm water runoff. Some ground subsidence was noted around a subsurface drainage structure south of the main building. There is a raised landscaped area surrounding the property, bounded by a concrete wall, on which trees have been planted and a sprinkler system has been installed. A large pile of soil mixed with C&D debris is located on the eastern side of the site. The site is predominantly flat with an elevation of between 200 and 210 feet above mean sea level (msl). Depth to groundwater is estimated to be approximately 80 feet below grade. Groundwater is estimated to flow generally in a northwesterly direction toward Cold Spring Harbor. There is one main structure on-site. The main building, originally used to handle construction and demolition (C&D) debris, is approximately 70 feet long by 50 feet wide and 30 feet in height. The building has been used recently as a truck maintenance shop. The building is currently in disrepair with exposed insulation. There is also a small building (kioskstyle) located near the truck scale, immediately inside the front gate of the property. A phase I ESA was conducted in April 2000. This site was never considered to be a potential inactive hazardous waste disposal site. In December 2007, the Town submitted an application to participate in the Department's Environmental Restoration Program (ERP). Since the municipality's ERP application approval package was held up due to the lack of program funding, the site was nominated for a USEPA funded Targeted Site Assessment grant. The purpose of the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S110247116

nomination was to keep the project moving forward. In June 2008, the EPA approved the grant. A TSA work assignment was issued and approved in December 2008. The WA Issuance/Notice to proceed letter was sent to the selected stand-by contractor on December 22, 2008. The Site Investigation (SI) work plan was approved on February 4, 2009 and implemented in March through September 2009. A Final SI report was approved on December 1, 2009. NFA letter to EPA on 12/3/09 signed by John Sheehan. The site did not qualify for addition to the Registry of Inactive Hazardous Disposal Sites

Env Problem: Based on the site investigation findings, the nature and extent of on-site contamination does not pose a significant threat to human health and the environment. No further investigation is warranted at this time. The primary concern at the site has been determined to be the semi volatile organic compounds, pesticides, and metals that exist in the defined buried C&D material areas throughout the site and the above grade debris piles. The majority of the contaminants are found in the fill area in the central, southwestern, western and northwestern portions of the site. Based on analytical results of the soils, groundwater and soil vapor samples collected as part of the site investigation, the level of contamination on-site is low and would require limited remedial measures. Industrial SCGs were met for the majority of the site, with the exception of one SVOC (Benzo(a)pyrene). Based on the future use of the site, limited remedial measures at the site may entail removal of the buried C&D material and above grade debris piles in several areas of the site.

Health Problem: Not reported
Dump: Not reported
Structure: Not reported
Lagoon: Not reported
Landfill: Not reported
Pond: Not reported
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: Not reported
Record Upd: Not reported
Updated By: Not reported
Own Op: Not reported
Sub Type: Not reported
Owner Name: Not reported
Owner Company: Not reported
Owner Address: Not reported
Owner Addr2: Not reported
Owner City, St, Zip: Not reported
Owner Country: Not reported
HW Code: Not reported
Waste Type: Not reported
Waste Quantity: Not reported
Waste Code: Not reported
Crossref ID: Not reported
Cross Ref Type Code: Not reported
Cross Ref Type: Not reported
Record Added Date: Not reported
Record Updated: Not reported
Updated By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S110247116

ERP:

Site Code: 391324
Program: ERP
HW Code: E152220
Site Class: A
Class N: A
SWIS: 5226
Region: 1
Town: Huntington
Acres: 2.130
Record Added: 12/21/2007
Record Updated: 01/27/2010
Updated By: WJPARISH
Site Description:

This 2.0-acre site is located at 1345 New York Avenue in the Town of Huntington, Suffolk County. Most recently, the property was used for truck storage and maintenance shop. From approximately 1988 to 1998, the property operated as a C&D recycling and transfer station. The material was weighed and stored for shipment to the appropriate disposal facility. During that time, there was several non-compliance and violation issues raised by the Department. The Town took title of the property for failure to pay property taxes. The property, which is predominantly flat, is paved with concrete and has several subsurface drainage structures to handle storm water runoff. A phase I ESA was conducted in April 2000. A Pre-application meeting was held in July, 2007. In December 2007, the Town submitted an application to participate in the Department's Environmental Restoration Program (ERP). Since the municipality's ERP application approval package has been held up due to the lack of program funding, the region, with central offices concurrence, has nominated the site for an EPA TSA grant. The grant was approved. A TSA work assignment was prepared and approved. The WA Issuance/Notice to proceed letter was sent to selected stand-by contractor on December 22, 2008. The work associated with the EPA TSA WA is being track under project number 152220.

Env Problem: 12/08: Since the municipality's ERP application approval package has been held up due to the lack of program funding, the region, with central offices concurrence, has nominated the site for an EPA TSA grant. The grant was approved. A TSA work assignment was prepared and approved. The WA Issuance/Notice to proceed letter was sent to selected stand-by contractor on December 22, 2008. The work associated with the EPA TSA WA is being track under project number 152220.

Health Problem: Not reported

SWF/LF:

Flag: INACTIVE
Region Code: 1
Phone Number: 6315493404
Owner Name: STATEWIDE RECYCLING
Owner Type: Private
Owner Address: 1345 NEW YORK AVE
Owner Addr2: Not reported
Owner City,St,Zip: HUNTINGTON STN., NY
Owner Email: Not reported
Owner Phone: Not reported
Contact Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

(Continued)

S110247116

Contact Address: Not reported
Contact Addr2: Not reported
Contact City,St,Zip: Not reported
Contact Email: Not reported
Contact Phone: Not reported
Activity Desc: C&D processing - registration
Activity Number: [52W02]
Active: No
East Coordinate: Not reported
North Coordinate: Not reported
Accuracy Code: Not reported
Regulatory Status: Not reported
Waste Type: Not reported
Authorization #: Not reported
Authorization Date: Not reported
Expiration Date: Not reported

DRYCLEANERS:

Facility ID: 1-4726-00476
Phone Number: Not reported
Region: Not reported
Registration Effective Date: Not reported
Inspection Date: 04JUN23
Install Date: Not reported
Drop Shop: Not reported
Shutdown: Y
Alternate Solvent: Not reported
Current Business: Not reported

RGALF:

2012	STATEWIDE RECYCLING	1345 NEW YORK AVE.
2011	STATEWIDE RECYCLING	1345 NEW YORK AVE.
2010	STATEWIDE RECYCLING	1345 NEW YORK AVE.
2009	STATEWIDE RECYCLING	1345 NEW YORK AVE.
2008	STATEWIDE RECYCLING	1345 NEW YORK AVE.
2007	STATEWIDE RECYCLING	1345 NEW YORK AVE.
2006	STATEWIDE RECYCLING	1345 NEW YORK AVE.
2005	STATEWIDE RECYCLING	1345 NEW YORK AVE.
2004	STATEWIDE RECYCLING	1345 NEW YORK AVE.

H41
SSE
1/8-1/4
0.126 mi.
667 ft.

ROTUNDO
1345 NEW YORK AVENUE
HUNTINGTON STATION, NY

US BROWNFIELDS 1016007781
FINDS N/A

Relative:
Lower

Actual:
206 ft.

Site 2 of 2 in cluster H

US BROWNFIELDS:
Recipient name: New York State Dept. of Environmental Conservation
Grant type: Section 128(a) State/Tribal
Property name: ROTUNDO
Property #: Not reported
Parcel size: 2
Property Description: Not reported
Latitude: 40.85
Longitude: -73.413889
HCM label: Address Matching-House Number
Map scale: Not reported
Point of reference: Center of a Facility or Station

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROTUNDO (Continued)

1016007781

Datum: North American Datum of 1927
ACRES property ID: 132902
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 150000
Assessment funding source: US EPA - State & Tribal Section 128(a) Funding
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Supplemental Assessment
Accomplishment count: 1
Cooperative agreement #: 98298003
Ownership entity: Government
Current owner: Town of Huntington
Did owner change: N
Cleanup required: No
Video available: No
Photo available: Yes
Institutional controls required: N
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

ROTUNDO (Continued)

1016007781

PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Y
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: Not reported
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: 2
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

FINDS:

Registry ID: 110045400730

Environmental Interest/Information System

US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES)
is a federal online database for Brownfields Grantees to
electronically submit data directly to EPA.

42
ESE
1/8-1/4
0.157 mi.
830 ft.

69 FAIRGROUND AVE
HUNTINGTON STATION, NY 11746

EDR US Hist Auto Stat 1015600956
N/A

Relative:
Lower
Actual:
204 ft.

EDR Historical Auto Stations:

Name: JAMEL & NICOLE'S AUTO SALON
Year: 2003
Address: 69 FAIRGROUND AVE
Name: JAMEL & NICOLE'S AUTO SALON
Year: 2004
Address: 69 FAIRGROUND AVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

43
WSW
1/8-1/4
0.158 mi.
832 ft.

BAILEY RESIDENCE
86 COLUMBIA STREET
HUNTINGTON STATION, NY

LTANKS S100493536
N/A

Relative:
Lower

Actual:
209 ft.

LTANKS:
Site ID: 308769
Spill Number/Closed Date: 9201883 / 2/3/1993
Spill Date: 5/15/1992
Spill Cause: Tank Failure
Spill Source: Private Dwelling
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Unknown Responsible Party. Corrective action taken. (ISR)
Cleanup Ceased: 2/3/1993
Cleanup Meets Standard: True
SWIS: 5200
Investigator: RICE
Referred To: Not reported
Reported to Dept: 5/15/1992
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 5/19/1992
Spill Record Last Update: 2/8/1993
Spiller Name: Not reported
Spiller Company: BAILEY RESIDENCE
Spiller Address: 86 COLUMBIA STREET
Spiller City,St,Zip: HUNTINGTON STATION, ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 249356
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"RICE"02/03/93: DEC ON SITE, DOROTHY BAILEY WHO WILL EXCAVATE CONT
SOIL, 9/3/92 DEC ON SITE, CLEANUP SATISFACTORY.
Remarks: 275 GAL TANK LAYING ON ITS SIDE ON DIRT UNDER KITCHEN, RELIANCE
UTILITIES IS AT SITE OWNER SMELLED OIL THIS MORNING

Material:
Site ID: 308769
Operable Unit ID: 969295
Operable Unit: 01
Material ID: 413169
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BAILEY RESIDENCE (Continued)

S100493536

Tank Test:

44
SSE
1/8-1/4
0.167 mi.
881 ft.

53 DEPOT RD
HUNTINGTON STATION, NY 11746

EDR US Hist Auto Stat 1015541610
N/A

Relative:
Lower

EDR Historical Auto Stations:

Actual:
205 ft.

Name:	AMIGOS AUTO SERVICE
Year:	1999
Address:	53 DEPOT RD
Name:	LATINOS AUTO SERVICE INCORPORATED
Year:	2000
Address:	53 DEPOT RD
Name:	JUSTIN BROWN AUTO REPAIR SRVC
Year:	2001
Address:	53 DEPOT RD
Name:	JUSTIN BROWN AUTO REPAIR SRVC
Year:	2002
Address:	53 DEPOT RD
Name:	JUSTIN BROWN AUTO RPR SERVICE
Year:	2003
Address:	53 DEPOT RD
Name:	JUSTIN BROWN AUTO REPAIR
Year:	2004
Address:	53 DEPOT RD
Name:	JUSTIN BROWN AUTO RPR SERVICE
Year:	2005
Address:	53 DEPOT RD
Name:	JUSTIN BROWN AUTO RPR SERVICE
Year:	2006
Address:	53 DEPOT RD
Name:	LATINOS AUTO SERVICE INC
Year:	2007
Address:	53 DEPOT RD
Name:	LATINOS AUTO SERVICE INC
Year:	2008
Address:	53 DEPOT RD
Name:	JUSTIN BROWN AUTO RPR SERVICE
Year:	2009
Address:	53 DEPOT RD
Name:	JUSTIN BROWN AUTO REPAIR SVC
Year:	2010
Address:	53 DEPOT RD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

1015541610

Name: JUSTIN BROWN AUTO RPR SVCE
Year: 2011
Address: 53 DEPOT RD

I45
SSW
1/8-1/4
0.181 mi.
954 ft.

NY TELEPHONE CO
50 WEST 4TH STREET
HUNTINGTON STATION, NY

LTANKS S101856415
N/A

Site 1 of 3 in cluster 1

Relative:
Lower

Actual:
200 ft.

LTANKS:

Site ID: 81572
Spill Number/Closed Date: 9110160 / 11/6/1992
Spill Date: 12/26/1991
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Cleanup Ceased: 11/6/1992
Cleanup Meets Standard: True
SWIS: 5200
Investigator: MIRZA
Referred To: Not reported
Reported to Dept: 12/26/1991
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered in Computer: 12/30/1991
Spill Record Last Update: 11/9/1992
Spiller Name: Not reported
Spiller Company: NY TELEPHONE CO
Spiller Address: 50 WEST 4TH STREET
Spiller City,St,Zip: HUNTINGTON STATION, ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 75447
DEC Memo: Not reported
Remarks: 7K FAILED AT -.150, GASOLINE INSTALLATION TESTER, PETROTITE,
EXCAVATE, ISOLATE & RETEST TOMORROW

Material:

Site ID: 81572
Operable Unit ID: 963781
Operable Unit: 01
Material ID: 418725
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

NY TELEPHONE CO (Continued)

S101856415

Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 81572
Spill Tank Test: 1539468
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

146
SSW
1/8-1/4
0.186 mi.
980 ft.

BELL ATLANTIC
50 W 4TH ST
HUNTINGTON, NY

RCRA NonGen / NLR 1001405131
FINDS NYR000065805

Site 2 of 3 in cluster I

Relative:
Lower

RCRA NonGen / NLR:

Date form received by agency: 01/01/2007
Facility name: BELL ATLANTIC
Facility address: 50 W 4TH ST
HUNTINGTON, NY 11743
EPA ID: NYR000065805
Mailing address: E 37TH ST
NEW YORK, NY 10016
Contact: LEO BUSINELLI
Contact address: E 37TH ST
NEW YORK, NY 10016
Contact country: US
Contact telephone: (212) 338-7675
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler. Non-Generators do not presently generate hazardous waste

Actual:
199 ft.

Owner/Operator Summary:

Owner/operator name: BELL ATLANTIC
Owner/operator address: 50 W 4TH ST
HUNTINGTON, NY 11743
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported
Owner/operator name: BELL ATLANTIC
Owner/operator address: 50 W 4TH ST
HUNTINGTON, NY 11743
Owner/operator country: US

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

47
SW
1/8-1/4
0.198 mi.
1047 ft.

R B HAMILTON HAULING & RIGGING CORP
44 RAILROAD ST
HUNTINGTON STATION, NY 11746

RCRA NonGen / NLR
FINDS
1000116710
NYD003779550

Relative:
Lower

RCRA NonGen / NLR:

Date form received by agency: 01/01/2007

Facility name: R B HAMILTON HAULING & RIGGING CORP

Facility address: 44 RAILROAD ST
HUNTINGTON STATION, NY 11746

EPA ID: NYD003779550

Mailing address: RAILROAD ST
HUNTINGTON STA, NY 11746

Contact: D AHMILTON

Contact address: RAILROAD ST
HUNTINGTON STA, NY 11746

Contact country: US

Contact telephone: (516) 427-4500

Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: D B HAMILTON
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: Private

Owner/Operator Type: Owner

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Owner/operator name: D B HAMILTON
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: Private

Owner/Operator Type: Operator

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No

Mixed waste (haz. and radioactive): No

Recycler of hazardous waste: No

Transporter of hazardous waste: No

Treater, storer or disposer of HW: No

Underground injection activity: No

On-site burner exemption: No

Furnace exemption: No

Used oil fuel burner: No

Used oil processor: No

User oil refiner: No

Used oil fuel marketer to burner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R B HAMILTON HAULING & RIGGING CORP (Continued)

1000116710

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: R B HAMILTON HAULING & RIGGING CORP
Classification: Not a generator, verified

Date form received by agency: 09/15/1961
Facility name: R B HAMILTON HAULING & RIGGING CORP
Classification: Unverified

Violation Status: No violations found

FINDS:

Registry ID: 110004342097

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

149
South
1/8-1/4
0.208 mi.
1098 ft.

**BELL ATLANTIC
50 WEST 4TH STREET
HUNTINGTON, NY**

Site 3 of 3 in cluster 1

**LTANKS
MANIFEST
NY Spills**

S102399491
N/A

Relative:
Lower

Actual:
199 ft.

LTANKS:

Site ID: 282045
Spill Number/Closed Date: 9605036 / 10/3/1996
Spill Date: 8/7/1996
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Cleanup Ceased: Not reported
Cleanup Meets Standard: True
SWIS: 5226
Investigator: T/T/F
Referred To: Not reported
Reported to Dept: 8/7/1996
CID: 297
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 8/7/1996
Spill Record Last Update: 10/4/1996
Spiller Name: GINA COSTANTINE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELL ATLANTIC (Continued)

S102399491

Spiller Company: NYNEX
Spiller Address: 50 WEST 4TH AVENUE
Spiller City,St,Zip: HUNTINGTON, NY
Spiller County: 001
Spiller Contact: GINA COSTANTINE
Spiller Phone: (516) 249-3150
Spiller Extension: 272
DEC Region: 1
DER Facility ID: 228962
DEC Memo: Not reported
Remarks: PRODUCT WAS DELIVERED PRIOR TO TEST WHICH CREATED A TEMPERATURE DIFFERENCE - THE FIRST TEST WAS ACTUALLY PERFORMED ON MONDAY AUGUST5TH 1996 - ANOTHER WILL BE PERFORMED TO VERIFY THE FINDINGS

Material:

Site ID: 282045
Operable Unit ID: 1033460
Operable Unit: 01
Material ID: 348683
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 282045
Spill Tank Test: 1544674
Tank Number: Not reported
Tank Size: 10000
Test Method: 03
Leak Rate: -5.9999999
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

NY MANIFEST:

EPA ID: NYR000065805
Country: USA
Mailing Name: BELL ATLANTIC
Mailing Contact: KENNY ANAYA
Mailing Address: 741 ZECKENDORF AVE
Mailing Address 2: Not reported
Mailing City: GARDEN CITY
Mailing State: NY
Mailing Zip: 11530
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 516-683-7135

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELL ATLANTIC (Continued)

S102399491

NY MANIFEST:

No Manifest Records Available

SPILLS:

Facility ID: 9709349
DER Facility ID: 275837
Facility Type: ER
Site ID: 81573
DEC Region: 1
Spill Date: 11/12/1997
Spill Number/Closed Date: 9709349 / 11/13/1997
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
SWIS: 5200
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 11/12/1997
CID: 257
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 11/12/1997
Spill Record Last Update: 11/13/1997
Spiller Name: JOE MARSHAIK
Spiller Company: BELL ATLANTIC
Spiller Address: 50 WEST 4TH STREET
Spiller City,St,Zip: HUNTINGTON, NY
Spiller Company: 001
Contact Name: JOE MARSHAIK
Contact Phone: (516) 361-5393
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"NONE"FILTER OF THE ENGINE BLEW OFF, MILRO ENROUTE TO CLEANUP NO
RESPONSE

Remarks:

caller is sending a cleanup crew out to clean - crew is on the way
spill is on pavement in parking lot

Material:

Site ID: 81573
Operable Unit ID: 1052497
Operable Unit: 01
Material ID: 327699
Material Code: 0010
Material Name: Hydraulic Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 3
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELL ATLANTIC (Continued)

S102399491

Tank Test:

49
SSW
1/8-1/4
0.209 mi.
1105 ft.

HUNTINGTON COACH
81 W 4TH ST
HUNTINGTON STATION, NY 11746

RCRA-CESQG
FINDS
MANIFEST
1000413051
NYD982282600

Relative:
Lower

RCRA-CESQG:

Actual:
198 ft.

Date form received by agency: 01/01/2007
Facility name: HUNTINGTON COACH
Facility address: 81 W 4TH ST
HUNTINGTON STATION, NY 117461603
EPA ID: NYD982282600
Mailing address: BAYVILLE AVE
BAYVILLE, NY 11709
Contact: Not reported
Contact address: BAYVILLE AVE
BAYVILLE, NY 11709
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Conditionally Exempt Small Quantity Generator
Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: HUNTINGTON COACH CORP
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: HUNTINGTON COACH CORP
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON COACH (Continued)

1000413051

Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: HUNTINGTON COACH
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/08/1999
Facility name: HUNTINGTON COACH
Classification: Not a generator, verified

Date form received by agency: 12/14/1987
Facility name: HUNTINGTON COACH
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004420458

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD982282600
Country: USA
Mailing Name: HUNTINGTON COACH
Mailing Contact: HUNTINGTON COACH
Mailing Address: 81 WEST FOURTH STREET
Mailing Address 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON COACH (Continued)

1000413051

Mailing City: HUNTINGTON STATION
Mailing State: NY
Mailing Zip: 11748
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 516-271-8995

Document ID: ILA1978275
Manifest Status: Not reported
Trans1 State ID: TXR000050930
Trans2 State ID: Not reported
Generator Ship Date: 12/01/2005
Trans1 Recv Date: 12/01/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/14/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982282600
Trans1 EPA ID: UPW151298
Trans2 EPA ID: Not reported
TSD ID: ILD980613913
Waste Code: F005 - UNKNOWN
Quantity: 00036
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Waste Code: F005 - UNKNOWN
Quantity: 00100
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: Not reported
Specific Gravity: 01.00
Waste Code: Not reported
Quantity: Not reported
Units: Not reported
Number of Containers: Not reported
Container Type: Not reported
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: Not reported
Year: Not reported

Document ID: NYA5146848
Manifest Status: Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID: NYIA8036
Trans2 State ID: Not reported
Generator Ship Date: 880203
Trans1 Recv Date: 880203
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880203
Part A Recv Date: 880322
Part B Recv Date: 880209
Generator EPA ID: NYD982282600

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON COACH (Continued)

1000413051

Trans1 EPA ID: NYD082785429
Trans2 EPA ID: Not reported
TSDf ID: NYD082785429
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00030
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 085
Year: 88

Document ID: ILA1978275
Manifest Status: Not reported
Trans1 State ID: TXR000050930
Trans2 State ID: Not reported
Generator Ship Date: 12/01/2005
Trans1 Recv Date: 12/01/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/14/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982282600
Trans1 EPA ID: UPW151288
Trans2 EPA ID: Not reported
TSDf ID: ILD980613913
Waste Code: F005 - UNKNOWN
Quantity: 00036
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Waste Code: F005 - UNKNOWN
Quantity: 00100
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: Not reported
Specific Gravity: 01.00
Waste Code: Not reported
Quantity: Not reported
Units: Not reported
Number of Containers: Not reported
Container Type: Not reported
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: Not reported
Year: 2005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

J50 NORTHGATE ELECTRIC CORP
SE 63 DEPOT RD
1/8-1/4 HUNTINGTON STATION, NY 11746
0.223 mi.
1180 ft. Site 1 of 2 in cluster J

RCRA NonGen / NLR 1000409428
FINDS NYD044473692

Relative:
Lower

RCRA NonGen / NLR:

Actual:
201 ft.

Date form received by agency: 01/01/2007
Facility name: NORTHGATE ELECTRIC CORP
Facility address: 63 DEPOT RD
HUNTINGTON STATION, NY 117461780
EPA ID: NYD044473692
Mailing address: DEPOT RD
HUNTINGTON STATION, NY 11746
Contact: Not reported
Contact address: DEPOT RD
HUNTINGTON STATION, NY 11746
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler. Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: NORTHGATE ELECTRIC CORP
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NORTHGATE ELECTRIC CORP
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NORTHGATE ELECTRIC CORP (Continued)

1000409428

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: NORTHGATE ELECTRIC CORP
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: NORTHGATE ELECTRIC CORP
Classification: Not a generator, verified

Date form received by agency: 09/22/1986
Facility name: NORTHGATE ELECTRIC CORP
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004355493

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

K51
South
1/8-1/4
0.231 mi.
1222 ft.

1419 NEW YORK AVENUE ASSO
1419 NEW YORK AVENUE
HUNTINGTON, NY

LTANKS S102959944
N/A

Site 1 of 2 in cluster K

Relative:
Lower

LTANKS:

Actual:
202 ft.

Site ID: 244708
Spill Number/Closed Date: 9710970 / 12/10/2009
Spill Date: 12/30/1997
Spill Cause: Tank Test Failure
Spill Source: Private Dwelling
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 5226
Investigator: T/T/F
Referred To: Not reported
Reported to Dept: 12/30/1997
CID: 204
Water Affected: Not reported
Spill Notifier: Local Agency
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1419 NEW YORK AVENUE ASSO (Continued)

S102959944

Remediation Phase: 0
Date Entered in Computer: 12/30/1997
Spill Record Last Update: 12/11/2009
Spiller Name: ANDY BRENNER
Spiller Company: SOVEREIGN EQUITIES
Spiller Address: 2900 HEMPSTEAD TPKE SUITE 211
Spiller City, St, Zip: LEVITTOWN, NY
Spiller County: 001
Spiller Contact: CHUCK PEDANO
Spiller Phone: (810) 278-7203
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 201006
DEC Memo: 12/30/97 11:35 AS PER CHUCK PEDANO, TANK ALONE TEST FAILURE BELIEVE
FILLER RISER IS PROBLEM BECAUSE IT KEPT TURNING WITH WRENCH/TANK IS A
1000 GAL UST #2 FUEL OIL, CROMPCO IS SUB CONTRACTOR FOR
EMGADMINISTRATIVELY CLOSED
Remarks: TANK TOP FAILURE

Material:
Site ID: 244708
Operable Unit ID: 1057355
Operable Unit: 01
Material ID: 329239
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

L52
North
1/8-1/4
0.232 mi.
1226 ft

CLARUS CLEANERS CORP
1044 NEW YORK AVE
HUNTINGTON STATION, NY 11746

RCRA NonGen / NLR 1000413610
MANIFEST NYD981557705
US AIRS

Relative:
Lower

Site 1 of 3 in cluster L
RCRA NonGen / NLR:
Date form received by agency: 01/01/2007
Facility name: CLARUS CLEANERS CORP
Facility address: 1044 NEW YORK AVE
HUNTINGTON STATION, NY 11746
EPA ID: NYD981557705
Mailing address: NEW YORK AVE
HUNTINGTON STATION, NY 11746
Contact: LEE JAEWON
Contact address: NEW YORK AVE
HUNTINGTON STATION, NY 11746
Contact country: US
Contact telephone: (516) 421-0777
Contact email: Not reported

Actual:
196 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EPA ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: CLARUS CLEANERS
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: CLARUS CLEANERS
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: CLARUS CLEANERS CORP
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 09/22/1986
Facility name: CLARUS CLEANERS CORP
Classification: Small Quantity Generator

Violation Status: No violations found

NY MANIFEST:

EPA ID: NYD981557705
Country: USA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Mailing Name: STATION CLEANERS
Mailing Contact: STATION CLEANERS
Mailing Address: 1044 NEW TURNPIKE AVENUE
Mailing Address 2: Not reported
Mailing City: HUNTINGTON STATION
Mailing State: NY
Mailing Zip: 11746
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 516-421-0777

Document ID: NYA9235214
Manifest Status: Completed copy
Trans1 State ID: AT8756
Trans2 State ID: Not reported
Generator Ship Date: 890313
Trans1 Recv Date: 890313
Trans2 Recv Date: Not reported
TSD Site Recv Date: 890313
Part A Recv Date: 890316
Part B Recv Date: 890317
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00135
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 000
Year: 89

Document ID: NYA9440752
Manifest Status: Completed copy
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 890829
Trans1 Recv Date: 890829
Trans2 Recv Date: Not reported
TSD Site Recv Date: 890829
Part A Recv Date: 890901
Part B Recv Date: 890901
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Year: 89

Document ID: NYC3696063
Manifest Status: Completed copy
Trans1 State ID: JE4744
Trans2 State ID: Not reported
Generator Ship Date: 951020
Trans1 Recv Date: 951020
Trans2 Recv Date: Not reported
TSD Site Recv Date: 951020
Part A Recv Date: 951027
Part B Recv Date: 951031
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 95

Document ID: NYC8552191
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: Not reported
Generator Ship Date: 11/01/2001
Trans1 Recv Date: 11/01/2001
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/01/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NY81982JC
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2001

Document ID: NYC8526710
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: Not reported
Generator Ship Date: 07/19/2001
Trans1 Recv Date: 07/19/2001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)
EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Trans2 Recv Date: Not reported
TSD Site Recv Date: 07/19/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYAM6252
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00150
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2001

Document ID: NYC4154894
Manifest Status: Completed copy
Trans1 State ID: NYJE4744
Trans2 State ID: Not reported
Generator Ship Date: 960702
Trans1 Recv Date: 960702
Trans2 Recv Date: Not reported
TSD Site Recv Date: 960702
Part A Recv Date: 960717
Part B Recv Date: 960715
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 96

Document ID: NYC4042056
Manifest Status: Completed copy
Trans1 State ID: NYJE4744
Trans2 State ID: Not reported
Generator Ship Date: 960402
Trans1 Recv Date: 960402
Trans2 Recv Date: Not reported
TSD Site Recv Date: 960402
Part A Recv Date: 960409
Part B Recv Date: 960412
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 96

Document ID: NYC1776609
Manifest Status: Completed copy
Trans1 State ID: GF1411
Trans2 State ID: Not reported
Generator Ship Date: 921012
Trans1 Recv Date: 921012
Trans2 Recv Date: Not reported
TSD Site Recv Date: 921012
Part A Recv Date: Not reported
Part B Recv Date: 921028
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92

Document ID: NYC3984096
Manifest Status: Completed copy
Trans1 State ID: NYJE4744
Trans2 State ID: Not reported
Generator Ship Date: 960112
Trans1 Recv Date: 960112
Trans2 Recv Date: Not reported
TSD Site Recv Date: 960112
Part A Recv Date: 960122
Part B Recv Date: 960124
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 96

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Document ID: NYC5582430
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 03/29/1999
Trans1 Recv Date: 03/29/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 03/29/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYAT8756
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 99

Document ID: NYC5513668
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 01/05/1999
Trans1 Recv Date: 01/05/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/05/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYAT8756
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 99

Document ID: NYC5921728
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 09/20/1999
Trans1 Recv Date: 09/20/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 09/20/1999
Part A Recv Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYAT8756
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 99

Document ID: NYC8006137
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 12/07/1999
Trans1 Recv Date: 12/07/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/07/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYAT8756
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 99

Document ID: NYC5672553
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 06/23/1999
Trans1 Recv Date: 06/23/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 06/23/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYAT8756
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 99

Document ID: NYC6999298
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: NJD071629976
Generator Ship Date: 12/31/2002
Trans1 Recv Date: 12/31/2002
Trans2 Recv Date: 01/03/2003
TSD Site Recv Date: 01/06/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: OHD980587364
Trans2 EPA ID: Not reported
TSD ID: NY81982JC
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00150
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2002

Document ID: NYC6775457
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: Not reported
Generator Ship Date: 09/12/2002
Trans1 Recv Date: 09/12/2002
Trans2 Recv Date: Not reported
TSD Site Recv Date: 09/12/2002
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYAT8756
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00150
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2002

Document ID: NYC6764466
Manifest Status: Not reported
Trans1 State ID: SCR000075150

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Trans2 State ID: Not reported
Generator Ship Date: 05/21/2002
Trans1 Recv Date: 05/21/2002
Trans2 Recv Date: Not reported
TSD Site Recv Date: 05/21/2002
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981557705
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYAM6252
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00150
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2002

Document ID: NYA9738786
Manifest Status: Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID: AT8755
Trans2 State ID: Not reported
Generator Ship Date: 900223
Trans1 Recv Date: 900223
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900223
Part A Recv Date: 900308
Part B Recv Date: 900321
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYC2168853
Manifest Status: Completed copy
Trans1 State ID: Not reported
Trans2 State ID: Not reported
Generator Ship Date: 930618
Trans1 Recv Date: 930618
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930618
Part A Recv Date: 930702
Part B Recv Date: 930629
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD051060408

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Trans2 EPA ID: Not reported
TSDF ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93

Document ID: NYC4281928
Manifest Status: Completed copy
Trans1 State ID: NYNP2515
Trans2 State ID: Not reported
Generator Ship Date: 960920
Trans1 Recv Date: 960920
Trans2 Recv Date: Not reported
TSD Site Recv Date: 960920
Part A Recv Date: 961007
Part B Recv Date: 961007
Generator EPA ID: NYD981557705
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD000708198
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 96

[Click this hyperlink](#) while viewing on your computer to access
32 additional NY_MANIFEST: record(s) in the EDR Site Report.

AIRS (AFS):

Airs Minor Details:

EPA plant ID: 110004408249
Plant name: ORGANIC STATION CLEANER
Plant address: 1044 NEW YORK AVE
HUNTINGTON STATION, NY 117461204
County: SUFFOLK
Region code: 02
Dunn & Bradst #: Not reported
Air quality cntrl region: 043
Sic code: 7216
Sic code desc: DRYCLEANING PLANTS, EXCEPT RUG
North Am. industrial class: 812320
NAIC code description: Drycleaning and Laundry Services (except Coin-Operated)
Default compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Default classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR
Govt facility: ALL OTHER FACILITIES NOT OWNED OR OPERATED BY A FEDERAL, STATE, OR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413510

Current HPV: LOCAL GOVERNMENT
Not reported

Compliance and Enforcement Major Issues:

Air program: SIP SOURCE
National action type: Not reported
Date achieved: 00000
Penalty amount: Not reported

Air program: SIP SOURCE
National action type: Not reported
Date achieved: 00000
Penalty amount: Not reported

Air program: Not reported
National action type: Not reported
Date achieved: Not reported
Penalty amount: Not reported

Historical Compliance Minor Sources:

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1101
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1102
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1103
Air prog code hist file: MACT (SECTION 63 NESHAPS)

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1104
Air prog code hist file: MACT (SECTION 63 NESHAPS)

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1202
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1203
Air prog code hist file: SIP SOURCE

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1204
Air prog code hist file: MACT (SECTION 63 NESHAPS)

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1301
Air prog code hist file: MACT (SECTION 63 NESHAPS)

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1302
Air prog code hist file: MACT (SECTION 63 NESHAPS)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1004
Air prog code hist file:	SIP SOURCE
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1004
Air prog code hist file:	MACT (SECTION 63 NESHAPS)
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1101
Air prog code hist file:	MACT (SECTION 63 NESHAPS)
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1102
Air prog code hist file:	MACT (SECTION 63 NESHAPS)
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1103
Air prog code hist file:	SIP SOURCE
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1104
Air prog code hist file:	SIP SOURCE
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1201
Air prog code hist file:	SIP SOURCE
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1201
Air prog code hist file:	MACT (SECTION 63 NESHAPS)
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1202
Air prog code hist file:	MACT (SECTION 63 NESHAPS)
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1203
Air prog code hist file:	MACT (SECTION 63 NESHAPS)
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1204
Air prog code hist file:	SIP SOURCE
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1301
Air prog code hist file:	SIP SOURCE
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1302
Air prog code hist file:	SIP SOURCE
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date:	1303
Air prog code hist file:	SIP SOURCE
State compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLARUS CLEANERS CORP (Continued)

1000413610

Hist compliance date: 1303
Air prog code hist file: MACT (SECTION 63 NESHAPS)

Compliance & Violation Data by Minor Sources:

Air program code: SIP SOURCE
Plant air program pollutant: Not reported
Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR
Def. poll. compliance status: IN COMPLIANCE - SHUT DOWN
Def. attainment/non attmmt: ATTAINMENT AREA FOR GIVEN POLLUTANT
Repeat violator date: Not reported
Turnover compliance: Not reported

Air program code: MACT (SECTION 63 NESHAPS)
Plant air program pollutant: Not reported
Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR
Def. poll. compliance status: IN COMPLIANCE - SHUT DOWN
Def. attainment/non attmmt: ATTAINMENT AREA FOR GIVEN POLLUTANT
Repeat violator date: Not reported
Turnover compliance: Not reported

Air program code: SIP SOURCE
Plant air program pollutant: Not reported
Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR
Def. poll. compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Def. attainment/non attmmt: ATTAINMENT AREA FOR GIVEN POLLUTANT
Repeat violator date: Not reported
Turnover compliance: Not reported

Air program code: SIP SOURCE
Plant air program pollutant: Not reported
Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR
Def. poll. compliance status: IN COMPLIANCE - SHUT DOWN
Def. attainment/non attmmt: UNCLASSIFIED
Repeat violator date: Not reported
Turnover compliance: Not reported

Air program code: MACT (SECTION 63 NESHAPS)
Plant air program pollutant: Not reported
Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR
Def. poll. compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Def. attainment/non attmmt: ATTAINMENT AREA FOR GIVEN POLLUTANT
Repeat violator date: Not reported
Turnover compliance: Not reported

Air program code: MACT (SECTION 63 NESHAPS)
Plant air program pollutant: Not reported
Default pollutant classification: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YEAR
Def. poll. compliance status: IN COMPLIANCE - SHUT DOWN
Def. attainment/non attmmt: UNCLASSIFIED
Repeat violator date: Not reported
Turnover compliance: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

L53 ORGANIC STATION/CLARUS CLEANERS DRYCLEANERS S110248112
North 1044 NEW YORK AVE. N/A
1/8-1/4 HUNTINGTON ST, NY 11746

0.232 mi.
1226 ft. Site 2 of 3 in cluster L

Relative: DRYCLEANERS:
Lower Facility ID: 1-4726-00964
 Phone Number: 631-682-3413
Actual: Region: Not reported
196 ft. Registration Effective Date: 11/25/2003
 Inspection Date: 05DEC13
 Install Date: 96/03
 Drop Shop: Not reported
 Shutdown: Not reported
 Alternate Solvent: DF2000
 Current Business: Not reported

L54 1044 NEW YORK AVE EDR US Hist Cleaners 1014970702
North HUNTINGTON STATION, NY 11746 N/A
1/8-1/4

0.232 mi.
1226 ft. Site 3 of 3 in cluster L

Relative: EDR Historical Cleaners:
Lower Name: FREDDY LAUNDROMAT SERVICE
 Year: 1999
Actual: Address: 1044 NEW YORK AVE
196 ft. Name: R J H LAUNDROMAT CORP
 Year: 2000
 Address: 1044 NEW YORK AVE
 Name: RJH LAUNDROMAT CORP
 Year: 2001
 Address: 1044 NEW YORK AVE
 Name: CLARUS CLEANERS
 Year: 2001
 Address: 1044 NEW YORK AVE
 Name: RJH LAUNDROMAT CORP
 Year: 2002
 Address: 1044 NEW YORK AVE
 Name: CLARUS CLEANERS
 Year: 2002
 Address: 1044 NEW YORK AVE
 Name: CLARUS CLEANERS
 Year: 2003
 Address: 1044 NEW YORK AVE
 Name: RJH LAUNDROMAT CORP
 Year: 2003
 Address: 1044 NEW YORK AVE
 Name: RJH LAUNDROMAT CORP
 Year: 2004
 Address: 1044 NEW YORK AVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

1014970702

Name:	STATION LAUNDROMAT
Year:	2005
Address:	1044 NEW YORK AVE
Name:	D & A LAUNDRY CENTER INC
Year:	2006
Address:	1044 NEW YORK AVE
Name:	STATION LAUNDROMAT
Year:	2007
Address:	1044 NEW YORK AVE
Name:	D & A LAUNDRY CENTER INC
Year:	2007
Address:	1044 NEW YORK AVE
Name:	STATION LAUNDROMAT
Year:	2008
Address:	1044 NEW YORK AVE
Name:	D & A LAUNDRY CENTER INC
Year:	2008
Address:	1044 NEW YORK AVE
Name:	STATION LAUNDROMAT
Year:	2009
Address:	1044 NEW YORK AVE
Name:	D & A LAUNDRY CENTER INC
Year:	2009
Address:	1044 NEW YORK AVE
Name:	CLARUS CLEANERS
Year:	2010
Address:	1044 NEW YORK AVE
Name:	D & A LAUNDRY CTR INC
Year:	2010
Address:	1044 NEW YORK AVE
Name:	CLARUS CLEANERS
Year:	2011
Address:	1044 NEW YORK AVE
Name:	D & A LAUNDRY CENTER INC
Year:	2011
Address:	1044 NEW YORK AVE
Name:	D & A LAUNDRY CENTER INC
Year:	2012
Address:	1044 NEW YORK AVE
Name:	CLARUS CLEANERS
Year:	2012
Address:	1044 NEW YORK AVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

55
West
1/8-1/4
0.238 mi.
1256 ft.

81 TOWER ST
HUNTINGTON STATION, NY 11746

EDR US Hist Auto Stat 1015642922
N/A

Relative:
Higher
Actual:
220 ft.

EDR Historical Auto Stations:
Name: CLASSIC AUTO TRANSPORT INC
Year: 2003
Address: 81 TOWER ST
Name: CLASSIC AUTO TRANSPORT INC
Year: 2004
Address: 81 TOWER ST

M56
South
1/8-1/4
0.239 mi.
1264 ft.

COMMERCIAL REAL ESTATE
32 WEST PULASKI ROAD
HUNTINGTON, NY

MANIFEST 1009225958
N/A

Site 1 of 2 in cluster M

Relative:
Lower
Actual:
199 ft.

NY MANIFEST:
EPA ID: NYD000896746
Country: USA
Mailing Name: COMMERCIAL REAL ESTATE
Mailing Contact: COMMERCIAL REAL ESTATE
Mailing Address: 211 MONTAGUE STREET
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11201
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-760-0552

Document ID: NYB2111661
Manifest Status: Completed copy
Trans1 State ID: XK18NYNJ
Trans2 State ID: Not reported
Generator Ship Date: 900301
Trans1 Recv Date: 900301
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900301
Part A Recv Date: 900323
Part B Recv Date: 900323
Generator EPA ID: NYD000896746
Trans1 EPA ID: NYD000691949
Trans2 EPA ID: Not reported
TSD ID: NYD000691949
Waste Code: U188 - PHENOL
Quantity: 04800
Units: P - Pounds
Number of Containers: 008
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Year: 90

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site _____ Database(s) _____ EDR ID Number
EPA ID Number

K57 PIERPONT PAINT STORE
South 1425 NEW YORK AVE
1/8-1/4 HUNTINGTON STATION, NY
0.242 mi.
1278 ft. Site 2 of 2 in cluster K

RCRA NonGen / NLR 1000368528
FINDS NYD986894335
MANIFEST

Relative:
Lower

Actual:
202 ft.

RCRA NonGen / NLR:
Date form received by agency: 01/01/2007
Facility name: PIERPONT PAINT STORE
Facility address: 1425 NEW YORK AVE
HUNTINGTON STATION, NY 117461706
EPA ID: NYD986894335
Mailing address: E MAIN ST
HUNTINGTON, NY 11743
Contact: Not reported
Contact address: E MAIN ST
HUNTINGTON, NY 11743
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: FUSARO PROPERTIES CO
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 89999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: FUSARO PROPERTIES CO
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 89999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PIERPONT PAINT STORE (Continued)

1000368528

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: PIERPONT PAINT STORE
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: PIERPONT PAINT STORE
Classification: Not a generator, verified

Date form received by agency: 04/06/1990
Facility name: PIERPONT PAINT STORE
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004444316

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD986894335
Country: USA
Mailing Name: PIER PORT PAINT STORE
Mailing Contact: PIER PORT PAINT STORE
Mailing Address: 160 EAST MAIN STREET
Mailing Address 2: Not reported
Mailing City: HUNTINGTON
Mailing State: NY
Mailing Zip: 11743
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 516-874-2112

Document ID: NYB2104092
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: IA8036
Trans2 State ID: Not reported
Generator Ship Date: 900410
Trans1 Recv Date: 900410
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900410
Part A Recv Date: 900530
Part B Recv Date: 900522

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PIERPONT PAINT STORE (Continued)

1000368528

Generator EPA ID: NYD986894335
Trans1 EPA ID: NYD082785429
Trans2 EPA ID: Not reported
TSDF ID: NYD082785429
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00220
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 004
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 102
Waste Code: Not reported
Quantity: 02800
Units: P - Pounds
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Year: 90

M58
SSW
1/8-1/4
0.250 mi.
1319 ft.

52 W PULASKI RD
HUNTINGTON STATION, NY 11746

EDR US Hist Auto Stat 1015536560
N/A

Site 2 of 2 in cluster M

Relative:
Lower
Actual:
197 ft.

EDR Historical Auto Stations:

Name: SUPER BOBS AUTO REPR
Year: 2006
Address: 52 W PULASKI RD
Name: SUPER BOBS AUTO REPR
Year: 2008
Address: 52 W PULASKI RD
Name: SUPER BOBS AUTO REPR
Year: 2009
Address: 52 W PULASKI RD

J59
SSE
1/4-1/2
0.250 mi.
1322 ft.

HUNTINGTON TOWN LF
DEPOSIT RD
HUNTINGTON, NY 11743

CERCLIS 1000413059
FINDS NYD980506844

Site 2 of 2 in cluster J

Relative:
Lower
Actual:
201 ft.

CERCLIS:

Site ID: 0201709
EPA ID: NYD980506844
Facility County: SUFFOLK
Short Name: HUNTINGTON TOWN LF
Congressional District: 03
IFMS ID: Not reported
SMSA Number: 5380
USGC Hydro Unit: 02030201
Federal Facility: Not a Federal Facility
DMNSN Number: 0.00000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

HUNTINGTON TOWN LF (Continued)

1000413059

Site Orphan Flag: N
RCRA ID: Not reported
USGS Quadrangle: Not reported
Site Init By Prog: Not reported
NFRAP Flag: Not reported
Parent ID: Not reported
RST Code: Not reported
EPA Region: 02
Classification: Not reported
Site Settings Code: Not reported
NPL Status: Not on the NPL
DMNSN Unit Code: Not reported
RBRAC Code: Not reported
RResp Fed Agency Code: Not reported
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information
Non NPL Status Date: 10/04/11
Site Fips Code: 36103
CC Concurrence Date: / /
CC Concurrence FY: Not reported
Alias EPA ID: Not reported
Site FUDS Flag: Not reported

Alias Comments: Not reported
Site Description: As of 11/29/2006, O & M ongoing.

CERCLIS Assessment History:

Action Code: 001
Action: DISCOVERY
Date Started: / /
Date Completed: 05/01/80
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: EPA Fund-Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Action Code: 001
Action: PRELIMINARY ASSESSMENT
Date Started: / /
Date Completed: 03/03/87
Priority Level: Low priority for further assessment
Operable Unit: SITEWIDE
Primary Responsibility: State, Fund Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Action Code: 001
Action: SITE INSPECTION
Date Started: 06/29/87
Date Completed: 07/01/87
Priority Level: Higher priority for further assessment
Operable Unit: SITEWIDE
Primary Responsibility: State, Fund Financed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON TOWN LF (Continued)

1000413059

Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Action Code: 001
Action: SITE REASSESSMENT
Date Started: 10/04/11
Date Completed: 10/04/11
Priority Level: NFRAP-Site does not qualify for the NPL based on existing information
Operable Unit: SITEWIDE
Primary Responsibility: EPA In-House
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

FINDS:

Registry ID: 110009302655

Environmental Interest/Information System

CERCLIS (Comprehensive Environmental Response, Compensation, and Liability Information System) is the Superfund database that is used to support management in all phases of the Superfund program. The system contains information on all aspects of hazardous waste sites, including an inventory of sites, planned and actual site activities, and financial information.

60
North
1/4-1/2
0.341 mi.
1798 ft.

MOBIL
984 NEW YORK AVENUE
HUNTINGTON, NY

LTANKS S100171255
MANIFEST N/A

Relative:
Lower

LTANKS:

Actual:
195 ft.

Site ID: 279436
Spill Number/Closed Date: 8600874 / 12/18/1989
Spill Date: 5/5/1986
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station
Spill Class: Not reported
Cleanup Ceased: 12/18/1989
Cleanup Meets Standard: True
SWIS: 5226
Investigator: CXONEILL
Referred To: Not reported
Reported to Dept: 5/6/1986
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 6/5/1986

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Spill Record Last Update: 2/27/2006
Spiller Name: Not reported
Spiller Company: MOBIL
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 999
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 226900
DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was
"O'NEILL FD*12/18/89: FAILED 3K REMOVED ABOUT 3 YRS AGO.2ND 3K
REMOVED ON 11/30/89. CONT FOUND IN THIS EXCAVATION & 2K EXCAVATION
ALSO.CONT SOIL REMOVED.APPROX 350 YDS STOCKPILED. 10/10/95: This is
additional information about material spilled from the translation of
the old spill file: SUPER NO LEAD.FILE HAS BEEN DESTROYED ACCORDING
TO STATE ARCHIVE AND RECORD ADMINISTRATOR RETENTION/DISPOSAL
PROCEDURES
Remarks: 3K U/G TANK FAILED PETROTITE TEST (-1.077)-DEC TO SEND 3 OPT.
LETTER&FOLLOW UP

Material:

Site ID: 279436
Operable Unit ID: 897151
Operable Unit: 01
Material ID: 477444
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 279436
Spill Tank Test: 1529910
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

NY MANIFEST:

EPA ID: NYD982182792
Country: USA
Mailing Name: WALGREENS #3470
Mailing Contact: CHRISTINA CHIAPETTA
Mailing Address: 200 WILMOT ROAD MS# 2171

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Mailing Address 2: Not reported
Mailing City: DEERFIELD
Mailing State: IL
Mailing Zip: 60015
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 847-914-3195

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 2011-03-24
Trans1 Recv Date: 2011-03-24
Trans2 Recv Date: 2011-03-30
TSD Site Recv Date: 2011-05-02
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: OHD083377010
Waste Code: Not reported
Quantity: 1.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 1.0
Year: 2011
Manifest Tracking Num: 004171844FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H061

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 2011-07-20
Trans1 Recv Date: 2011-07-20
Trans2 Recv Date: 2011-07-22
TSD Site Recv Date: 2011-08-23
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Trans2 EPA ID: Not reported
TSD ID: OHD083377010
Waste Code: Not reported
Quantity: 4.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 1.0
Year: 2011
Manifest Tracking Num: 004703634FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H061

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 18-Apr-2013 00:00:00
Trans1 Recv Date: 18-Apr-2013 00:00:00
Trans2 Recv Date: 24-Apr-2013 00:00:00
TSD Site Recv Date: 26-Apr-2013 00:00:00
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 14
Units: P - Pounds
Number of Containers: 1
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 005401045FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 18-Apr-2013 00:00:00
Trans1 Recv Date: 18-Apr-2013 00:00:00
Trans2 Recv Date: 24-Apr-2013 00:00:00
TSD Site Recv Date: 26-Apr-2013 00:00:00
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 3
Units: P - Pounds
Number of Containers: 1
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 005401045FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 18-Apr-2013 00:00:00
Trans1 Recv Date: 18-Apr-2013 00:00:00
Trans2 Recv Date: 24-Apr-2013 00:00:00
TSD Site Recv Date: 26-Apr-2013 00:00:00
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 1
Units: P - Pounds
Number of Containers: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 005401045FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 18-Apr-2013 00:00:00
Trans1 Recv Date: 18-Apr-2013 00:00:00
Trans2 Recv Date: 24-Apr-2013 00:00:00
TSD Site Recv Date: 26-Apr-2013 00:00:00
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 1
Units: P - Pounds
Number of Containers: 1
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 005401045FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Trans2 State ID: NJD054126164
Generator Ship Date: 18-Apr-2013 00:00:00
Trans1 Recv Date: 18-Apr-2013 00:00:00
Trans2 Recv Date: 24-Apr-2013 00:00:00
TSD Site Recv Date: 26-Apr-2013 00:00:00
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 2
Units: P - Pounds
Number of Containers: 1
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 005401045FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 24-Jan-2013 00:00:00
Trans1 Recv Date: 24-Jan-2013 00:00:00
Trans2 Recv Date: 28-Jan-2013 00:00:00
TSD Site Recv Date: 30-Jan-2013 00:00:00
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 2
Units: P - Pounds
Number of Containers: 1
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 005520221FLE
Import Ind: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	CTD983872698
Trans2 State ID:	NJR000063677
Generator Ship Date:	31-Jul-2013 00:00:00
Trans1 Recv Date:	31-Jul-2013 00:00:00
Trans2 Recv Date:	07-Aug-2013 00:00:00
TSD Site Recv Date:	21-Aug-2013 00:00:00
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982182792
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSD ID:	INR000110197
Waste Code:	Not reported
Quantity:	16
Units:	P - Pounds
Number of Containers:	1
Container Type:	CF - Fiber or plastic boxes, cartons
Handling Method:	L Landfill
Specific Gravity:	1
Year:	2013
Manifest Tracking Num:	006302629FLE
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	N
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	H141
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	CTD983872698
Trans2 State ID:	NJR000063677
Generator Ship Date:	31-Jul-2013 00:00:00
Trans1 Recv Date:	31-Jul-2013 00:00:00
Trans2 Recv Date:	07-Aug-2013 00:00:00
TSD Site Recv Date:	21-Aug-2013 00:00:00
Part A Recv Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDf ID: INR000110197
Waste Code: Not reported
Quantity: 5
Units: P - Pounds
Number of Containers: 1
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 006302629FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJR000063677
Generator Ship Date: 31-Jul-2013 00:00:00
Trans1 Recv Date: 31-Jul-2013 00:00:00
Trans2 Recv Date: 07-Aug-2013 00:00:00
TSD Site Recv Date: 21-Aug-2013 00:00:00
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDf ID: INR000110197
Waste Code: Not reported
Quantity: 4
Units: P - Pounds
Number of Containers: 1
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 006302629FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EOR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJR000063677
Generator Ship Date: 31-Jul-2013 00:00:00
Trans1 Recv Date: 31-Jul-2013 00:00:00
Trans2 Recv Date: 07-Aug-2013 00:00:00
TSD Site Recv Date: 21-Aug-2013 00:00:00
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: INR000110197
Waste Code: Not reported
Quantity: 1
Units: P - Pounds
Number of Containers: 1
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 006302629FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJR000063677
Generator Ship Date: 31-Jul-2013 00:00:00
Trans1 Recv Date: 31-Jul-2013 00:00:00
Trans2 Recv Date: 07-Aug-2013 00:00:00
TSD Site Recv Date: 21-Aug-2013 00:00:00
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: INR000110197
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Quantity: 1
Units: P - Pounds
Number of Containers: 1
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1
Year: 2013
Manifest Tracking Num: 006302629FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 2012-07-10
Trans1 Recv Date: 2012-07-10
Trans2 Recv Date: 2012-07-13
TSD Site Recv Date: 2012-07-18
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: INR000110197
Waste Code: Not reported
Quantity: 2.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 005401627FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 2012-07-10
Trans1 Recv Date: 2012-07-10
Trans2 Recv Date: 2012-07-13
TSD Site Recv Date: 2012-07-18
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 3.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 005401627FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 2012-07-10
Trans1 Recv Date: 2012-07-10
Trans2 Recv Date: 2012-07-13
TSD Site Recv Date: 2012-07-18
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 4.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Year: 2012
Manifest Tracking Num: 005401627FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 2012-12-13
Trans1 Recv Date: 2012-12-13
Trans2 Recv Date: 2012-12-19
TSD Site Recv Date: 2012-12-28
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: INR000110197
Waste Code: Not reported
Quantity: 8.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 005520082FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 2012-07-10
Trans1 Recv Date: 2012-07-10

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL (Continued)

S100171255

Trans2 Recv Date: 2012-07-13
TSD Site Recv Date: 2012-07-18
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 3.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 005401627FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 2012-07-10
Trans1 Recv Date: 2012-07-10
Trans2 Recv Date: 2012-07-13
TSD Site Recv Date: 2012-07-18
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 2.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 005401627FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EPA ID Number

EPA ID Number
S100171255

MOBIL (Continued)

S100171255

Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: CTD983872698
Trans2 State ID: NJD054126164
Generator Ship Date: 2012-07-10
Trans1 Recv Date: 2012-07-10
Trans2 Recv Date: 2012-07-13
TSD Site Recv Date: 2012-07-18
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982182792
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: INR000110197
Waste Code: Not reported
Quantity: 4.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: L Landfill
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 005401627FLE
Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

[Click this hyperlink](#) while viewing on your computer to access
1 additional NY_MANIFEST record(s) in the EDR Site Report.

61
SW
1/4-1/2
0.393 mi.
2077 ft.

GARDEN STEWART CORP
200 MCKAY ROAD
HUNTINGTON, NY

LTANKS S100491844
N/A

Relative:
Lower

LTANKS:
Site ID: 266923
Spill Number/Closed Date: 9208116 / 3/15/1995
Spill Date: 10/13/1992
Spill Cause: Tank Test Failure

Actual:
198 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GARDEN STEWART CORP (Continued)

S100491844

Spill Source: Commercial/Industrial
Spill Class: No spill occurred. (Not Possible)
Cleanup Ceased: 3/15/1995
Cleanup Meets Standard: True
SWIS: 5226
Investigator: T/T/F
Referred To: Not reported
Reported to Dept: 10/14/1992
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered in Computer: 10/14/1992
Spill Record Last Update: 3/16/1995
Spiller Name: Not reported
Spiller Company: GARDEN STEWART CORP
Spiller Address: 1 JERICO TPKE
Spiller City,St,Zip: NEW HYDE PARK, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 1
DER Facility ID: 217425
DEC Memo: Not reported
Remarks: 3K FAILED HORNER EZ CHECK II, ANS TESTER

Material:
Site ID: 266923
Operable Unit ID: 974904
Operable Unit: 01
Material ID: 408718
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: 266923
Spill Tank Test: 1540705
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

62
NNW
1/4-1/2
0.427 mi.
2257 ft.

HUNTINGTON HOUSING AUTHORITY
5 LOWNDES AVE
HUNTINGTON STATION, NY

RCRA NonGen / NLR
FINDS
LTANKS
NY Spills

1000413050
NYD981870207

Relative:
Lower

RCRA NonGen / NLR:

Date form received by agency: 01/01/2007
Facility name: HUNTINGTON HOUSING AUTHORITY
Facility address: 5 LOWNDES AVE
HUNTINGTON STATION, NY 11746
EPA ID: NYD981870207
Mailing address: LOWNDES AVE
HUNTINGTON STATION, NY 11746
Contact: Not reported
Contact address: LOWNDES AVE
HUNTINGTON STATION, NY 11746
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler; Non-Generators do not presently generate hazardous waste

Actual:
206 ft.

Owner/Operator Summary:

Owner/operator name: HUNTINGTON HOUSING AUTHORITY
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: HUNTINGTON HOUSING AUTHORITY
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUNTINGTON HOUSING AUTHORITY (Continued)

1000413050

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: HUNTINGTON HOUSING AUTHORITY
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: HUNTINGTON HOUSING AUTHORITY
Classification: Not a generator, verified

Date form received by agency: 12/11/1986
Facility name: HUNTINGTON HOUSING AUTHORITY
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004411645

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

LTANKS:

Site ID: 189866
Spill Number/Closed Date: 8603290 / 1/6/1987
Spill Date: 8/18/1986
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Cleanup Ceased: 1/6/1987
Cleanup Meets Standard: True
SWIS: 5226
Investigator: CXONEILL
Referred To: Not reported
Reported to Dept: 8/18/1986
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered in Computer: 8/25/1986
Spill Record Last Update: 5/18/2012
Spiller Name: Not reported
Spiller Company: HUNTINGTON HOUSING AUTH

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

HUNTINGTON HOUSING AUTHORITY (Continued)

1000413050

Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 1
DER Facility ID: 158442
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "O'NEILL FD" // : DEC INVESTIGATE, TANK REMOVED 12/16/86,NO HOLES NOR CONTAMINATION FOUND.FILE HAS BEEN DESTROYED ACCORDING TO STATE ARCHIVE AND RECORD ADMINISTRATOR RETENTION/DISPOSAL PROCEDURES
Remarks: POSSIBLE PROBLEM WITH ABANDONED PIPING SINCE FEED AND RETURN LINES WERE REPLUMBED LAST YEAR. -.318GPH

Material:
Site ID: 189866
Operable Unit ID: 900184
Operable Unit: 01
Material ID: 476120
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: 189866
Spill Tank Test: 1530137
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

SPILLS:
Facility ID: 1201595
DER Facility ID: 418709
Facility Type: ER
Site ID: 464313
DEC Region: 1
Spill Date: 5/18/2012
Spill Number/Closed Date: 1201595 / Not Reported
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS: 5226
Investigator: dhraymon

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EPA ID Number
EDR ID Number

HUNTINGTON HOUSING AUTHORITY (Continued)

1000413050

Referred To: Not reported
Reported to Dept: 5/18/2012
CID: Not reported
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 1
Date Entered In Computer: 5/18/2012
Spill Record Last Update: 5/19/2012
Spiller Name: Not reported
Spiller Company: TOWN OF HUNTINGTON HOUSING AUTHORITY
Spiller Address: Not reported
Spiller City,St,Zip: NY 11746
Spiller Company: 999
Contact Name: JAMES AUFIERO
Contact Phone: (631) 840-7284 cell
DEC Memo:

THIS IS THE "GATEWAY GARDENS" HOUSING COMPLEX OWNED BY THE TOWN OF HUNTINGTON HOUSING AUTHORITY; THERE HAVE BEEN OTHER INCIDENTS AT THIS COMPLEX DR05/18/12 1200 Hrs (A): Jim called- this involved the removal of a 4,000gal fuel oil tank. DEC REMINDED HIM THIS OFFICE IS REQUIRED TO BE NOTIFIED PRIOR TO THE REMOVAL OF REGULATED TANKS.05/18/12 1200 Hrs (B): He said he was on site with EVA BODULA OF THE SUFFOLK COUNTY HEALTH DEPARTMENT, AND STATEWIDE UTILITIES, then transferred DEC to Bodula.05/18/12 1200 Hrs (C): Bodula confirmed this was "Gateway Gardens", and DEC informed her that there had been earlier incidents at this complex.05/18/12 1200 Hrs (D): As per Bodula, the tank is DOUBLEWALL FIBERGLASS BUT DID NOT HAVE PROPER LEAK DETECTION, AND THE SITE IS UNDER A CONSENT ORDER WITH HER DEPARTMENT TO ADDRESS VARIOUS TANK ISSUES.05/18/12 1200 Hrs (E): She said the spillage appeared to be due to overfills from the manway sump. THERE WAS AN ODOR, BUT NO STAINING, TO THE SOIL UNDER THE TANK, AND NO SOIL HAD YET BEEN EXCAVATED.05/18/12 1200 Hrs (F): THE TANK WAS IN CLOSE PROXIMITY TO THE BUILDING, WHICH IS ON A SLAB. DEC informed her that it was this Department's policy that in such situations the contractor has the final determination whether to excavate any soil.05/18/12 1200 Hrs (F): She said the LI Analytical had taken endpoint soil samples BEFORE she arrived. DEC RECOMMENDED THAT SHE HAVE THEM RESAMPLE IN HER PRESENCE ONCE STATEWIDE HAD DETERMINED THEY WERE FINISHED WITH ANY SOIL REMOVAL.05/18/12 1200 Hrs (H): DEC then informed her that Statewide could backfill the excavation once the new endpoint samples had been taken, and asked her to direct LI Analytical to forward a copy of their report to this office for review.05/18/12 1200 Hrs (I): DEC asked her to send a copy of her report to this office, and to direct Statewide to call this office next week to determine who had been assigned to the case. DR unknown

Remarks:

Material:
Site ID: 464313
Operable Unit ID: 1214370
Operable Unit: 01
Material ID: 2212410
Material Code: 0001A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

HUNTINGTON HOUSING AUTHORITY (Continued)

1000413050

Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

N63
SW
1/4-1/2
0.451 mi.
2379 ft.

100 RAILROAD STREET
HUNTINGTON STATION, NY

SWF/LF S111378452
RGA LF N/A

Site 1 of 2 in cluster N

Relative:
Lower

SWF/LF:

Actual:
198 ft.

Flag: ACTIVE
Region Code: 1
Phone Number: 6312710147
Owner Name: John Brigati
Owner Type: Private
Owner Address: 400 W. Pulaski Rd
Owner Addr2: Not reported
Owner City,St,Zip: Huntington, NY 11743
Owner Email: Not reported
Owner Phone: 6312714141
Contact Name: John Brigati
Contact Address: 400 W. Pulaski Road
Contact Addr2: Not reported
Contact City,St,Zip: Huntington, NY 11743
Contact Email: wpwgrowers@live.com
Contact Phone: 6312714141
Activity Desc: C&D processing - registration
Activity Number: [52W179R]
Active: Yes
East Coordinate: 633242
North Coordinate: 4523055
Accuracy Code: 1 - No accuracy stated
Regulatory Status: Registration
Waste Type: Asphalt,Brick,Concrete,Rock,Soil (Clean)
Authorization #: 52W179R
Authorization Date: 11/25/2011
Expiration Date: Not reported

RGA LF:

2012 WHITE POST WHOLESALE GROWERS 100 RAILROAD STREET

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	11 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5
2	11 inches	18 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5
3	18 inches	27 inches	gravelly loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5
4	27 inches	59 inches	stratified gravelly sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Well-graded sand.	Max: 141 Min: 141	Max: 6 Min: 4.5

Soil Map ID: 3

Soil Component Name: Haven

Soil Surface Texture: highly decomposed plant material

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	1 inches	highly decomposed plant material	A-8	Highly organic soils, Peat.	Max: 42 Min: 1.4	Max: 5.5 Min: 4.5
2	1 inches	5 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5
3	5 inches	18 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5
4	18 inches	27 inches	gravelly loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5
5	27 inches	59 inches	stratified gravelly sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Well-graded sand.	Max: 141 Min: 141	Max: 6 Min: 4.5

Soil Map ID: 4

Soil Component Name: Haven

Soil Surface Texture: highly decomposed plant material

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	1 inches	highly decomposed plant material	A-8	Highly organic soils, Peat.	Max: 42 Min: 1.4	Max: 5.5 Min: 4.5
2	5 inches	18 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5
3	1 inches	5 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5
4	18 inches	27 inches	gravelly loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5
5	27 inches	59 inches	stratified gravelly sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Well-graded sand.	Max: 141 Min: 141	Max: 6 Min: 4.5

Soil Map ID: 5

Soil Component Name: Montauk

Soil Surface Texture: fine sandy loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 67 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	1 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 4	Max: 6 Min: 3.6
2	1 inches	27 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 4	Max: 6 Min: 3.6
3	27 inches	59 inches	loamy sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4 Min: 0.42	Max: 6 Min: 3.6

Soil Map ID: 6

Soil Component Name: Riverhead

Soil Surface Texture: sandy loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	11 inches	sandy loam	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 14	Max: 5.5 Min: 4.5
2	11 inches	27 inches	sandy loam	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 14	Max: 5.5 Min: 4.5
3	27 inches	35 inches	gravelly loamy sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 42 Min: 14	Max: 5.5 Min: 4.5
4	35 inches	64 inches	stratified coarse sand to gravelly sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Well-graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 141	Max: 5.5 Min: 4.5

Soil Map ID: 7

Soil Component Name: Cut and fill land

Soil Surface Texture: sandy loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 153 inches

Depth to Watertable Min: > 0 inches

No Layer Information available.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 8

Soil Component Name: Plymouth

Soil Surface Texture: sand

Hydrologic Group: Class A - High infiltration rates. Soils are deep, well drained to excessively drained sands and gravels.

Soil Drainage Class: Excessively drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	3 inches	sand	Granular materials (35 pct. or less passing No. 200), Fine Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 5.5 Min: 3.6
2	3 inches	27 inches	sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 5.5 Min: 3.6
3	27 inches	59 inches	gravelly coarse sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Clean Sands, Well-graded sand.	Max: 141 Min: 141	Max: 5.5 Min: 3.6

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
1	USGS40000834733	1/4 - 1/2 Mile NNW
2	USGS40000834495	1/2 - 1 Mile WSW
3	USGS40000834391	1/2 - 1 Mile SW
A4	USGS40000834303	1/2 - 1 Mile SSW
A5	USGS40000834304	1/2 - 1 Mile SSW
B6	USGS40000834802	1/2 - 1 Mile NE
B7	USGS40000834794	1/2 - 1 Mile NE
B8	USGS40000834795	1/2 - 1 Mile NE
16	USGS40000834963	1/2 - 1 Mile North
17	USGS40000834917	1/2 - 1 Mile NNE

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
B15	NY0010526	1/2 - 1 Mile NE

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
B9	NYWS005852	1/2 - 1 Mile NE
B10	NYWS005853	1/2 - 1 Mile NE
B11	NYWS005854	1/2 - 1 Mile NE
B12	NYWS005849	1/2 - 1 Mile NE
B13	NYWS005850	1/2 - 1 Mile NE
B14	NYWS005851	1/2 - 1 Mile NE

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Database EDR ID Number

1
 NNW
 1/4 - 1/2 Mile
 Higher

FED USGS USGS40000834733

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405127073250001		
Monloc name:	S 28. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	Not Reported	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8575984
Longitude:	-73.4162314	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	156.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifename:	Not Reported		
Formation type:	Not Reported		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	174
Welldepth units:	ft	Wellholedepth:	Not Reported
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 91

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1959-05-13		96.31	1959-02-06		96.30
1959-01-07		96.83	1958-12-02		97.21
1958-10-29		97.79	1958-10-06		98.08
1958-08-29		98.64	1958-07-30		98.93
1958-06-27		99.20	1958-05-23		98.69
1958-05-01		97.79	1958-04-17		97.06
1958-04-10		96.68	1958-04-03		96.20
1958-03-27		95.95	1958-03-20		95.84
1958-03-13		95.75	1958-03-06		95.59
1958-03-05		95.55	1958-01-31		94.84
1958-01-07		94.45	1957-12-02		94.32
1957-11-08		94.51	1942-04-18		92.61
1942-04-11		92.53	1942-04-04		92.44
1942-03-28		92.34	1942-03-21		92.21
1942-03-14		92.17	1942-03-07		92.09
1942-02-28		92.12	1942-02-21		92.10
1942-02-14		92.11	1942-02-07		92.00
1942-01-31		92.24	1942-01-24		92.24
1942-01-17		92.35	1942-01-10		92.37
1942-01-03		92.34	1941-12-27		92.32
1941-12-20		92.35	1941-12-13		92.44
1941-12-06		92.46	1941-11-29		92.55
1941-11-22		92.54	1941-11-15		92.58
1941-11-08		92.69	1941-11-01		92.61

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Ground-water levels, continued.

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1941-10-25		92.62	1941-10-18		92.55
1941-10-11		92.67	1941-10-04		92.68
1941-09-27		92.71	1941-09-20		92.82
1941-09-13		93.04	1941-09-06		93.24
1941-08-30		93.24	1941-08-23		93.22
1941-08-16		93.27	1941-08-09		93.29
1941-08-02		93.52	1941-07-26		93.49
1941-07-19		93.57	1941-07-12		93.60
1941-07-05		93.59	1941-06-28		93.52
1941-06-21		93.76	1941-06-14		93.74
1941-06-07		93.76	1941-05-31		93.66
1941-05-24		93.78	1941-05-17		93.86
1941-05-10		93.76	1941-05-03		93.64
1941-04-26		93.38	1941-04-19		93.35
1941-04-12		93.39	1941-04-05		93.24
1941-03-29		93.10	1941-03-22		93.22
1941-03-15		93.18	1941-03-08		93.18
1941-03-01		93.19	1941-02-22		93.22
1941-02-15		93.24	1941-02-08		93.34
1941-02-01		93.53	1941-01-25		93.49
1941-01-18		93.41	1941-01-11		93.52
1941-01-04		93.68			

2
WSW
1/2 - 1 Mile
Higher

FED USGS USGS40000834495

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405101073252201		
Monloc name:	S 74573. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8503763
Longitude:	-73.4223428	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	Not Reported
Vert measure units:	Not Reported	Vertacc measure val:	Not Reported
Vert accmeasure units:	Not Reported		
Vertcollection method:	Not Reported		
Vert coord refsys:	Not Reported	Countrycode:	US
Aquifername:	Not Reported		
Formation type:	Not Reported		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	Not Reported
Welldepth units:	Not Reported	Wellholedepth:	650
Wellholedepth units:	ft		

Ground-water levels, Number of Measurements: 0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Database EDR ID Number

3
SW
 1/2 - 1 Mile
 Lower

FED USGS USGS40000834391

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405041073251501		
Monloc name:	S 46871. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8448208
Longitude:	-73.4203984	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	196.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Magothy Aquifer		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	836
Welldepth units:	ft	Wellholedepth:	Not Reported
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 0

A4
SSW
 1/2 - 1 Mile
 Lower

FED USGS USGS40000834303

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405027073250201		
Monloc name:	S 29. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8409319
Longitude:	-73.4167873	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	Not Reported
Vert measure units:	Not Reported	Vertacc measure val:	Not Reported
Vert accmeasure units:	Not Reported		
Vertcollection method:	Not Reported		
Vert coord refsys:	Not Reported	Countrycode:	US
Aquifername:	Not Reported		
Formation type:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Aquifer type:	Not Reported	Welldepth:	120
Construction date:	Not Reported	Wellholedepth:	Not Reported
Welldepth units:	ft		
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 9

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1959-05-13		66.41	1959-02-06		67.12
1958-12-02		67.51	1958-10-06		67.47
1958-07-30		67.32	1958-06-03		66.29
1958-05-08		65.19	1958-03-20		63.53
1958-02-06		63.12			

A5
SSW
1/2 - 1 Mile
Lower

FED USGS USGS40000834304

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405027073250301		
Monloc name:	S 16137. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8409319
Longitude:	-73.417065	Source map scale:	24000
Horiz. Acc. measure:	1	Horiz. Acc. measure units:	seconds
Horiz. Collection method:	Interpolated from map		
Horiz. coord. refs.:	NAD83	Vert. measure val.:	160.0
Vert. measure units:	feet	Vert. acc. measure val.:	0.1
Vert. acc. measure units:	feet		
Vert. collection method:	Level or other surveying method		
Vert. coord. refs.:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		
Aquifer type:	Not Reported		
Construction date:	19580724	Welldepth:	604
Welldepth units:	ft	Wellholedepth:	604
Wellholedepth units:	ft		

Ground-water levels, Number of Measurements: 0

B6
NE
1/2 - 1 Mile
Lower

FED USGS USGS40000834802

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405135073235501		
Monloc name:	S 38785. 1		
Monloc type:	Well		
Monloc desc:	SCWA BROADWAY #3	HUNTINGTON STATION	
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8598206
Longitude:	-73.3995642	Source map scale:	24000

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refs:	NAD83	Vert measure val:	105.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refs:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Magothy Aquifer		
Aquifer type:	Not Reported		
Construction date:	19710330	Welldepth:	666
Welldepth units:	ft	Wellholedepth:	702
Wellholedepth units:	ft		

Ground-water levels, Number of Measurements: 0

B7
NE
1/2 - 1 Mile
Lower

FED USGS USGS40000834794

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405134073235802		
Monloc name:	S 27070. 1		
Monloc type:	Well		
Monloc desc:	SCWA BROADWAY #2	HUNTINGTON STATION	
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8595428
Longitude:	-73.3990086	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refs:	NAD83	Vert measure val:	209.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refs:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		
Aquifer type:	Not Reported		
Construction date:	19660517	Welldepth:	560
Welldepth units:	ft	Wellholedepth:	612
Wellholedepth units:	ft		

Ground-water levels, Number of Measurements: 0

B8
NE
1/2 - 1 Mile
Higher

FED USGS USGS40000834795

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405134073235702		
Monloc name:	S 21121. 1		
Monloc type:	Well		
Monloc desc:	SCWA BROADWAY #1	HUNTINGTON STATION	
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8595428
Longitude:	-73.3987308	Sourcemap scale:	24000

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refs:	NAD83	Vert measure val:	220.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refs:	NGVD29	Countrycode:	US
Aquifemame:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		
Aquifer type:	Not Reported		
Construction date:	19630402	Welldepth:	600
Welldepth units:	ft	Wellholedepth:	621
Wellholedepth units:	ft		

Ground-water levels, Number of Measurements: 4

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1971-02-11		40.80	1970-03-10		43.60
1966-02-02		41.80	1963-04-02		50.54

B9
NE
1/2 - 1 Mile
Lower

NY WELLS NYWS005852

Well id:	NY5110526	System name:	SUFFOLK COUNTY WATER AUTHORITY
System id:	124	Well name:	BROADWAY WELL # 3 S-38785
Type:	Well	Active?:	Active
County:	SUFFOLK COUNTY	Latitude:	405135 000
Longitude:	732356 000	Slec_type_:	AC
Agency:	MURRAY, ROBERT L.		
Address:	180 Fifth Avenue		
City/State/Zip:	BAYSHORE NY 11706		
Phone:	631-665-0662		

B10
NE
1/2 - 1 Mile
Lower

NY WELLS NYWS005853

Well id:	NY5110526	System name:	SUFFOLK COUNTY WATER AUTHORITY
System id:	122	Well name:	BROADWAY WELL # 1 S-21121
Type:	Well	Active?:	Active
County:	SUFFOLK COUNTY	Latitude:	405135 000
Longitude:	732356 000	Slec_type_:	AC
Agency:	RANDAZZO, KAREN		
Address:	PO BOX 18043		
City/State/Zip:	HAUPPAUGUE NY 11788		
Phone:	631-583-0258		

B11
NE
1/2 - 1 Mile
Lower

NY WELLS NYWS005854

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Well Id: NY5110526
 System Id: 122
 Type: Well
 County: SUFFOLK COUNTY
 Longitude: 732356 000
 Agency: MURRAY, ROBERT L.
 Address: 180 Fifth Avenue
 City/State/Zip: BAYSHORE NY 11706
 Phone: 631-665-0662

System name:
 Well name:
 Active?:
 Latitude:
 Slec_type_:

SUFFOLK COUNTY WATER AUTHORITY
 BROADWAY WELL # 1 S-21121
 Active
 405135 000
 AC

B12
NE
 1/2 - 1 Mile
 Lower

NY WELLS NYWS005849

Well Id: NY5110526
 System Id: 124
 Type: Well
 County: SUFFOLK COUNTY
 Longitude: 732356 000
 Agency: RANDAZZO, KAREN
 Address: PO BOX 18043
 City/State/Zip: HAUPPAUGUE NY 11788
 Phone: 631-563-0258

System name:
 Well name:
 Active?:
 Latitude:
 Slec_type_:

SUFFOLK COUNTY WATER AUTHORITY
 BROADWAY WELL # 3 S-38785
 Active
 405135 000
 AC

B13
NE
 1/2 - 1 Mile
 Lower

NY WELLS NYWS005850

Well Id: NY5110526
 System Id: 123
 Type: Well
 County: SUFFOLK COUNTY
 Longitude: 732356 000
 Agency: MURRAY, ROBERT L.
 Address: 180 Fifth Avenue
 City/State/Zip: BAYSHORE NY 11706
 Phone: 631-665-0662

System name:
 Well name:
 Active?:
 Latitude:
 Slec_type_:

SUFFOLK COUNTY WATER AUTHORITY
 BROADWAY WELL # 2 S-27070
 Active
 405135 000
 AC

B14
NE
 1/2 - 1 Mile
 Lower

NY WELLS NYWS005851

Well Id: NY5110526
 System Id: 123
 Type: Well
 County: SUFFOLK COUNTY
 Longitude: 732356 000
 Agency: RANDAZZO, KAREN
 Address: PO BOX 18043
 City/State/Zip: HAUPPAUGUE NY 11788
 Phone: 631-563-0258

System name:
 Well name:
 Active?:
 Latitude:
 Slec_type_:

SUFFOLK COUNTY WATER AUTHORITY
 BROADWAY WELL # 2 S-27070
 Active
 405135 000
 AC

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Database EDR ID Number

B15
 NE
 1/2 - 1 Mile
 Higher

FRDS PWS NY0010526

PWS ID: NY0010526
 Date Initiated: Not Reported Date Deactivated: Not Reported
 PWS Name: SUFFOLK COUNTY WATER AUTHORITY
 POND ROAD
 OAKDALE, NY 11769

Addressee / Facility: System Owner/Responsible Party
 SUFFOLK COUNTY WATER AUTHORITY
 POND ROAD
 OAKDALE, NY 11769

Facility Latitude:	40 43 17	Facility Longitude:	073 15 36
Facility Latitude:	40 45 37	Facility Longitude:	073 16 33
Facility Latitude:	40 45 05	Facility Longitude:	073 13 14
Facility Latitude:	40 40 46	Facility Longitude:	073 25 20
Facility Latitude:	40 47 07	Facility Longitude:	073 18 58
Facility Latitude:	40 48 05	Facility Longitude:	073 05 14
Facility Latitude:	40 46 32	Facility Longitude:	073 07 06
Facility Latitude:	40 45 54	Facility Longitude:	072 56 19
Facility Latitude:	40 59 00	Facility Longitude:	072 06 24
Facility Latitude:	41 03 16	Facility Longitude:	071 56 47
Facility Latitude:	40 58 39	Facility Longitude:	072 11 45
Facility Latitude:	40 58 44	Facility Longitude:	072 08 24
Facility Latitude:	40 44 30	Facility Longitude:	073 21 16
Facility Latitude:	40 45 49	Facility Longitude:	073 10 44
Facility Latitude:	40 43 26	Facility Longitude:	073 17 38
Facility Latitude:	40 42 05	Facility Longitude:	073 24 22
Facility Latitude:	40 49 51	Facility Longitude:	073 04 30
Facility Latitude:	40 49 36	Facility Longitude:	073 06 04
Facility Latitude:	40 52 44	Facility Longitude:	072 58 50
Facility Latitude:	41 02 42	Facility Longitude:	071 55 44
Facility Latitude:	40 58 16	Facility Longitude:	072 10 06
Facility Latitude:	40 57 18	Facility Longitude:	072 12 29
Facility Latitude:	40 51 40	Facility Longitude:	073 19 07
Facility Latitude:	40 43 20	Facility Longitude:	073 20 19
Facility Latitude:	40 45 01	Facility Longitude:	073 18 22
Facility Latitude:	40 43 18	Facility Longitude:	073 15 38
Facility Latitude:	40 42 00	Facility Longitude:	073 21 25
Facility Latitude:	40 48 20	Facility Longitude:	073 07 40
Facility Latitude:	40 47 15	Facility Longitude:	072 59 59
Facility Latitude:	40 44 55	Facility Longitude:	073 03 33
Facility Latitude:	40 53 32	Facility Longitude:	072 24 22
Facility Latitude:	41 02 00	Facility Longitude:	071 57 36
Facility Latitude:	40 59 20	Facility Longitude:	072 17 05
Facility Latitude:	40 51 35	Facility Longitude:	073 23 56
Facility Latitude:	40 54 01	Facility Longitude:	073 27 59
Facility Latitude:	40 53 09	Facility Longitude:	073 22 34
Facility Latitude:	40 42 11	Facility Longitude:	073 25 01
Facility Latitude:	40 41 18	Facility Longitude:	073 22 45

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Facility Latitude:	40 44 28	Facility Longitude:	073 07 40
Facility Latitude:	40 48 11	Facility Longitude:	073 11 33
Facility Latitude:	40 43 24	Facility Longitude:	073 22 25
Facility Latitude:	40 40 49	Facility Longitude:	073 23 23
Facility Latitude:	40 51 04	Facility Longitude:	073 05 11
Facility Latitude:	40 47 53	Facility Longitude:	073 02 50
Facility Latitude:	40 49 03	Facility Longitude:	073 03 31
Facility Latitude:	40 49 45	Facility Longitude:	072 59 15
Facility Latitude:	40 49 55	Facility Longitude:	072 58 39
Facility Latitude:	41 02 58	Facility Longitude:	071 57 18
Facility Latitude:	40 54 13	Facility Longitude:	072 23 28
Facility Latitude:	40 53 57	Facility Longitude:	073 18 27
Facility Latitude:	40 53 35	Facility Longitude:	073 20 24
Facility Latitude:	40 53 05	Facility Longitude:	073 17 49
Facility Latitude:	40 53 43	Facility Longitude:	073 20 39
Facility Latitude:	40 51 21	Facility Longitude:	073 27 32
Facility Latitude:	40 45 26	Facility Longitude:	073 15 05
Facility Latitude:	40 43 57	Facility Longitude:	073 18 14
Facility Latitude:	40 47 52	Facility Longitude:	073 13 14
Facility Latitude:	40 50 38	Facility Longitude:	073 03 30
Facility Latitude:	41 02 28	Facility Longitude:	071 56 31
Facility Latitude:	40 51 58	Facility Longitude:	073 25 48
Facility Latitude:	40 54 36	Facility Longitude:	073 19 47
Facility Latitude:	40 52 54	Facility Longitude:	073 26 36
Facility Latitude:	40 54 13	Facility Longitude:	073 20 51
Facility Latitude:	40 52 56	Facility Longitude:	073 20 28
Facility Latitude:	40 43 05	Facility Longitude:	073 21 57
Facility Latitude:	40 45 39	Facility Longitude:	073 21 01
Facility Latitude:	40 46 59	Facility Longitude:	073 16 37
Facility Latitude:	40 45 11	Facility Longitude:	073 11 23
Facility Latitude:	40 44 32	Facility Longitude:	073 15 11
Facility Latitude:	40 41 58	Facility Longitude:	073 21 22
Facility Latitude:	40 44 02	Facility Longitude:	073 19 34
Facility Latitude:	40 42 32	Facility Longitude:	073 20 43
Facility Latitude:	40 40 50	Facility Longitude:	073 22 56
Facility Latitude:	40 47 37	Facility Longitude:	072 56 52
Facility Latitude:	40 46 16	Facility Longitude:	073 03 57
Facility Latitude:	40 54 11	Facility Longitude:	072 23 28
Facility Latitude:	40 51 17	Facility Longitude:	073 26 15
Facility Latitude:	40 52 48	Facility Longitude:	073 25 18
Facility Latitude:	40 43 50	Facility Longitude:	073 21 57
Facility Latitude:	40 46 05	Facility Longitude:	073 17 46
Facility Latitude:	40 43 07	Facility Longitude:	073 08 52
Facility Latitude:	40 45 21	Facility Longitude:	073 22 39
Facility Latitude:	41 03 28	Facility Longitude:	071 56 49
Facility Latitude:	40 46 16	Facility Longitude:	073 12 33
Facility Latitude:	40 43 04	Facility Longitude:	073 16 19
Facility Latitude:	40 48 02	Facility Longitude:	073 10 02
Facility Latitude:	40 48 02	Facility Longitude:	073 12 27
Facility Latitude:	40 44 20	Facility Longitude:	073 17 18
Facility Latitude:	40 42 23	Facility Longitude:	073 19 03
Facility Latitude:	41 03 22	Facility Longitude:	071 56 43
Facility Latitude:	41 03 05	Facility Longitude:	071 57 02
Facility Latitude:	40 53 16	Facility Longitude:	073 23 41
Facility Latitude:	40 49 57	Facility Longitude:	073 17 04
Facility Latitude:	40 52 32	Facility Longitude:	073 22 15

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Facility Latitude: 40 52 57
 City Served: ISLIP (T)
 Treatment Class: Not Reported

Facility Longitude: 073 23 03
 Population: Not Reported

Violations information not reported.

16
North
1/2 - 1 Mile
Lower

FED USGS USGS40000834963

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405159073244401		
Monloc name:	S 246. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030201	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8664873
Longitude:	-73.4117867	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	Not Reported
Vert measure units:	Not Reported	Vertacc measure val:	Not Reported
Vert accmeasure units:	Not Reported		
Vertcollection method:	Not Reported		
Vert coord refsys:	Not Reported	Countrycode:	US
Aquifername:	Not Reported		
Formation type:	Not Reported		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	Not Reported
Welldepth units:	Not Reported	Wellholeddepth:	Not Reported
Wellholeddepth units:	Not Reported		

Ground-water levels, Number of Measurements: 0

17
NNE
1/2 - 1 Mile
Lower

FED USGS USGS40000834917

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-405153073241101		
Monloc name:	S 40841. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	Not Reported	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8648206
Longitude:	-73.4026197	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	108.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Aquifer type: Not Reported
 Construction date: Not Reported
 Welldepth units: ft
 Wellholedepth units: Not Reported

Welldepth: 66
 Wellholedepth: Not Reported

Ground-water levels, Number of Measurements: 64

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1988-12-04		62.60	1986-09-04		63.41
1988-06-02		64.49	1986-03-18		65.12
1985-12-09		65.30	1985-09-20		66.90
1985-06-26		68.80	1985-04-10		68.89
1984-12-10		69.62	1984-09-19		69.60
1984-06-11		67.90	1984-03-20		66.11
1983-12-21		65.26	1983-09-16		65.03
1983-06-14		64.92	1983-03-16		62.54
1982-12-29		62.80	1982-09-27		62.10
1982-06-14		63.16	1982-03-15		63.08
1981-12-14		63.36	1981-09-14		64.37
1981-06-15		65.86	1981-03-26		67.70
1980-12-31		67.20	1980-09-25		68.05
1980-06-24		68.98	1980-03-24		68.34
1980-01-02		69.01	1979-09-20		69.43
1979-06-20		69.55	1979-03-26		67.52
1979-02-05		67.30	1978-12-22		67.47
1978-10-04		67.63	1978-06-19		67.00
1978-03-28		65.55	1977-12-27		64.10
1977-09-26		64.10	1977-06-23		64.87
1977-04-01		65.17	1976-12-21		65.97
1976-09-22		66.38	1976-06-22		66.74
1976-03-30		66.24	1975-12-30		65.29
1975-09-29		65.09	1975-06-25		65.38
1975-03-27		65.13	1974-12-16		65.66
1974-09-17		66.17	1974-07-18		66.67
1974-04-05		66.95	1974-01-03		66.81
1973-06-25		66.95	1973-03-27		65.35
1972-12-19		63.93	1972-09-27		63.32
1972-06-21		62.98	1972-03-27		62.42
1971-12-16		62.51	1971-09-24		63.13
1971-08-26		62.73	1971-06-09		62.89

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

AREA RADON INFORMATION

State Database: NY Radon

Radon Test Results

County	Town	Num Tests	Avg Result	Geo Mean	Max Result
SUFFOLK	BABYLON	49	1.07	0.76	5.5
SUFFOLK	BROOKHAVEN	117	1.61	1.22	7.5
SUFFOLK	E. HAMPTON	19	1.55	1.16	4.7
SUFFOLK	HUNTINGTON	146	2.13	1.47	22.2
SUFFOLK	ISLIP	61	1.19	0.74	10.4
SUFFOLK	NORTHPORT	4	1.43	1.12	2.5
SUFFOLK	RIVERHEAD	9	2.18	1.26	8.9
SUFFOLK	SHELTER ISLAND	1	1.1	1.1	1.1
SUFFOLK	SMITHTOWN	60	3.02	1.48	42.6
SUFFOLK	SOUTHAMPTON	24	0.99	0.8	2.8
SUFFOLK	SOUTHOLD	7	2.47	1.58	8.6

Federal EPA Radon Zone for SUFFOLK County: 3

- Note: Zone 1 indoor average level > 4 pCi/L.
 : Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
 : Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for SUFFOLK COUNTY, NY

Number of sites tested: 183

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	0.670 pCi/L	100%	0%	0%
Basement	1.010 pCi/L	98%	2%	0%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW[®] Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Services (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells

Source: New York Department of Health

Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database

Department of Environmental Conservation

Telephone: 518-402-8072

These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon

Source: Department of Health

Telephone: 518-402-7556

Radon Test Results

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6856

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

A
P
P
E
N
D
I
X
E

New York Ave and Railroad Street

New York Ave and Railroad Street

Huntington Station, NY 11746

Inquiry Number: 3836178.2

January 23, 2014

Certified Sanborn® Map Report

Certified Sanborn® Map Report

1/23/14

Site Name:
New York Ave and Railroad
New York Ave and Railroad
Huntington Station, NY 11746

Client Name:
Nobis Engineering, Inc.
585 Middlesex St
Lowell, MA 01851

EDR Inquiry # 3836178.2 **Contact:** Jeff Brunelle



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Nobis Engineering, Inc. were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Site Name: New York Ave and Railroad Street
Address: New York Ave and Railroad Street
City, State, Zip: Huntington Station, NY 11746
Cross Street:
P.O. # NA
Project: Huntington Station
Certification # 9D62-49FD-848F



Sanborn® Library search results
Certification # 9D62-49FD-848F

Maps Provided:

1968
1946
1930
1922
1914

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Nobis Engineering, Inc. (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2014 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1968 Source Sheets



Volume 1, Sheet 29



Volume 1, Sheet 32



Volume 1, Sheet 26



Volume 1, Sheet 28

1946 Source Sheets



Volume 1, Sheet 28



Volume 1, Sheet 26



Volume 1, Sheet 29



Volume 1, Sheet 32

1930 Source Sheets



Volume 1, Sheet 26



Volume 1, Sheet 28



Volume 1, Sheet 29



Volume 1, Sheet 32

1922 Source Sheets



Volume 1, Sheet 18



Volume 1, Sheet 20



Volume 1, Sheet 22



Volume 1, Sheet 16

1914 Source Sheets




Volume 1, Sheet 14



Volume 1, Sheet 15

1968 Certified Sanborn Map

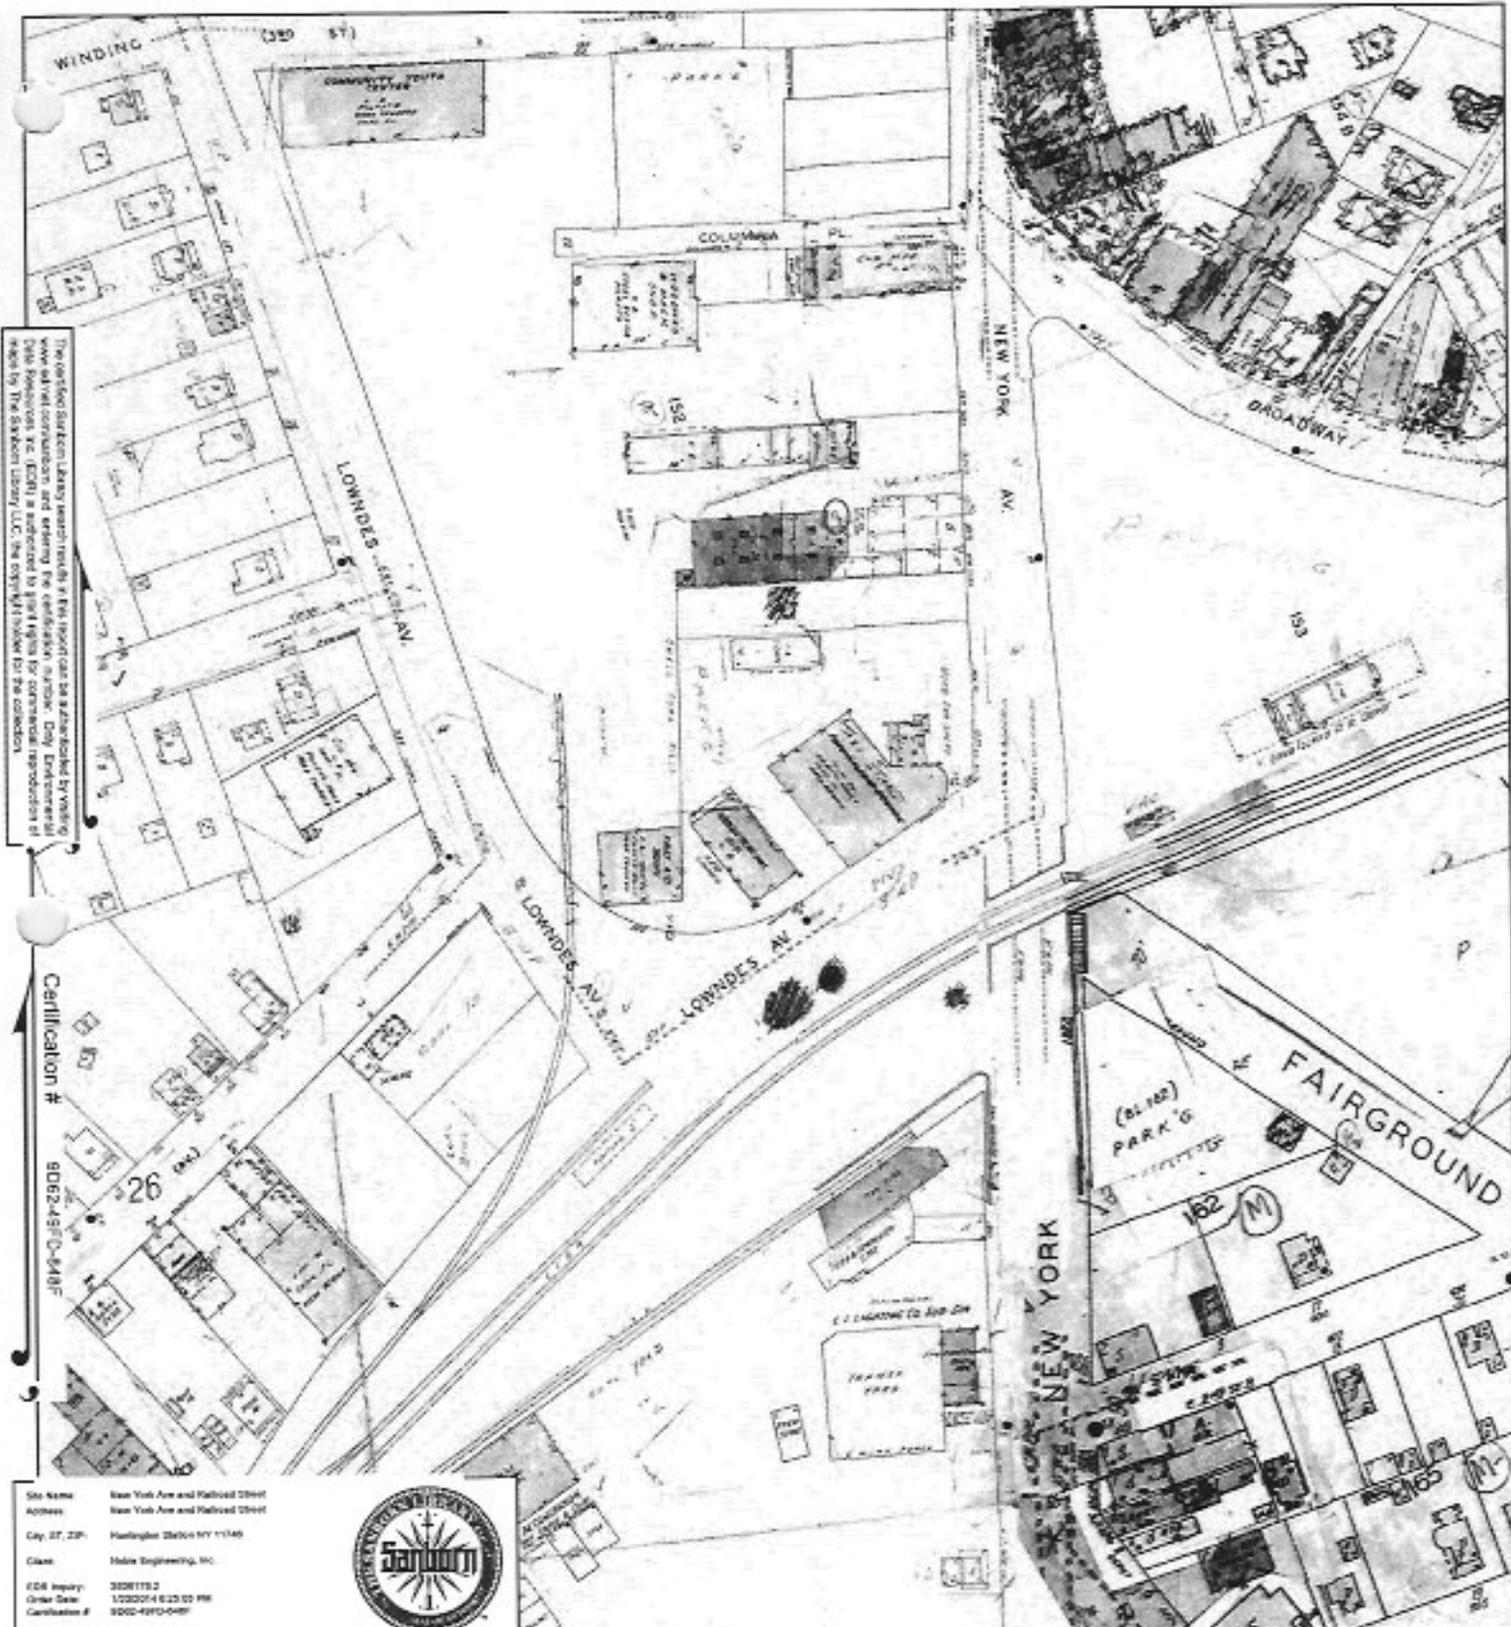



The certified Sanborn Library search results in this report can be attributed by visiting www.edi.com, and entering the certification number: City Environmental Data Resources, Inc. (CEDRI) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC. The copyright holder for the collection.

Certification #
SD62-450-048F

Site Name: New York Ave and Railroad Street
 Address: New York Ave and Railroad Street
 City, ST, ZIP: Hastings Station NY 11746
 Client: Mike Engineering, Inc.
 CED Inquiry: 3081182
 Order Date: 5/22/2014 6:25:00 PM
 Certification #: 9000-4910-048F
 Copyright: 2008




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

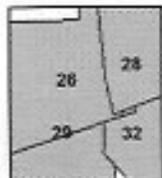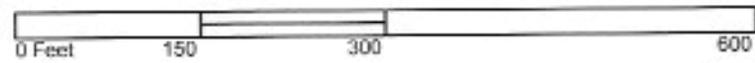

- Volume 1, Sheet 29
- Volume 1, Sheet 32
- Volume 1, Sheet 26
- Volume 1, Sheet 28



1946 Certified Sanborn Map

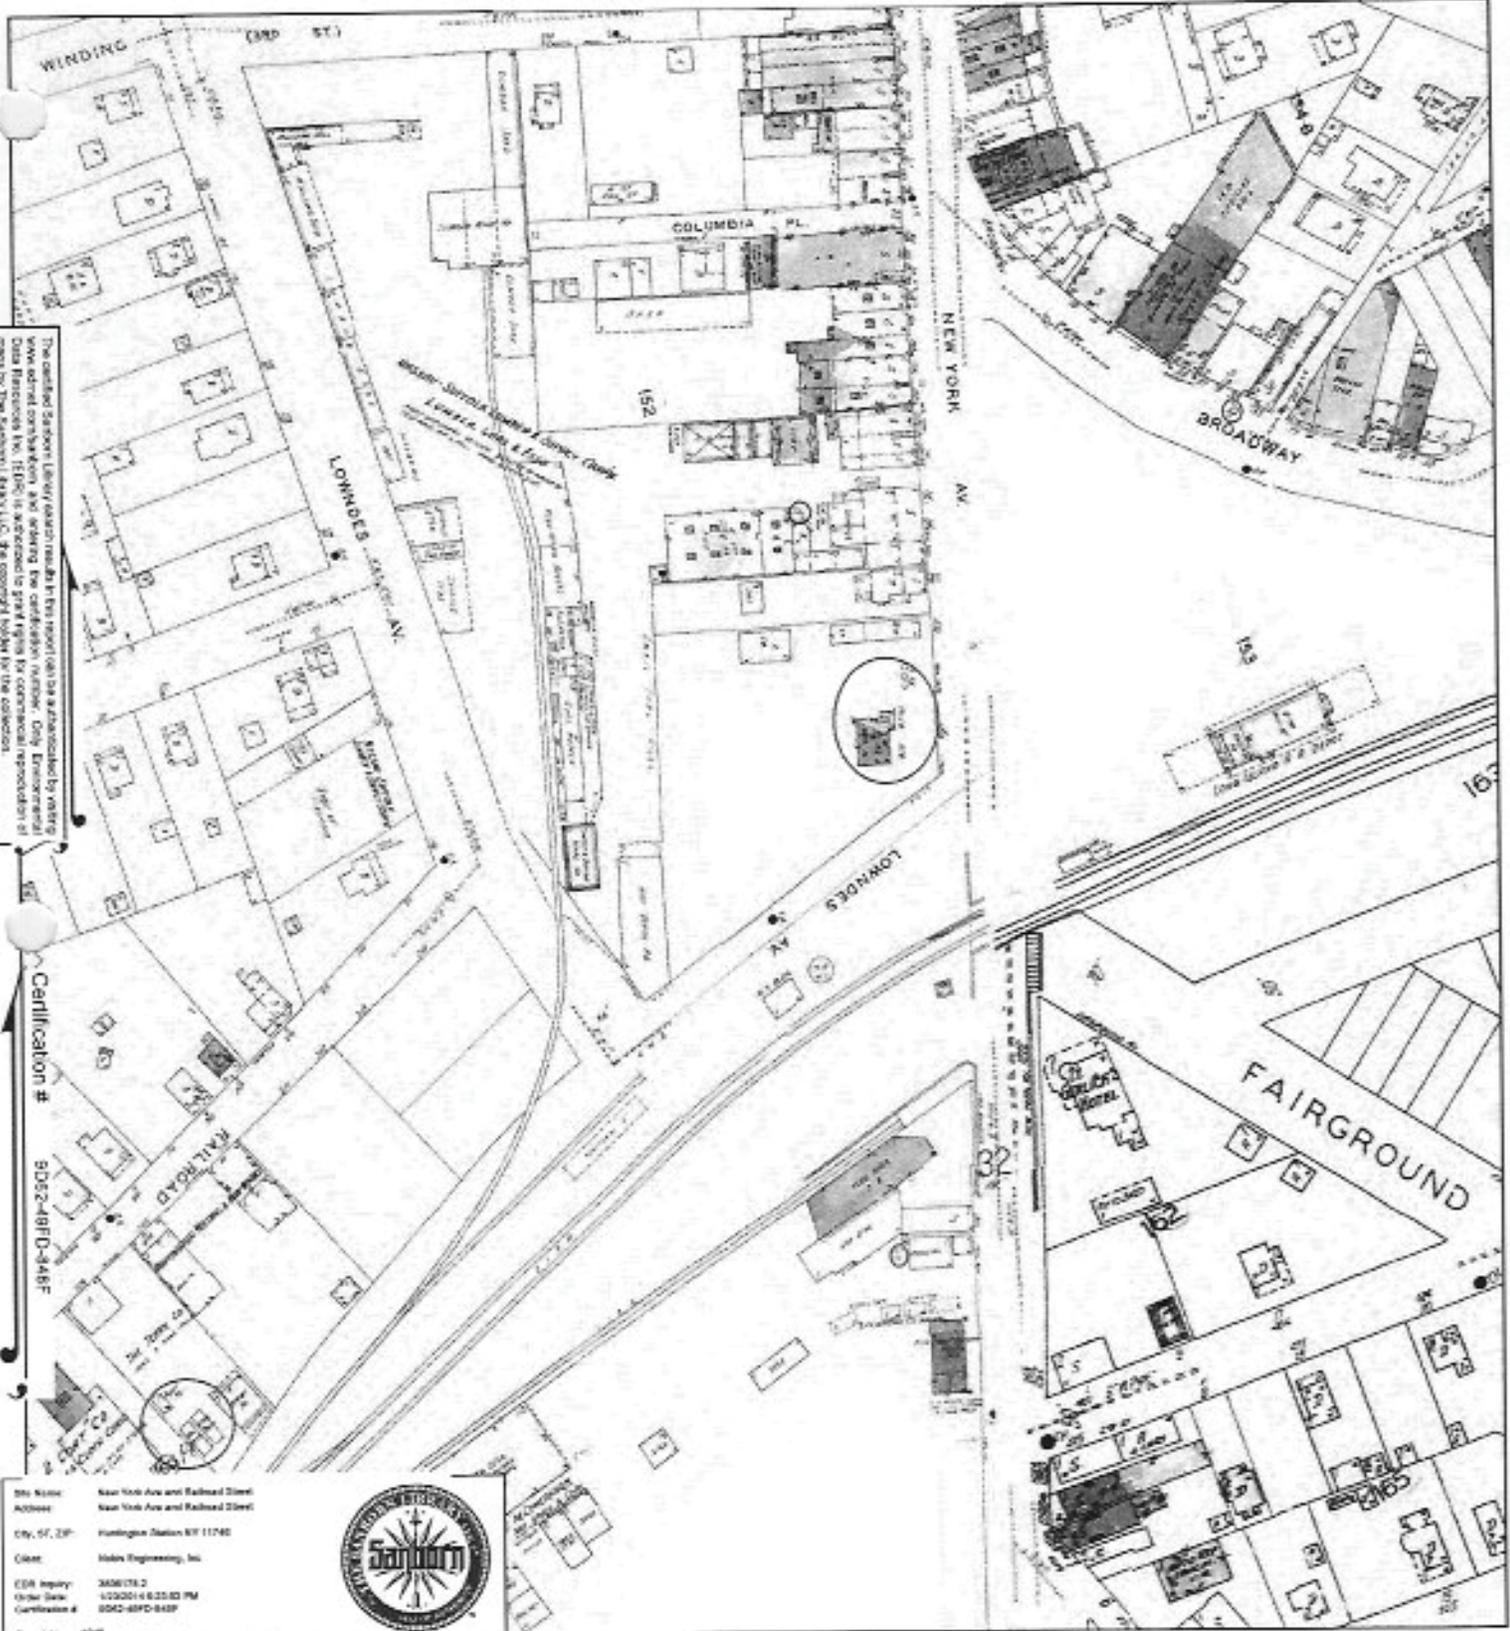



The certified Sanborn Library edition results in this report can be accessed by using the online search tool and adding the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC. See copyright notice for the details.

Certification # 9552-48FD-446F

Site Name: Near York Ave and Railroad Street
 Address: Near York Ave and Railroad Street
 City, St, Zip: Hightstown NJ 07104
 Client: Miller Engineering, Inc.
 EDR Inquiry: 3/30/2012
 Order Date: 1/23/2014 8:23:03 PM
 Certification #: 9552-48FD-446F
 Copyright: 2012




This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

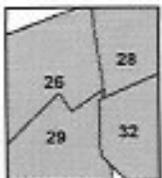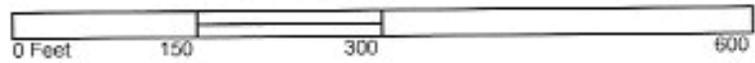

- Volume 1, Sheet 20
- Volume 1, Sheet 28
- Volume 1, Sheet 29
- Volume 1, Sheet 32



1930 Certified Sanborn Map

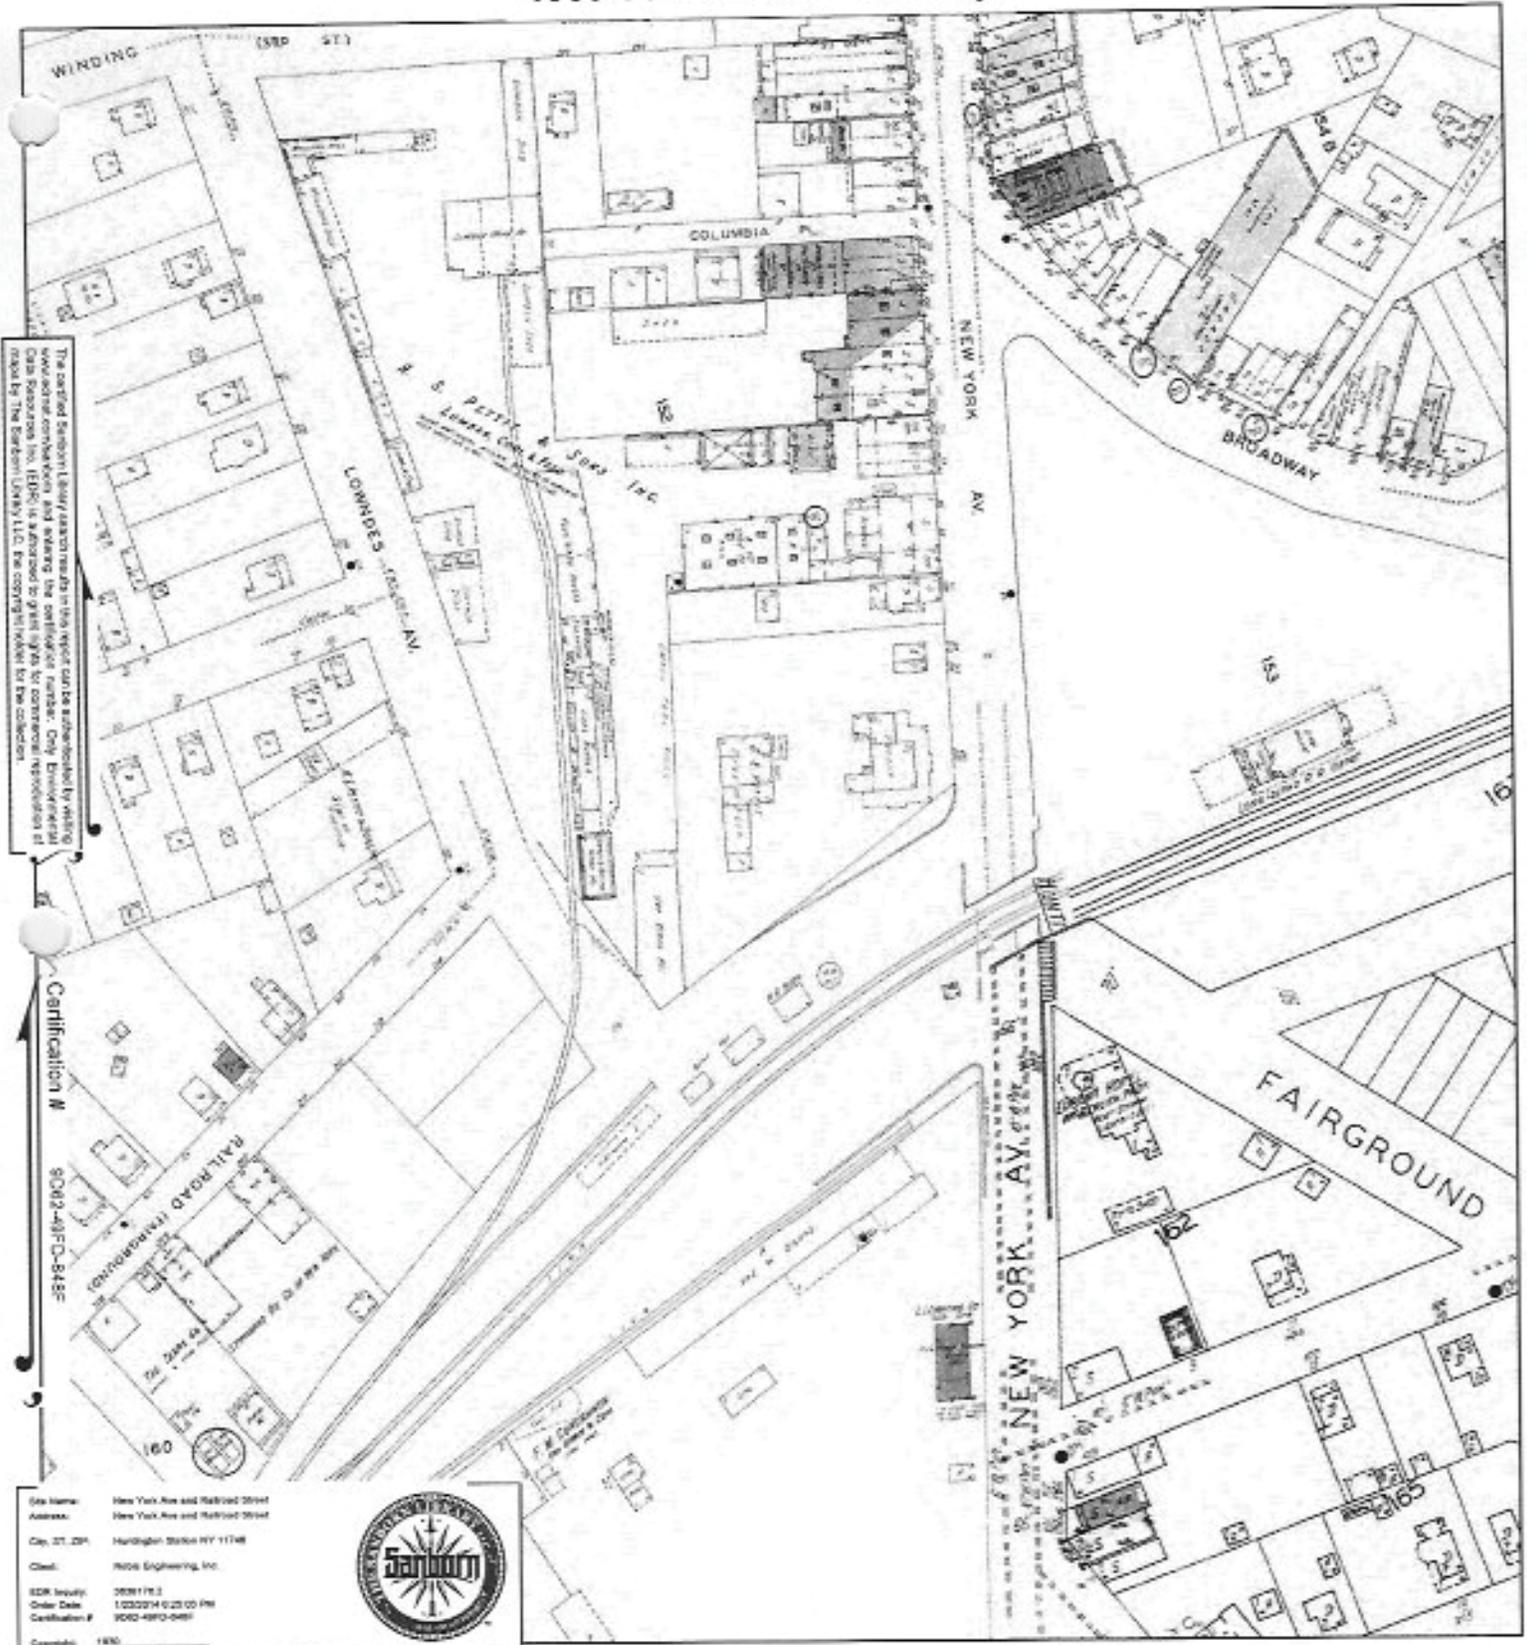



The certified Sanborn Library associations in this report can be substituted by using
 your agent's contribution and making the certificate number. Only Environmental
 Data Resources, Inc. (EDRI) is authorized to grant rights for commercial reproduction of
 maps by The Sanborn Library, LLC. For copying information for the collection.

Certification # 9082-48FD-8456

Site Name: New York Ave and Railroad Street
 Address: New York Ave and Railroad Street
 City, St, Zip: Huntington Station NY 11748
 Client: RDC Engineering, Inc.
 EDRI Inquiry: 3836178
 Order Date: 1/23/2014 02:00 PM
 Certification #: 9082-48FD-8456
 Copyright: 1930




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

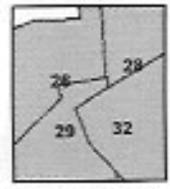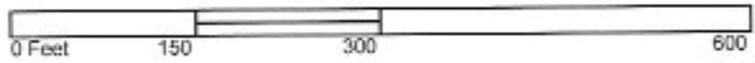

- Volume 1, Sheet 26
- Volume 1, Sheet 28
- Volume 1, Sheet 29
- Volume 1, Sheet 32



1922 Certified Sanborn Map

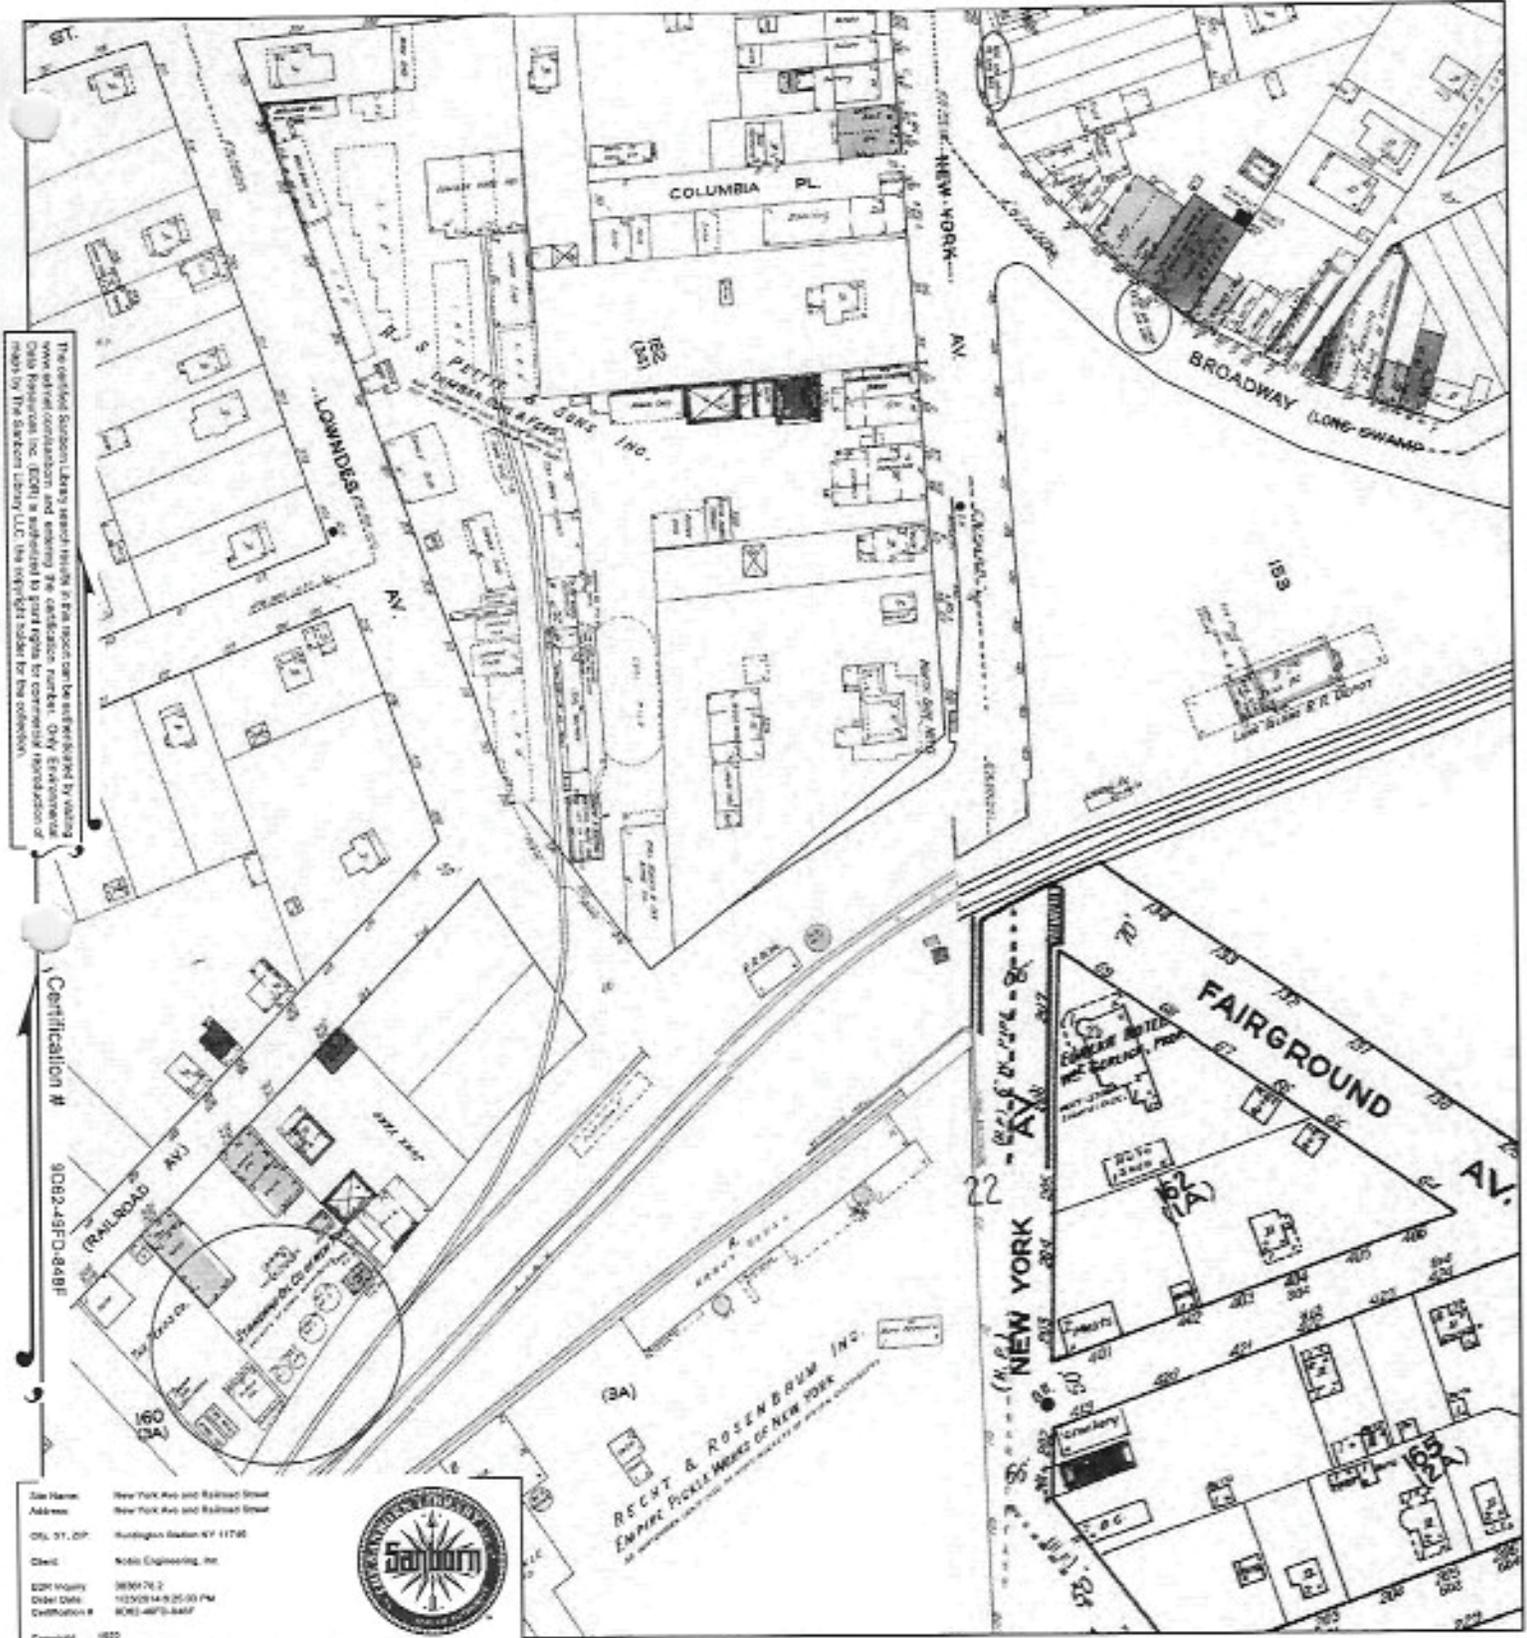

The certified Sanborn Map search results in this report can be retrieved by visiting
 www.electronicdata.com and entering the certification number. Only Electronic
 Data Resources, Inc. (EDRI) is authorized to grant rights for commercial reproduction of
 maps by The Sanborn Library LLC. Use subject to the conditions.



Certification # 9082-48D-488F

Site Name: New York Ave and Railroad Street
 Address: New York Ave and Railroad Street
 City, St, ZIP: Hurlingham Station NY 11748
 Client: Noble Engineering, Inc.
 EDRI Inquiry: 3836178-2
 Digit Date: 11/25/2014 9:25:00 PM
 Certification #: 9082-48D-488F
 Copyright: 1922



RECHT & ROSENBERG INC.
 EMPIRE PICKLE MEATS OF NEW YORK

This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

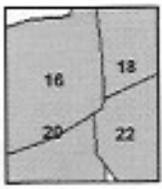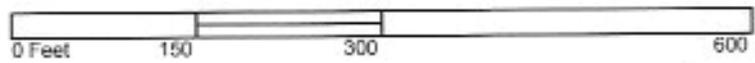

- Volume 1, Sheet 18
- Volume 1, Sheet 20
- Volume 1, Sheet 22
- Volume 1, Sheet 16



1914 Certified Sanborn Map



The original Sanborn Library search results in this report can be advanced by using our advanced comparison, and adding the navigation number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC. The copyright holder for the collection.

Certification # 9262-48FD-848F

Site Name: New York Ave and Railroad Street
 Address: New York Ave and Railroad Street
 City, St., ZIP: Huttigton Station NY 11740
 Client: Nobs Engineering, Inc.
 EDR Inquiry: 2020/10/2
 Order Date: 10/22/2014 8:25:03 AM
 Certification #: 8262-48FD-848F
 Copyright: 2014



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

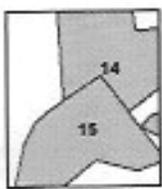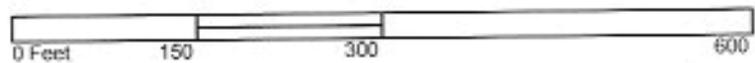

Volume 1, Sheet 14
 Volume 1, Sheet 15



New York Ave and Railroad Street
New York Ave and Railroad Street
Huntington Station, NY 11746

Inquiry Number: 3836178.4
January 23, 2014

The EDR Aerial Photo Decade Package



440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

EDR Aerial Photo Decade Package

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2014 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Date EDR Searched Historical Sources:

Aerial Photography January 23, 2014

Target Property:New York Ave and Railroad Street
Huntington Station, NY 11746

<u>Year</u>	<u>Scale</u>	<u>Details</u>	<u>Source</u>
1947	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Date: January 01, 1947	EDR
1953	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Date: December 02, 1953	EDR
1957	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Date: March 01, 1957	EDR
1966	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Date: March 29, 1966	EDR
1974	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Date: January 01, 1974	EDR
1976	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Date: January 01, 1976	EDR
1980	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Date: January 01, 1980	EDR
1994	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; DOQQ - acquisition dates: April 08, 1994	EDR
2006	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Year: 2006	EDR
2008	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Year: 2008	EDR
2009	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Year: 2009	EDR
2011	Aerial Photograph. Scale: 1"=500'	Panel #: 40073-G4, Huntington, NY; Flight Year: 2011	EDR



INQUIRY #: 3836178.4

YEAR: 1947

| = 500'





INQUIRY #: 3836178.4

YEAR: 1953

| = 500'



INQUIRY #: 3836178.4

YEAR: 1957



| = 500'





INQUIRY #: 3836178.4

YEAR: 1966

| = 500'





INQUIRY #: 3836178.4

YEAR: 1974

| = 500'





INQUIRY #: 3836178.4

YEAR: 1976



| = 500'



INQUIRY #: 3836178.4

YEAR: 1980

| = 500'





INQUIRY #: 3836178.4

YEAR: 1994

| = 500'





INQUIRY #: 3836178.4

YEAR: 2006

| = 500'





INQUIRY #: 3836178.4

YEAR: 2008

| = 500'





INQUIRY #: 3836178.4

YEAR: 2009

| = 500'





INQUIRY #: 3836178.4

YEAR: 2011

— = 500'



New York Ave and Railroad Street
New York Ave and Railroad Street
Huntington Station, NY 11746

Inquiry Number: 3810998.4
December 16, 2013

EDR Historical Topographic Map Report

EDR Historical Topographic Map Report

Environmental Data Resources, Inc.'s (EDR) Historical Topographic Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDR's Historical Topographic Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the early 1900s.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Historical Topographic Map




	TARGET QUAD NAME: NORTHPORT MAP YEAR: 1903	SITE NAME: New York Ave and Railroad Street ADDRESS: New York Ave and Railroad Street	CLIENT: Nobis Engineering, Inc. CONTACT: Jeff Brunelle INQUIRY#: 3810998.4 RESEARCH DATE: 12/16/2013
	SERIES: 15 SCALE: 1:62500	HUNTINGTON STATION, NY 11746 LAT/LONG: 40.8525 / -73.4123	

Historical Topographic Map



	TARGET QUAD NAME: ISLIP MAP YEAR: 1904	SITE NAME: New York Ave and Railroad Street ADDRESS: New York Ave and Railroad Street	CLIENT: Nobis Engineering, Inc. CONTACT: Jeff Brunelle INQUIRY#: 3810998.4 RESEARCH DATE: 12/16/2013
	SERIES: 30 SCALE: 1:125000	HUNTINGTON STATION, NY 11746 LAT/LONG: 40.8525 / -73.4123	

Historical Topographic Map

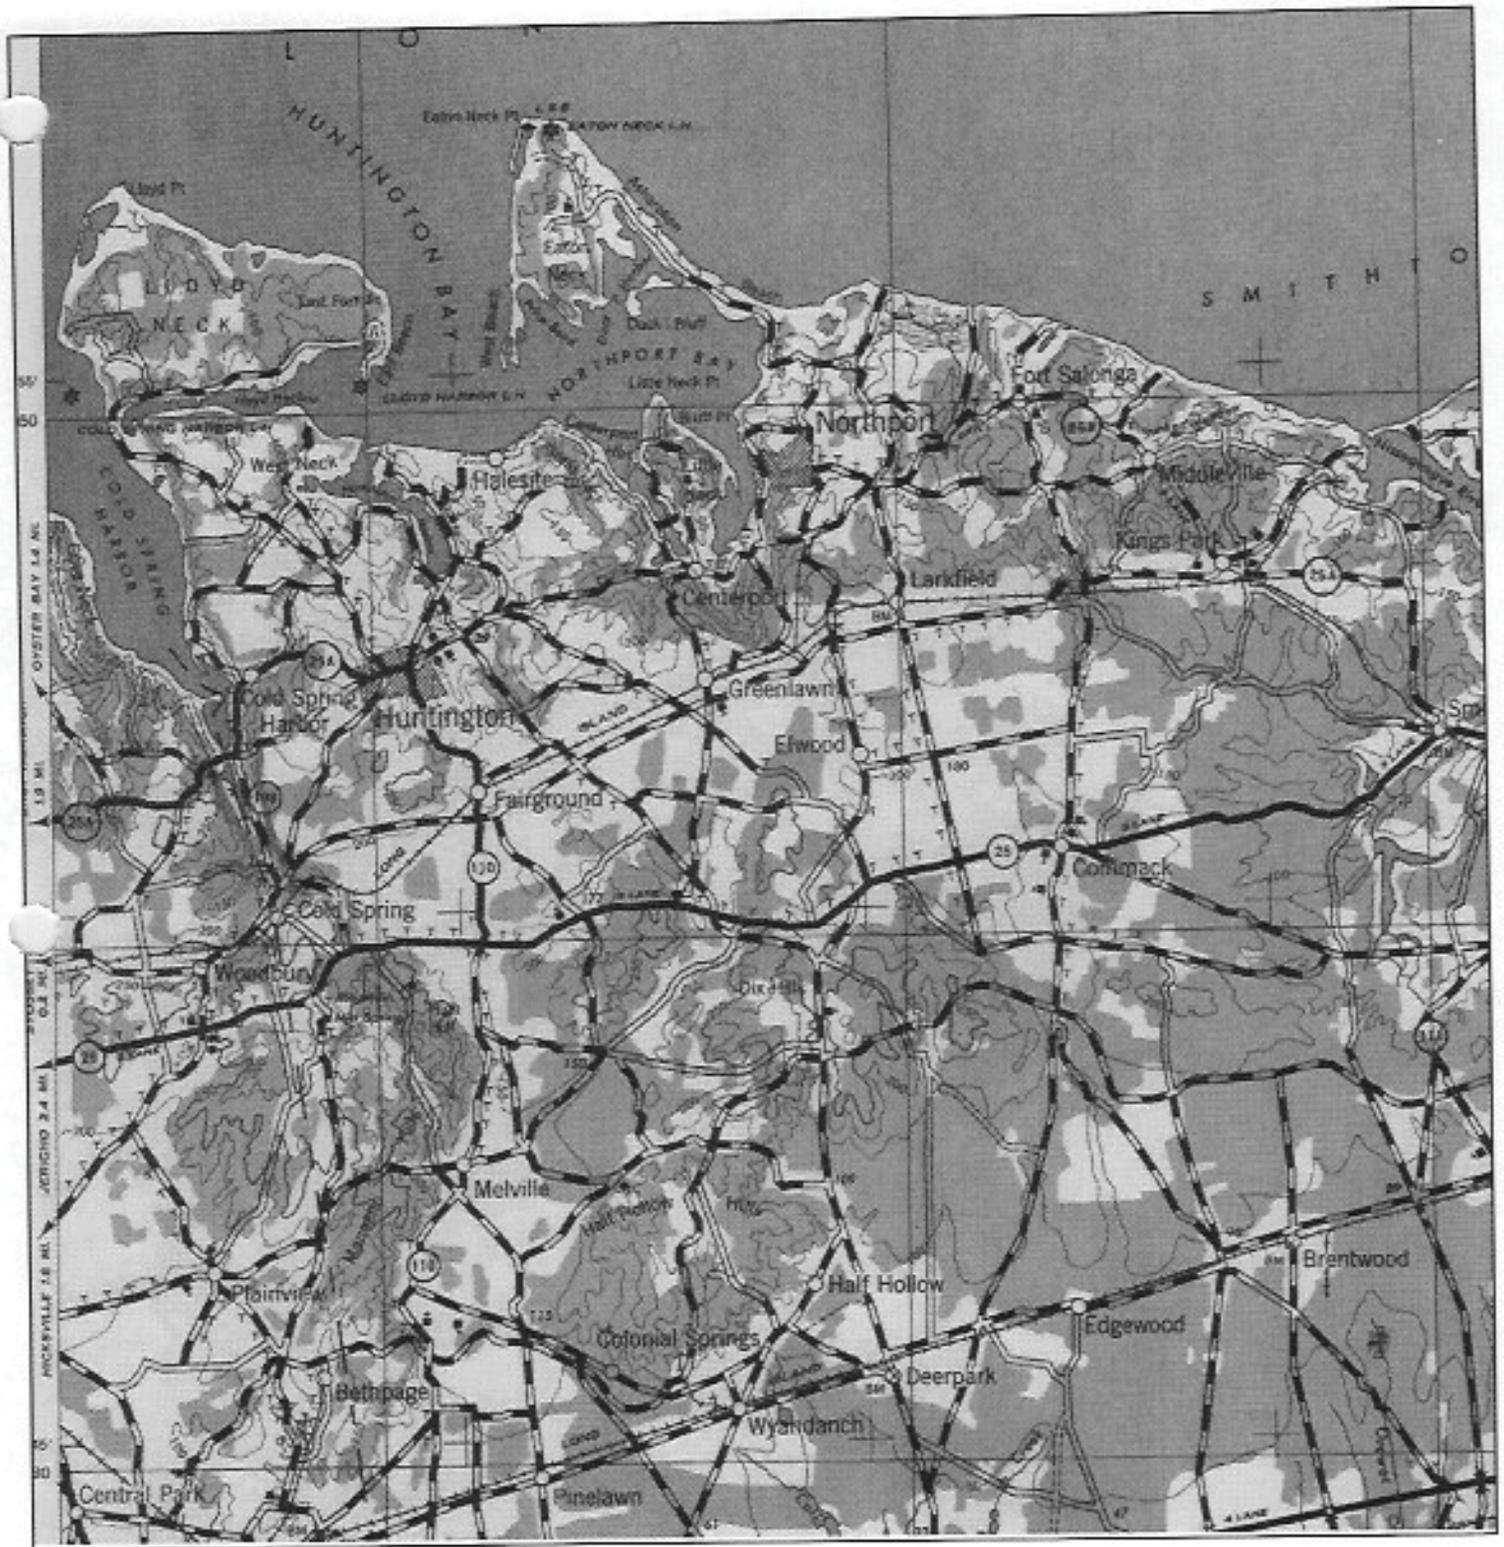

	TARGET QUAD NAME: ISLIP MAP YEAR: 1942	SITE NAME: New York Ave and Railroad Street ADDRESS: New York Ave and Railroad Street	CLIENT: Nobis Engineering, Inc. CONTACT: Jeff Brunelle INQUIRY#: 3810998.4 RESEARCH DATE: 12/16/2013
	SERIES: 30 SCALE: 1:125000	HUNTINGTON STATION, NY 11746 LAT/LONG: 40.8525 / -73.4123	

Historical Topographic Map




	TARGET QUAD NAME: HUNTINGTON MAP YEAR: 1947	SITE NAME: New York Ave and Railroad Street ADDRESS: New York Ave and Railroad Street	CLIENT: Nobis Engineering, Inc. CONTACT: Jeff Brunelle INQUIRY#: 3810998.4 RESEARCH DATE: 12/16/2013
	SERIES: 7.5 SCALE: 1:25000	Huntington Station, NY 11746 LAT/LONG: 40.8525 / -73.4123	

Historical Topographic Map



	TARGET QUAD NAME: HUNTINGTON MAP YEAR: 1954	SITE NAME: New York Ave and Railroad Street ADDRESS: New York Ave and Railroad Street	CLIENT: Nobis Engineering, Inc. CONTACT: Jeff Brunelle INQUIRY#: 3810998.4 RESEARCH DATE: 12/16/2013
	SERIES: 7.5 SCALE: 1:24000	LAT/LONG: 40.8525 / -73.4123 Huntington Station, NY 11746	

Historical Topographic Map

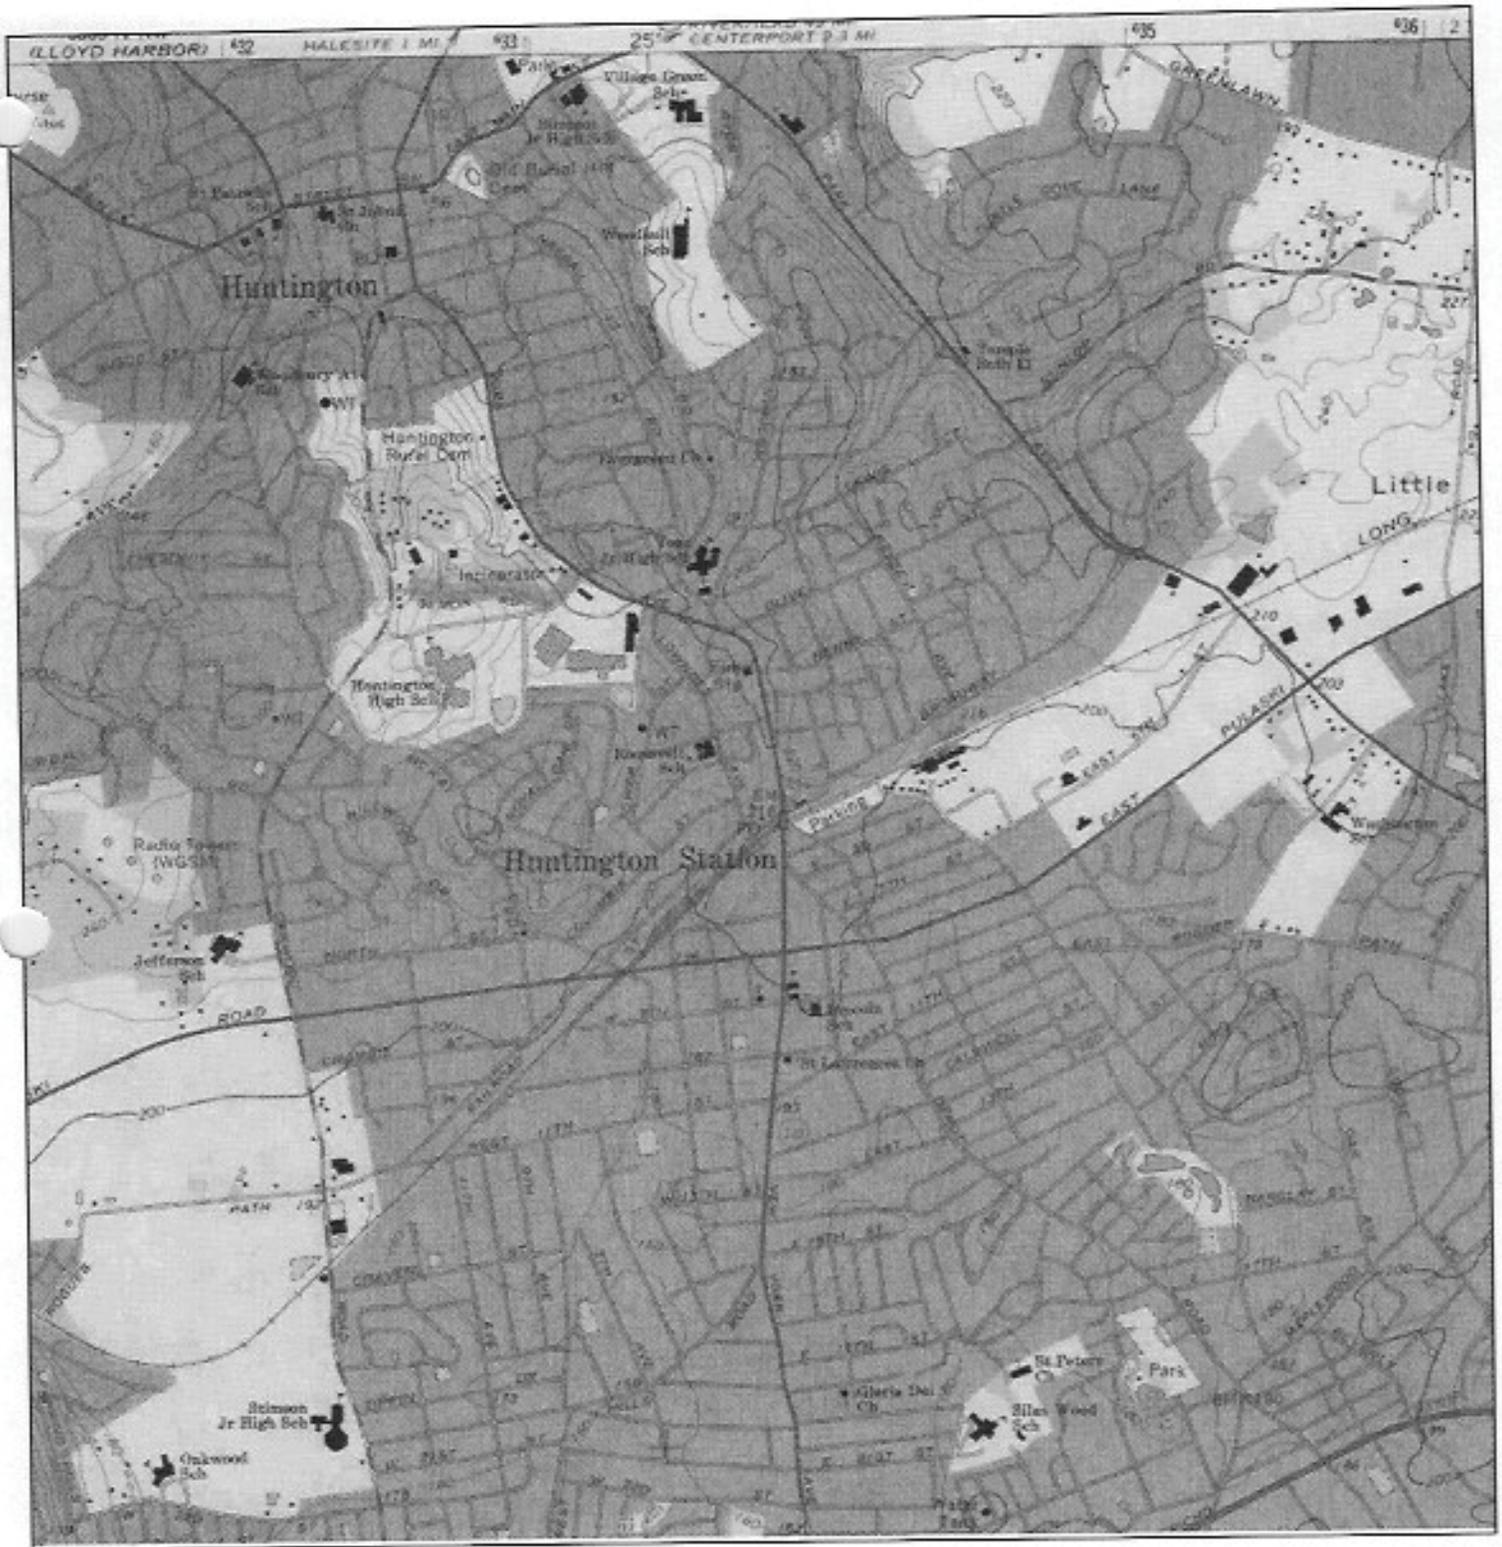

	TARGET QUAD NAME: HUNTINGTON MAP YEAR: 1967	SITE NAME: New York Ave and Railroad Street ADDRESS: New York Ave and Railroad Street	CLIENT: Nobis Engineering, Inc. CONTACT: Jeff Brunelle INQUIRY#: 3810998.4 RESEARCH DATE: 12/16/2013
	SERIES: 7.5 SCALE: 1:24000	HUNTINGTON STATION, NY 11746 LAT/LONG: 40.8525 / -73.4123	

Historical Topographic Map



	TARGET QUAD NAME: HUNTINGTON MAP YEAR: 1979 PHOTOREVISED FROM :1967 SERIES: 7.5 SCALE: 1:24000	SITE NAME: New York Ave and Railroad Street ADDRESS: New York Ave and Railroad Street Huntington Station, NY 11746 LAT/LONG: 40.8525 / -73.4123	CLIENT: Nobis Engineering, Inc. CONTACT: Jeff Brunelle INQUIRY#: 3810998.4 RESEARCH DATE: 12/16/2013

New York Ave and Railroad Street
New York Ave and Railroad Street
Huntington Station, NY 11746

Inquiry Number: 3810998.6
December 16, 2013

The EDR-City Directory Image Report



EDR® Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available city directory data at 5 year intervals.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

<u>Year</u>	<u>Target Street</u>	<u>Cross Street</u>	<u>Source</u>
2013	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Information Services
2008	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Information Services
2003	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Information Services
1999	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Information Services
1995	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Criss-Cross Directory
1990	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Criss-Cross Directory
1985	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Criss-Cross Directory
1980	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Criss-Cross Directory
1975	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Criss-Cross Directory

RECORD SOURCES

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.

FINDINGS

TARGET PROPERTY STREET

New York Ave and Railroad Street
Huntington Station, NY 11746

<u>Year</u>	<u>CD Image</u>	<u>Source</u>
<u>NEW YORK AVE</u>		
2013	pg A1	Cole Information Services
2008	pg A5	Cole Information Services
2003	pg A8	Cole Information Services
1999	pg A12	Cole Information Services
1995	pg A15	Cole Criss-Cross Directory
1995	pg A16	Cole Criss-Cross Directory
1990	pg A18	Cole Criss-Cross Directory
1990	pg A19	Cole Criss-Cross Directory
1985	pg A21	Cole Criss-Cross Directory
1980	pg A22	Cole Criss-Cross Directory
1975	pg A23	Cole Criss-Cross Directory

RAILROAD ST

2013	pg A4	Cole Information Services	
2008	pg A7	Cole Information Services	
2003	pg A11	Cole Information Services	
1999	pg A14	Cole Information Services	
1995	pg A17	Cole Criss-Cross Directory	
1990	pg A20	Cole Criss-Cross Directory	
1985	-	Cole Criss-Cross Directory	Street not listed in Source
1980	-	Cole Criss-Cross Directory	Street not listed in Source
1975	-	Cole Criss-Cross Directory	Street not listed in Source

FINDINGS

CROSS STREETS

No Cross Streets Identified

City Directory Images

NEW YORK AVE 2013

1006	PAWN SHOP OF HUNTINGTON
1014	HUNTINGTON AUTO PARTS UHAUL
1024	ROBERT CARABALLO
1026	EL PICACHO CORPORATION PULAPANSAK RESTAURANT
1036	PARTS PLUS PERFORMANCE INC
1038	ANTIQUES AT YANKEE PEDDLER
1044	0 ZERO ZERO ZERO TWENTY FOUR H BRIGHT WASH USA CLARUS CLEANERS JENNYS DELI MARIAS FAMOUS PIZZA CHICKEN & RIBS
1078	MAJORIE DELANEY
1264	HUNTINGTON STATION ENRICHMENT CENTER
1268	DAVID HARRIS DOROTHY ANTHONY HUTINGTON COMMUNITY DEVELOPMENT AGEN SANTE BENITEZ SHANTEE DANIEL THE DENTAL CENTER
1290	3 BROTHERS ONE CORPORATION AMOCO CENTER OF SOUND CRYSTAL SOUND
1291	EUROPEAN CAR TECHNIQUE RXR JUSTIN BROWN AUTO RPR SVCE
1297	7ELEVEN
1300	DIAMANTE UNISEX BEAUTY SALON PETES WOOD FLOOR & JANITORIAL SUPPLI QUICK AUTO INSURANCE SOHO BEAUTY SALON TAX AUTHORITY
1320	FLOWERDALE LTD
1326	RICHARD BAUER
1328	E A ENVIRONMENTAL ASSOC CORP METROPOLITAN DEVELOPMENT GROUP INCOR YORK MANAGEMENT
1335	CHURCH OF JESUS CHRIST OF LATTERDAY HUNTINGTON PUBLIC LIBRARY THE CHURCH OF JESUS CHRIST OF LATTER
1342	DANALYN BOUS EDITH HOPKINS FERJON REALTY CORP MICHAEL DREW PROMESAS PROMESAS
1344	ADA MUNIZ CATRACHOS UNISEX SALON CONRADO INSURANCE SINFOROS VASQUEZ

NEW YORK AVE 2013 (Cont'd)

1345	DOYLE SAILMAKERS INC FRESH FARMS JOSEPH FANNING ROTHMAN MURRAY
1346	BARELY NOTHING LINGERIE
1355	DAVID SPERLING LAW OFFICE OF DAVID M SPERLIN SPERLING DAVID M
1357	CONTINENTAL EXCHANGE SOLUTIONS INC
1380	JACOBSEN A L FUNERAL HOME INC
1389	BLEND CITY ELSA RAMLOGAN JEFF FITZPATRICK NEW YORK PUBLIC INTEREST RESEARCH GR
1395	KING JUDITH NUZHAT SIDDIQUI
1399	THE LAW OFFICE OF XAVIER A PALACIOS
1403	CHINA DELIGHT KITCHEN
1405	FLASH PHOTO TUTIENDA TUTIENDA
1415	COMPRUEBE DELI MINI MARKET NY CORP FITS RIGHT LOCKSMITH
1419	CARLOS VELEZ MELISSA RESTRNT OLGAS INTERNATIONAL
1425	AMERICAN DELI CENTRAL HECTOR CORTES SOCIETY OF ST VINCENT DE PAUL
1429	TAQVERIA MEXICO LINDO
1433	GSCI TELECOM NETWORKS JTA COMMUNICATIONS
1435	ANYKUT CARPET
1437	OCCUPANT UNKNOWN
1439	ROBERTO SANTOLAYA
1445	ALBORNOZ EDUARDO E CARLINE PREVAL CASTLETON GARDENS REALTY INC EDUARDO ALBORNOZ ESPOSITO VINCENT M HAMP CONSULTING JOHN KAY PREVAL CARLINE SUNRISE CAREER INSTITUTE
1450	FAMILY SERVICE LEAGUE OPENING WORD PROGRAM TOWN OF HUNTINGTON SENIOR CITIZEN SA
1454	MISHAEL GROCERY CORP
1455	TENNIS COURT EQUIPMENT & MATERIALS
1466	LAKEIVA MILLER
1475	CARMEN MOLINA

Target Street

Cross Street

Source

✓

-

Cole Information Services

NEW YORK AVE 2013 (Cont'd)

1475 SERVITAX INCORPORATED
TOP NOTCH ANSWERING SVCE

RAILROAD ST 2013

2	HUNTINGTON COMMUNITY FIRST AID SQUAD
5	JODAN AUTOMOTIVE SPECIALISTS
9	OCCUPANT UNKNOWN
11	OCCUPANT UNKNOWN
12	CANNON COLLISION OF HUNTINGTON CORP
13	BRIAN BAUER
	OCCUPANT UNKNOWN
	VICTOR GRANADOS
15	OCCUPANT UNKNOWN
16	SUBURBAN S MILLS INC
17	DRYWALL CONCEPTS CORP
	P PRECISION INT
18	SHANNON TRANSPORTATION
	TWIN TOWN TAXI SVCE CO
19	KEVIN MADDOX
	KEYANA MCQUEEN
20	D C A
	HILUME CORP
	LIBERTY DOOR WORKS INC
	W J NORTHRIDGE CONSTR CORP
21	ELAINE SMITH
23	CASONDRA RUDLAFF
	RASWAH OLIVER
25	ALBERTOS AUTOMOBILE SERVICE
	ANTONIO GOMEZ
27	PATRICIA ALLEN
29	FRANCO SANTOLI
31	JOHN COZZETORT

NEW YORK AVE 2008

1006 CELESTINE NEWKIRK
 1014 CASTLE AUTO PARTS INC
 1024 EDWIN GROCERY CORP
 1026 COYRACAON MEXICAN GROCERY
 EL PICACHO CORP
 1036 PARTS PLUS PERFORMANCE INC
 1038 BETTER HOME FURNITURE
 YANKEE PEDDLER ANTIQUES & WORKSHOP
 YANKEE PEDDLER INC
 1044 D & A LAUNDRY CENTER INC
 MARIAS FAMOUS PIZZA INC
 MNS DELI CORP
 NEW STATION CLEANERS
 STATION LAUNDROMAT
 1078 MAJORIE DELANEY
 1262 IGLESIA PENTECOSTAL REFUGIO
 1268 OCCUPANT UNKNOWN
 1291 EUROPEAN CAR TECHNIQUES RXR
 1300 PETE S FLOOR STANDING & JANITORIAL
 1320 FLOWERDALE LTD
 1326 RICHARD BAUER
 1328 EA ENVIRONMENTAL ASSOCIATES CORP
 MDG CONSTRUCTION CORP
 METROPOLITAN DEVELOPMENT GROUP INC
 1335 CHURCH OF JESUS CHRIST OF LATTER DAY
 THE CORP OF THE PRESIDENT OF THE CHU
 1342 ANA PLEITEZ
 E HOPKINS
 JOSE PEREZ
 PAULA SALGADO
 1344 CATRACHO UNISEX SALON
 CONRADO INSURANCE
 LAURA UNISEX
 1345 MELBOURNE C FISHER YACHT SAILS INC
 MICHAEL COSTANZA
 MURRAY ROTHMAN
 ON THE GO CUISINE
 1346 BARELY NOTHING LINGERIE
 1351 BLOCKBUSTER VIDEO
 1355 DAVID SPERLING
 LAW OFFICES SPERLING DAVID
 1357 CHOICE BEAUTY SUPPLY INC
 1359 INVIREX DEMOLITION INC
 1380 JACOBSENS FUNERAL
 VIRAG MADDEX FUNERAL DIRECTORS INC
 1391 AGAPEBEAUTY SALON INC
 1395 AMERICANS 4 LEGAL REFORM
 FEDERATED SECURITIES INC
 JUDITH C KING TAX SERVICE
 1399 DEPOT BARBR SHOP

NEW YORK AVE 2008 (Cont'd)

1403 CHINA DELIGHT KITCHEN
1405 FLASH PHOTO BY MARIO HERAS
1415 COMPREVE MINI MARKET
LATINO MARKET NEW YORK
1419 ALCOHOLICS ANONIMOS
MELISSA RESTAURANT
OCCUPANT UNKNOWN
1425 HECTOR CORTES
SAINT VINCENT DE PAUL THRIFT STORE
1429 LA GUADALUPANA INC
1433 GSCI TELECOM NETWORKS
J & TA COMMUNICATIONS INC
1435 ANY KUT CARPET
1437 OCCUPANT UNKNOWN
1439 PETRA CORTES
1445 ALBORNOZ EDUARDO E
CARLINE PREVAL MD PC
CASTLETON GARDENS REALTY INC
COASTAL LAND SERVICES INC
JOHN KAY
KAY JOHN ANDREW INSURANCE
1450 ST HUGHS RELIGIOUS EDUCATION DEPARTM
TOWN OF HUNTINGTON SENIOR CITIZEN
1454 MISHAEL GROCERY CORP
1466 IRMA DAVIS
JOEL EIZIKOVITS
LATARSHA BYNUM
R LOPEZ
1475 DEVINE ENTERTAINMENT INC
HUNTINGTON BAY CONSTRUCTION
JOSE VENTURA
SERVITAX INC

RAILROAD ST 2008

1	JULIO AVILA
2	HUNTINGTON COMMUNITY FIRST AID SQUAD
5	JODAN AUTOMOBILE SPECIALIST
7	MIRIAN BARBOSA
9	MARCUS MARRERO
	OCCUPANT UNKNOWN
	OSCAR REDON
	ROBERTO REYES
11	HUGO ESPINOZA
	MISAEEL RIVAS
	RON HAYNES
12	MARKHAM COLLISION & GLASS CORP
13	CARLOS MARTINEZ
	GERMAN CONTRERAS
	MARIA FUENTES
	OCCUPANT UNKNOWN
	RONALD HAYNES
	ROSA REYES
15	JOSE ORTIZ
16	SUBURBAN MILLS INC
17	BOYLE SERVICES INC
19	ATHENA HAWKINS
	KEYANA MCQUEEN
	NANCY MADDOX
20	HI LUME CORP
	LIBERTY DOORWORKS INC
	METRO INTERIOR DISTRIBUTORS
	PRECISION INTERIORS CONSTRUCTION
	RRA ASSOCIATES
	W J NORTHRIDGE CONSTRUCTION CORP
21	ANDRE KNOX
	MARITZA RIOS
23	DEANNA BOCCARD
25	ALBERTSONS AUTO SERVICE
	ANGELA BARBOSA
27	AMANDA NEWKIRK
29	SANTOLI FRANCO
31	OCCUPANT UNKNOWN

NEW YORK AVE 2003

1006	ALEX DUFF EDUARDO ARROYO GEORGE KEYS JAMES CRAIG JAY SCHWEITZER LATORA CHARLES LISA ONEAL MARVIN WILLIAMS
1014	CASTLE AUTO PARTS
1024	ANNAS KITCHEN
1026	ATMTC LAWN SPRNKLR SRVC LLC COYOCAN MEXICAN GROCERY SCHWARTZ GEOFF/ATMTC LAWN
1038	BETTER HOME FURNITURE & SLPCVR OCCUPANT UNKNOWN YANKEE PEDDLER ANTIQUES
1044	CLARUS CLEANERS JENNYS DELI MARIAS FAMOUS PIZZA CHCKN & RI RJH LAUNDROMAT CORP
1078	PALMA BROWN
1262	IGLESIA PENTECOSTAL REFUGIO DE
1268	REGINALD MARTIN ROSALBA CANALES
1290	MEHMET BOYNUINCE U HAUL CO
1291	OCCUPANT UNKNOWN RXR EUROPEAN CAR TECHNIK INC
1297	OCCUPANT UNKNOWN
1300	LAURA PETRICCIONE LAURA UNISEX PETES WOOD FLOOR & JNTRL SPLY
1320	FLOWERDALE LTD OCCUPANT UNKNOWN
1326	MOWER SHOP RICHARD BAUER SILHOUTTE LANDSCAPES
1328	NOVALEX CONTRACTING CORP NOVALEX MDG JV OCCUPANT UNKNOWN
1335	CHURCH OF JSUS CHRIST LDDRSNTS HUNTINGTON PUBLIC LIBRARY
1342	ANA PLEITEZ FER JON REALTY CORP
1344	CONRADO INSURANCE
1345	DIANA MALKIN DOYLE SAILMAKERS INC HUNTINGTON FARMS INC ON THE GO CUISINE
1346	BARELY NOTHING LINGERIE

NEW YORK AVE 2003 (Cont'd)

1351	BLOCKBUSTER VIDEO MONTAGE BEAUTY SYSTEMS INC
1355	DAVID M SPURLING DAVID SPERLING LITTLE LUXURIESBY JL & B INC MOET LIMOUSINE SERVICE ROY ARANDA STAR MULTI CARE SERVICES INC TODD E HOUSLANGER ESQ
1359	HUNTINGTON COACH LLC OCCUPANT UNKNOWN
1380	JACOBSEN A L FUNERAL HOME INC VIRAG MADDEX DIRECTORS INC
1389	ANTHONY ACEVEDO BOB TETENMAN RAPID O MULTIPLE SVCES RICHARD HALL
1391	OCCUPANT UNKNOWN
1395	JUDITH C KING TAX SERVICE
1399	DEPOT BARBR SHOP
1403	CHINA DELIGHT KITCHEN OCCUPANT UNKNOWN
1405	FLASH PHOTO OCCUPANT UNKNOWN
1415	COMPREVE MINI MARKET OCCUPANT UNKNOWN
1419	ALCOLICOS ANONIMOS FRANCISCO REYES MELISSA RESTRNT O & W BEAUTY SALON INC
1425	HECTOR CORTES SOCIETY OF ST VINCENT DE PAUL
1429	ALEX ITALIAN/AMERICAN DELI LA GUADALUPANA INC
1430	DAIRY BARN STORES
1431	MARGARITA PEREZ
1433	LUIS RAMIREZ
1435	ANY KUT CARPET OCCUPANT UNKNOWN
1437	OCCUPANT UNKNOWN
1439	PETRA CORTES
1445	ANTHONY NOBERINI CASTLETON GARDENS REALTY INC EDUARDO E ALBORNOZ FARRELL JOSEPH E PC KAY JOHN ANDREW INSURANCE OCCASIONALLY YOURS INC VINCENT M ESPOSITO
1450	OCCUPANT UNKNOWN TRINITY REGIONAL SCHOOL

Target Street

Cross Street

Source

Cole Information Services

NEW YORK AVE 2003 (Cont'd)

1454	JIMENEZ DELI JUAN PEREZ
1455	WALSH & HUGHES INC
1457	FOUR WINDS BAIT & TACKLE
1460	JESICA ORTIZ
1466	IGNACIO TOTLHUA PATRICE KEEL
1475	JIMMYS TRAVEL SERVICE US AMERICAN INC

RAILROAD ST 2003

1	JULIO AVILA
2	HUNTINGTON COMMUNITY FIRST AID OCCUPANT UNKNOWN
5	JO DAN AUTOMOTIVE SPCLST JODAN AUTOMOBILE SPECIALIST
7	CARLOS RODRIGUEZ OCCUPANT UNKNOWN
9	FRANCISCO ALFARO JOSE ANDRADE OCCUPANT UNKNOWN
11	OCCUPANT UNKNOWN
12	MARKHAM COLLISION INC MARKHAM SPECIALTY PAINTING OCCUPANT UNKNOWN
13	JULIO AVILA MARIA FUENTES OCCUPANT UNKNOWN ROSA REYES
15	JOSE ORTIZ
16	ROBERT REDICK
17	BOYLE SERVICES INC CLIFFORD MOODY
19	K MCQUEEN RAYMOND WICKMAN
20	LIBERTY DOORWORKS INC METRO INTERIOR DISTRIBUTORS PRECISION INTERIORS CNSTRCTN RRA ASSOC WJ NORTHRIDGE CONSTRUCTION CORP
21	KAILA MCCOY
23	A GRANT
25	ANTONIO GOMEZ
27	ELIZABETH ROBINSON
29	DAN BENJAMIN
31	OCCUPANT UNKNOWN

NEW YORK AVE 1999

1000 RYDER TRUCK RENT ONE-WAY INCORPORATED NEIGHBORHOOD DEALERS
 TILDEN BRAKES
 1006 CHEZ MAGGY VARIETY STORE
 1014 CASTLE AUTO PARTS
 1024 ANNAS KITCHEN
 1036 PARTS PLUS PERFORMANCE DISCOUNT AUTO STORE
 1038 YANKEE PEDDLER ANTIQUES
 YANKEE PEDDLER ANTIQUES & WORKSHOP
 1044 CLARUS CLEANERS
 FREDDY LAUNDROMAT SERVICE
 JENNYS DELI
 MARIAS FAMOUS PIZZA CHICKEN & RIBS INCORPORATED
 TOWN DELI
 1078 OCCUPANT UNKNOWN
 1290 AMOCO GAS STATION
 U HAUL COMPANY
 ZAM PETROLEUM
 1291 IMPORTS CAR TECHNIK
 1297 JIFFY LUBE
 1320 FLOWERDALE LIMITED
 1326 MOWER SHOP
 1328 METROPOLITAN DEVELOPMENT GROUP INCORPORATED
 1335 HUNTINGTON PUBLIC LIBRARY STATION BRANCH
 HUNTINGTON STATION ENRICHMENT CENTER
 1342 FER JON REALTY CORPORATION
 1344 LAURA UNISEX
 NYDIAS TRAVEL
 1345 DOYLE SAILMAKERS INCORPORATED
 OCCUPANT UNKNOWN
 ROTHMAN MURRAY
 SHORE SAILS
 SHORE SAILS INCORPORATED
 STATEWIDE RECYCLING
 1346 BARELY NOTHING LINGERIE
 1355 ELECTRONIC TRADING SYSTEMS
 1357 PETES WOOD FLOOR & JANITORIAL SUPPLIES
 QUICK AUTO INSURANCE
 1359 INVIREX DEMOLITION INCORPORATED WAREHOUSE
 1380 COMSTOCK WALTER FUNRL DIRECTOR
 JACOBSEN A L FUNERAL HOME I
 1389 AGAPE BEAUTY SALON
 EL VANS BEAUTY EXPLOSION
 RAPID O MULTIPLE SVCES
 1395 ALL SECURITIES FSI
 LYNCH DANIEL E AGENCY REAL ESTATE
 1403 CHINA DELIGHT KITCHEN
 1405 FLASH PHOTO
 1415 EL TREBOL INCORPORATED
 1419 JULIAS INTERNATIONAL BEAUTY SALON
 1425 ST VINCENT DEPAUL SOC

NEW YORK AVE 1999 (Cont'd)

1429 ALEX AMERICAN ITALIAN DELICATESSEN
JOES DELCATESN

1433 ST VINCENT DEPAUL SOC

1435 ANY KUT CARPET

1445 BASTIBLE FRANCIS X ATTORNEY
CASTLETON GARDENS REALTY INCORPORATED
DIXON WILLIAM P INSURANCE
ESPOSITO VINCENT M ATTORNEY
FARRELL JOSEPH E PC ATTORNEY
IANNONE R CPA
JEBCO BUILDERS INCORPORATED
KAY JOHN ANDREW INSURANCE
MAHONEY PATRICK J ATTORNEY

1450 ST HUGHS BINGO
TOWN OF HUNTINGTON SENIOR CITIZEN SATELLITE
TRINITY REGIONAL SCHOOL

1455 TENNIS COURT EQUIPT & MATER
VELVETOP PRODUCTS
WALSH & HUGHES INCORPORATED

1457 FOUR WINDS BAIT & TACKLE
VALENTINE GEORGE TACKLE FISHING

1475 JIMMYS TRAVEL SVCE

RAILROAD ST 1999

- 4 COMMUNITY YOUTH CENTER HUNTINGTON STATION INCORPORATED
PEDERSON KRAG CENTER INCORPORATED COMMUNITY CENTER
- 5 JO DAN AUTOMOTIVE SPECIALIS
- 16 SUBURBAN MILLS
- 20 D C A
HI LUME CORPORATION
LIBERTY DOOR WORKS INCORPORATED
METRO INTERIOR DSTRBTRS
W J NORTHRIDGE CONSTRUCTION CORPORATION
X L CONTRACTING CORPORATION
- 21 OCCUPANT UNKNOWN
- 24 OCCUPANT UNKNOWN
- 25 ALBERTOS AUTO SVCE
- 31 OCCUPANT UNKNOWN

NEW YORK AVE 1995

2631

NP

100 RESIDENCE

9 BUSINESS

● NEW YORK AVE 11746
Huntington Sta PO

O	935-	1419	CT1109.02		\$B..C	2
E	936-	1418	CT1110.02		\$C..C	2
E	1420-	1650	CT1112.01		\$C..C	2
O	1421-	1649	CT1111		\$C..C	2
O	1651-	2199	CT1111		\$C..C	2
E	1652-	2198	CT1112.02		\$B..C	2
	2202-	2400	CT1120.01		\$B..D	2
●	HAGSTROM	NAP LOC	F4	2		
●	HAGSTROM	NAP LOC	G4	2		
904	915	921	925		NP	
934	★	M A Connell	Furl			427-1123
	★	Huntingtn	Furl Hm	93	⊙	427-1123
943	946	949			NP	
953	★	Econowash		92		351-2982
	★	Glén Cty	Chns Ktch	90		421-4560
	★	N Isl	Check Cashing	90		673-1055
	★	Value Exprss	Fd St	90		421-0089
	★	Western Union		-	⊙	673-1055
984	★	J E Harris	Auto Rp	86		673-6288
1000	★	Ryder	Truck Rental	-		385-7932
	★	Tilden	Brakes			423-0200
	★	Tilden	Car Care	91	⊙	423-0200
1006	★	1 2 3	Deal		⊙	427-2938
1014	★	Castle	Auto Parts	87		427-3033
1024		Christalyn	Boyd	-		271-2543
2		M Stephen		88		424-6375
	★	Annas	Kitchen	84		427-7782
1038	★	Better Hm	Furnitr	92		549-5880
	★	Yankee Antq	Wkshp	76		351-9578

NEW YORK AVE 1995

PAGE 006		COI
1236	* Yankee Pdr Art&Wk	76 271-5817
1244	Bolting	
	* Clara Cleaners	88 421-8777
	* Maria's Pizza Chick	85 351-1353
	* Station Laundromat	87 351-1886
	* Town Deli	12 421-4388
1255		NP
1272	Michael R Franz	88 385-7574
1280	S Teich	87 423-0106
1282	J Gordon	- 427-2180
1288	* Lee Carr	12 421-1780
1287		NP
1290	* Enka Petroleum	88 873-6426
	* Gasynex Corp of NY	89 548-4882
	* Triple G Serv Sta	89 427-8828
1291	* Suffolk Import Car	91 423-7448
1297	* Jilly Lube	89 423-8886
1300	* Shanley&Schwartz	91 351-8886
1320	* Flowerdale	423-8344
	* R P Spangler First	87 423-8344
1325	* Manor Auto Parts	87 427-3360
1328	* Dynetics Inc	78 873-5855
1335	* Long Island Rac Auto	86 385-2437
1342	* Far-Joe Rity Corp	86 427-4085
1344	Fabio Ruiz	31 873-8051
	Miguel Valacop	89 947-2620
	* Hydrex Travel	90 423-6861
1345	* C A Griffith&Co	33 427-1688
	* Garden City Proline	- 425-7398
	* C A Griffith Meats	87 427-1688
	* Huntington Farms	12 425-7398
	* Mtra Automotive Capt	71 385-8128
	* Ramondo Bros Ravi	89 385-4851
	* Shore Sails Inc	89 873-5855
	* Statewide Recycling	11 548-3484
1348	* Beverly Nothing	88 385-8321
1351	* Kings Public Libr	72 421-5853
1354		NP
1355	* Bakery Images Pstr	85 548-4144
1357	* Peter Wood Fly&Jet	83 548-5478
	* Quick Auto Insurec	82 873-7378
1358	* Intex Sewelition	88 873-8687
	* Intex Sewelition	88 421-1113
1360	Kevin DeLoest	33 421-1820
	* W Carstock Ferl Dr	91 423-2185
	* A L Jacobson Ferl	87 423-2185
1363	J Cocker	82 271-0380
	Tom Romano	82 873-4781
	* Music Int'l	12 271-8288
1385	* Lynch Apparel Assoc	88 427-1888
	* Daniel F Lynch ASC	88 427-8288
1389	V A Anderson	88 423-7630
	Anthony J Diario	92 421-4549
	* Depot Barber Shop	427-8744
14	* Huggs Assoc Gd	86 423-8222
1403	* China Delight Kuche	88 351-4586
1405	* Sheelin Kong-Fa	80 351-1556
1415	* El Yashal Mini Mkt	91 351-7889
1419	* Allied Fincl Svces	12 425-8488
	* Eastern Finance Inc	83 423-8888
	* Mother McGees	91 271-1888
1425	* Bruno Fashion	12 423-7342
	* F&S Bagels Plus	12 385-2851
1429	Angela Hernandez	12 423-2081
	Margarita Perez	12 547-1833
	* Joan Delcatese	423-5888
1431		NP
1433	* Hearty New Shop	73 271-8449
	* St Vincent De Paul	83 271-8449
1435	* Any-Kut Carpet	83 423-2588
1438	Luis Gonzalez	33 385-8188
1445	Anthony Naberis	84 548-4584
	* F X Bartible Aty	77 421-8811
	* W P Bross Inc	12 271-2255
	* V M Esposito Aty	85 271-7254
	* J E Farrell PC Aty	71 421-8444
	* R Iannone CPA	87 385-2818
	* Jobco Builders Inc	72 271-9482
	* John A Kay Inc	86 271-2358
	* P J Maloney Aty	83 421-8518
1458	* Bread of Life Inc	88 548-4813
	* Hunger Action Wker	88 424-8888
	* St Hugh's Hosp	83 427-2288
	* Two Huggers St Chr	91 385-1988
	* Trinity Day School	88 548-7458
1459		NP
	Rita Alvarez	12 423-0824
	Dora Cruz	93 271-4522
	* Pilsa Perterta Del	85 271-4888
1455	F Labiano	80 385-8414
	* Tennis Court	78 427-5884
	* Valentes Proctrs	88 427-5884
	* Walsh&Hughes Inc	78 427-5884
1457	* Four Winds Bail	14 421-1184
	* G Valentine Tail-Fa	74 421-1184
1460	Jose S Gonzalez	82 423-5848
	F A Percecloper	91 385-8888
1468	Jorge Bryant	12 427-9136
1475	Rafilo Arzoo	- 271-5848
	Gilberto Montes	91 385-8773
1480	Joana D Marroquin	12 427-9412
1484	* Bible Ledding	88 421-1518
	* Bible Michl V & Az	12 271-8155
	* Night Lights Inc	88 548-8843
1501	Manuel Acovedo	12 271-1483
	Luz Dida	83 385-8788
1507	* A Summerline Pool	- 271-10
	* Alrecon Courier Sv	87

RAILROAD ST 1995

● RAILROAD ST 11746	
Huntington Sta PO	
1- 98 CT1116.02	9C.C 2
● HAGSTROM MAP LOC F4	2
4★ County Yth Ctr Houst	82 673-8814
★ Haitian Com Assoc	82 427-2113
7 Ladillo Chavez	93 549-1082
Luis Fernandez	89 421-5752
9 Ralph Balobridge	82 424-0147
Dimas Benitez	82 424-7925
Arturo Campos	92 351-1049
Wilman Valencia	82 423-1517
11 Medardo J Flores	82 271-3256
Roman Mercado	93 271-3254
12★ Markham Collision	82 421-1888
13 Miguel Cartagena	92 424-3750
Dimas Hidalgo	93 271-1224
15 Natividad Oniz	82 549-7619
William Reyes	93 271-0235
17	NP
19 Elizabeth Curtis	82 673-8847
20★ B C A	82 421-8835
★ W J Northridge Const	98 421-1168
23 A Grant	91 549-5309
25 Francisco Morales	92 424-1032
Jose Rodriguez	93 421-1303
Anita Sanchez	92 673-5205
★ Albertas Auto Sv	89 424-8838
29 Dan Benjamin	82 427-9238
33 John Proves	82 271-8799
35 Caren Jacobs	93 826-8141
Joffyn M Newton	93 424-8566
Andrew D Turner	93 385-3953
39 Leonard Blagman	91 427-3165
Prince Ireland	93 424-2505
Alexander Samuels	82 424-2855
43 Daniel Nema	82 271-2043
44★ C R Hamilton Inc	93 351-4500
★ C R Hamilton Corp	85 351-4500
45	NP
47 Darlene Washington	91 673-0901
See Yates	92 351-4513
55 A Chellan	79 549-5389
63 Frank Falcone	73 271-0335
65 John T Brown	89 271-2734
67 Angela Avitable	66 427-5517
71	NP
73 C Hoffmann	92 427-8476
83 Hoffmann	80 423-6562
85	NP
85★ D Holman	77 549-3827
★ Pipeline Oil Co	85 427-3388
★ Suffolk Kerosene	427-8668
100★ S&S Auto Wrecking	71 423-2735
104	NP
105 James C Holins	93 547-1516
106 M Comore	82 427-8432
Louise Placide	92 427-0257
111 C P Johnson	90 427-7642
Caroline Johnson	92 427-5644
Robert Vargas	91 385-2072
114★ Metro Fleet Svc	92 385-7876
120 Erikus Goodron	93 549-7548
Nancy Meyer	92 427-7581
132★ BCI	81 271-7321
★ Bills Catering Inc	76 271-7321
134★ Normans Auto Svc	82 421-5738
136★ Utz Entropy&Detail	82 424-8667
138★ E Coast Classic Cars	88 549-4838
141 B E Dening	91 549-7058
145	NP
146★ Azjack Precan Prod	423-7555
152 Rick Hawkins	92 427-4066
Dominick Nicoletti	91 385-7241
★ Manor Fuel Co	423-8758
154★ Agostino&Sons Inc	83 351-4949
★ V&A Ready Mix	91 351-4949
★ V&A Ready Mix Inc	93 351-4949
159★ Huntington Freedom	73 421-5858
165 Paul Betts	82 385-7833
Mark Green	82 271-6904
168★ Atlas Cable Tray	92 423-8711
★ Audio Agency	93 423-3246
★ Diamond Exteriors	82 423-8572
★ Diamond Blinds/Corp	76 423-4788
★ Diamond Dry Clean	92 271-8888
185★ Urban-De Motors	92 427-3241
NO ★ Berleth/DINCHERY	81 423-1818
54 RESERVES	30 BUSINESS

● RAILROAD TRCK RD W 11743	
New Street-1990	
Huntington PO	
NO ★ Bedrock Blacktop	90 757-5511

NEW YORK AVE 1990

	97 RESIDENCE	647 BUSINESS
	NEW YORK AVE 11746	
	<i>Huntington Sta PO</i>	
E	900-1024	CT1110.02 \$C..C 2
O	901-1377	CT1109.02 \$C..C 2
E	1026-1378	CT1110.02 \$C..C 2
O	1379-1451	CT1109.02 \$C..C 2
E	1380-1452	CT1112.01 \$C..C 2
O	1453-1649	CT1111 \$C..C 2
	1380-1632	CT1112.01 \$C..C 2
E	1454-1650	CT1112.01 \$C..C 2
E	1634-2098	CT1112.01 \$C..C 2
O	1651-2099	CT1111 \$C..C 2
	1633-2198	CT1112.02 \$B..C 2
	2100-2199	CT1112.02 \$B..C 2
	2200-2400	CT1120.01 \$B..D 2
	2200-2399	CT1120.01 \$B..D 2
	● HAGSTROM MAP LOC F4	2
	● HAGSTROM MAP LOC G4	2
	904 915 921 925	NP
	934★ M A Connell Funl	427-1123
	★ Huntingtn Funl Hm	○ 427-1123
	943 946 949	NP
	984★ J E Harris Auto Rp	.86 673-6288
	★ J E Harris Auto Rp	.86 351-9138
	1000★ Ntnl Car Rntl Sys	.88 427-1977
	★ Tilden Brakes	692-6475
	★ Tilden Car Care Ct	423-0200
	1006 C Henry	424-6385
	Chris Larson	424-5818
	Frederick McGee	385-8728
	★ Little Old Sign SH	.80 271-7933
	1014★ Castle Auto Parts	.87 427-3033
	1024★ Annas Kitchen	.84 427-7782
	Mary Lee	549-6917
	P Lynch	673-5411
	M Stephen	424-6375
	1026★ Tasman's Glass Shop	427-2900
	1036★ Parts Plus Dscnt	.86 673-0044
	1038★ Atlantique	.87 385-1778
	★ P&B Bazaar Inc	.78 427-9292
	★ Yankee Antq Wrkshp	.76 351-9578
	★ Yankee Peddlr Antq	.76 271-5817
	1044★ Station Clnrs Hatg	.88 421-0777
	★ Station Laundromat	.87 351-1866
	★ Town Deli	.84 423-0773
	C★ Maria's Pizza Chick	.85 351-1353
	1065	NP
	1078 Michael R Franz	.88 385-7524

NOT TO BE REPRODUCED OR PHOTOGRAPHED IN ANY MANNER WHATSOEVER EXCEPT BY THE PUBLISHER
 - Business Listing © — Duplicate Phone Number At This Office

NEW YORK AVE 1990

NEW YORK AVE			
00	1090 S Teich	87	423-0106
01	1262★ Johns Stereo Sta	81	424-3344
08	1268★ Beazer Pub 32 Ltd	77	351-8867
08	1287 A	NP	
08	1290★ Enka Petroleum	88	549-4682
18	★ Triple G Serv Sta	81	427-8038
22	1291★ M S Suffix Imp Car	83	423-7469
22	1297★ Jilly Lube	88	423-8004
84	1320★ Flowerdale		423-8244
88	★ R P Spangler First	81	423-8244
88	1326★ Manor Auto Parts	87	427-3300
29	★ NAPA Auto Parts	87	427-3300
86	1328★ American Power Industr	81	423-8041
88	★ American Power Ind	83	673-5886
28	★ Dynamics Inc	78	673-5856
88	★ Luch Rare Coins	88	673-7558
88	1335★ Sir Speedy Printing	86	427-6266
86	1342 T Arnold	85	385-0626
86	★ Fer-Jon Rlty Corp	85	427-4885
89	Randays Supermad	85	351-8752
89	1344 Ismael Fricano	88	673-4183
27	Tereciet Perez	81	673-7935
89	Miguel Velazquez	81	547-0820
11	1346★ Classic Carpentry	87	351-1852
89	★ E Coast Paving Ccp	88	673-1863
89	★ Rotonda Bros Ravi	81	385-4651
28	★ Shore Sails Inc		673-5856
35	★ Sunrise Golf		427-4448
88	★ Sunrise Golf Outf	81	427-4448
34	1348★ Barely Nothing	88	385-8321
82	1351★ Hughs Public Libry	72	421-5853
18	1354	NP	
28	1355★ Brlwy Images Phgr	85	549-4144
87	★ Floyd	81	351-8575
36	★ Refkar Inc	87	549-1385
85	★ J A Schluter Assoc	85	549-8995
88	1357★ American Luch Rpt	76	549-5444
88	★ Rapaport Bros AFL	75	549-5444
54	1359★ Invorex Demolition	88	673-0887
88	★ Invorex Demolition	88	421-1113
54	1380 Edward Ellis	88	421-1323
73	★ A L Jacobson Enrl		423-2185
73	1388★ No Shor Printing	79	423-2887
81	Laura Oliver	88	673-7942
88	Carlos Orfano		385-9378
88	Allen Powell	86	549-4062
82	Tam Romano	82	673-4781
21	1395★ Lynch Appraisal Sv	86	427-1888
38	★ Daniel E Lynch AGC	86	427-8288
88	D Senobal	88	424-5888
82	1399 V A Anderson	86	423-7630
82	★ Depot Barber Shop		427-8744
82	J Montecovata	88	424-3796
84	1402★ China Delight Kchn	88	351-4586
88	1405★ Hughts Replics	81	385-1588
88	1415★ Radics Ltd	87	385-8688
87	1415★ Joel Craig Prodcn	81	424-7288
33	★ Nickys of Hughts	88	271-1688
97	1425★ Pierpont Pet&Wippr		423-2222
22	1429★ Joes Delicatessen		423-8888
22	Jacqueline Worrell	88	549-9588
48	1431	NP	
48	1432★ Neerly New Shop	73	271-9448
38	1435★ Any-Rot Carpet	83	423-2588
18	1445★ F X Bastible Art	77	421-4611
82	★ Conservative Prty	88	271-2358
38	★ V M Esposito Art	85	271-7254
82	★ J E Farrell PC Art	71	421-8444
79	Domenic Iannone	87	385-7282
88	★ R Iannone CPA	87	385-2818
88	★ Jcbca Builders Inc	72	271-9482
88	★ John A Kay Ins	86	271-2358
78	★ P J Mahoney Art	83	421-8518
28	Anthony Nuberini	84	549-4584
88	★ Save-All	86	427-4686
89	1450★ Bread of Life Inn	88	549-4613
18	★ St Hughs Brngs	83	427-2289
88	★ St Hughs School	88	549-7458
18	1454 Theodora Aviles	88	424-8715
82	Joaquin Echevarria	81	421-8227
39	★ Phils Prthse Deli	85	271-4858
86	1455★ Lauries Repair	81	549-8471
35	★ R Meade Electric	81	549-8842
38	R Monello	87	673-5835
82	★ Tennis Court	78	427-5894
8	★ Velvetop Sealer	88	427-5894
8	★ Walsh/Hughes Inc	79	427-5894
6	1457★ Four Winds Bait	74	421-1184
2	★ G Valentine Tki-Fs	74	421-1184
2	1460 Jose S Gonzalez	82	423-5848
2	Isabel Reyes		673-7253
2	1466 Teodora Aviles	85	271-1065

RAILROAD ST 1990

	105	Wolfgang Holik82	704-2420
		30 RESIDENCE	5	BUSINESS
		RAILROAD ST		11746
		<i>Huntington Sta PD</i>		
		1- 199 CT1111		4C..C 2
8		● HAGSTROM MAP LOC F4	2	
0		4★ Cmnty Yth Ctr Hunt	.82	673-0614
7		★ Family Svce League	.87	673-0539
3		7 Luis Fernandez	π	421-5752
5		Jose Rodriguez	π	424-8710
3		9★ Grand Manor Constr	.82	271-7777
4		Felix Rodriguez	o/	385-1646
9		12★ Century Collision		421-1008
5		13 Hector Villanueva86	385-9751
1		B I Costacamps88	424-9227
2		15 E Montanez88	424-6142
7		Jose Ortiz87	549-7840
2		17 Ellen OHara88	424-8850
0		19 Anthony Lamberti87	385-8884
0		25★ Albertos Auto Sv		424-4515
8		Alberto Lopez	π	424-2541
7		29 Dan Benjamin77	421-4028
2		35 P Harms	π	351-5776
7		Caren Jacobs	π	385-9799
2		Douglas Ury88	271-4013
6		39 Cathy OMalley82	427-3753
7		43 Bob A Jasinkonis83	549-6657
9		44★ C R Hamilton Corp	.85	351-4500
8		45 Palmira Edwards	π	673-9031
5		47 Thomas Grimes	π	385-8419
8		55 A Challan79	549-5369
4		63 Frank Falcone73	271-0335
9		65 John T Brown69	271-2734
6		67 Angelo Avitabile66	427-5517
4		69 A Mele85	427-2702
5		71 Euranía Vento	π	673-0240
5		73 C Hoffmann80	423-8552
8		83★ Bdh Fuel	π	549-0250
4		Frank Pascarelli87	549-4908
3		85★ Pipeline Oil Co85	427-3388
5		100★ S&S Auto Wrecking	.71	423-2735
7		104	NP	
7		106★ Bros Anderson88	424-9832
5		Jean Dalance88	421-5524
4		P Jean-Baptiste84	549-1156
8		Sherly Pierre	π	424-0103
1		114★ Extra Fleet Svce81	673-3737
3		★ Kraftig Corp	π	549-8588
		120 Michael Cain88	673-6942
		D ★ Combination Auto	π	673-9692
		132★ Bills Catering Inc75	271-7321
		136★ BCI81	271-7321
		138★ Berlinetta Motorcr81	423-1810
		★ E Coast Clssc Cars88	549-4839
8		141 Cornelius Boyle	π	424-8823

NOT REPRODUCED OR PHOTOGRAPHED IN ANY MANNER WHATSOEVER
 - Business Listing - Duplicate Phone # -

NEW YORK AVE 1985

Address	Business Name	Phone Number
1000	Ticker Car Care Ct	423-6296
1000	G Allen	673-5256
1000	S Holmes	423-4461
1000	Parsons Kelson	673-3395
1000	Little Old Sign SH	271-7933
1024	Anna's Kitchen	427-7782
1024	Mary Lee	549-5517
1028	Teenage Glass Shop	427-2900
1038	Anthony Dent Car	673-6044
1038	Joseph G Anderson	421-9182
1038	P&S Beaser Inc	427-8292
1038	Parsonics Clock	423-8086
1038	M G Terashita	427-8292
1038	Yankee Arts Wkshp	361-9576
1038	Yankee Paddle Arts	271-5817
1044	Station Landronet	361-1886
1044	Tobacco Plus Inc	549-2026
1044	Town Deli	423-6773
1044	C Dames Pizza Chkn	361-1363
1063	David Cope	673-7525
1078	Dr Samuel Tetch	423-6294
1262	Birdie Golf Ltd	427-4468
1264	Bacon Pub 32 Ltd	351-8867
1311	A	
1329	Triple G Serv Sta	427-8038
1329	M S Smith Imp Car	423-7489
1329	Jiffy Lube	423-6006
1329	Flowerdale	423-0244
1329	R P Spangler First	423-0244
1329	Joseph Cantor Glas	421-0300
1329	M Cantor Glas Corp	421-0300
1329	Coertse	351-8130
1329	Fabulous Jules	423-6641
1329	American Power Ind	673-5885
1333	Carnival Ice Cms	423-6252
1333	Aerobic Body Shop	673-1814
1337	Ryde Motorcycles	673-2893
1338	Donatice Inc	673-5665
1342	Zalles Beauty Shn	423-9205
1344	Marcelo M Hair	423-0330
1344	The Perfect Fit	361-1219
1344	M Velasquez	673-6183
1345	Crutcher Tights Inc	673-2789
1345	U 1st Specialty	351-4734
1345	Miss 88 City Co	423-6282
1345	Hopkins Sportsw	662-0388
1346	Barely Nothing	421-4002
1351	Hughes Public Liby	421-5663
1354	Nessee 87th City	549-8898
1357	Amazon Lndr Sport	549-5444
1357	Rapport Bros Art	549-5444
1359	D Epilo Corp	673-6712
1359	Invics Demolition	673-6663
1359	Invics Demolition	423-1113
1390	A L Jackson Print	423-2188
1393	I & B Fuller Printing	423-2667
1393	Knockout Ass Printg	423-2667
1393	Laura Oliver	673-7942
1393	Petes Liquors Inc	423-0192
1393	Tom Romano	673-4781
1393	L J Seide Wine/Lor	423-0192
1393	L E Schreiber	423-2188
1393	No Shore Laundry	421-5141
1393	L E Schreiber	427-0344
1399	Deport Barber Shop	423-8289
1415	Harrington Paper Co	423-8289
1418	Frank P Saman	673-3730
1425	Pierpont Post & Wcar	425-2223
1425	John Delcasteann	423-5989
1431	Paul Chasin	421-9343
1431	Huo Park Kwok	271-6297
1433	Neely New Shop	271-9449
1435	Any-Kut Carpet	423-2589
1435	Tony Mcc	427-8799
1443	P X Bartok Art	421-4811
1443	S Brudmoby Art	423-1330
1443	J F Russell PC Art	427-9444
1443	John Sullivan Inc	271-9402
1443	J E Larkin	692-9836
1443	Malcolm G Lowery	423-8339
1443	P J Mahoney Art	549-1122
1443	Anthony Noberti	549-4564
1443	C Salas & Sons Inc	271-1899
1450	St Hughes Stage	423-2389
1454	Opal S Arns	673-2853
1454	Phile Drie in Food	271-4088
1458	AAA&A TV Spec Inc	423-6707
1458	Albino Hm Design	421-8066
1458	Apple Spec Inc	423-8534
1458	Cont&Pat Acwing Sv	271-8324
1458	Express Gaspool	423-6885
1458	Otto G Feltig	427-8514
1458	Laurie Repair	549-8471
1458	S Meade Electric	549-8942
1458	See Peering	421-9467
1458	S C Springer Co	271-8186
1458	Tenna Court	423-9904
1458	Wolcott Sealer	427-9904
1458	Wilson Electric	423-8843
1458	Walsh & Hughes Inc	427-5904
1458	L Walsh	351-8153
1457	Four Winds Bar	421-1184
1457	G Valentine Thi-Pa	421-1184
1460	Jose S Gonzalez	673-3548
1460	Joel Ramirez	423-3548
1468	A Evans	271-9209
1468	S Melton	673-3038
1468	Herns Service	361-2948
1475	Dwain Hair Aid Co	423-3489
1480	Den Christensen	549-8175
1480	Do-It-Yourself Extern	423-5484
1480	Lorenson Johnson	673-4532
1480	News Post Control	549-8989
1480	M Sore	427-9020
1484	United Funding Inc	423-92

NEW YORK AVE 1980

Address	Business Name	Phone Number
1006	B A Arts	427-6223
	*Little Old Sign SH	271-7933
	*Sally Hicks	675-0861
1024	Mary Lee	427-1226
1025	*Tasman Glass Shop	427-2986
1030	*Automv Dent Cr	675-0644
1038	Joseph G Anderson	421-8132
	*P&B Bazaar Inc	427-8282
	*M G Tereolis	427-8282
	*The Bazaar	427-8282
	*Washing Place Ltd	271-6434
	*Yankee Antq Wrshp	425-9578
	*Yankee Peddr Antq	271-6817
1065		NP
1076	Randy Gilbert	427-3475
1090	*Dr Samuel Teich	425-0284
1256	*Booser Pub 32 Ltd	425-8687
1257A		NP
1286	*Econo-Car	427-3122
	*Triple G Serv Bld	427-8828
1320	*Flowerdsh	425-0244
	*R P Sponger Print	425-0244
1328	*Joseph Cantor Glas	421-0500
	*M Cantor Glas Corp	421-0500
	*Cantors	421-0500
	*Fabulous Jules	425-8284
1333	*Carnival Ice Cnt	425-3252
1335	*Ranger Radio	427-4966
1337	*Sound Investment	427-0228
1338	*Dynamics Inc	675-8855
1342	*Zeller Beauty Sh	425-8205
1344	*Wanda Boutique	425-8471
1345	*All Appliance Part	427-4990
	*M&M Mtg Co	425-8282
	*Rogene Sportsw	582-5555
1346	*Barly Nothing	421-4002
1351	*Wright Public Libry	421-0543
1354		NP
1357	*Amer Lnth Repart	548-5444
	*Repart Sinc	548-5444
1358	*Witraz Demolition	675-0067
	*Witraz Demolition	421-1113
1360	Raymond Chmpy	421-5245
	*A L Jacobson Ford	425-2156
1388	*Ear Fuller Printing	425-2887
	*Kavanagh Asc Printg	425-2887
	R Maggo	675-7105
	Laura Oliver	675-7942
	*Penas Uppers Inc	425-0180
	*L J Seidr WoodLar	425-0180
1393	*No Shore Laundry	425-2186
	E Scheiber	427-6141
1398	Charles Conkin	421-0883
	*Sagol Barber Shop	427-8744
1415	*Huntington Paper Co	425-8288
1419	*Flamettes Only RS	548-8070
	Marie Williamson	421-1623
1420	*Pierpont PhotWppr	425-2287
1425	Steven Brooks	675-0652
	*Joel Delcatessen	425-8882
1431	John W Thaler Jr	271-8374
1433	*Nearly New Shop	271-9448
1435	*Crest-A-Kitchen	271-9526
1438	*Toys 882	427-8760
1445	*AAAAA TV Svcs Inc	425-8787
	*F X Beathis Atty	421-4611
	*Brooksky&Shulman	427-1230
	*J E Farrell PC Atty	421-0444
	*Jebco Builders Inc	271-9482
	David A Masoni	79
	*S G Martin Atty	421-1211
	*F P McGowan Atty	427-8585
1450	*St Hughes Post Meal	427-2206
1454	*Phils Dns In Food	271-4655
1455	*Art Microwave Dns	271-2190
	*Appic Speck Inc	425-8554
	*Birchwood Towlpg	425-1236
	*CarolPat Answg Sv	271-8534
	*Chemical Group	548-5623
	*Curtis 1995 Inc	271-2296
	*Discount Oil	271-8830
	*Good&Stessk CPA	548-8238
	*Joseph E Hocker Jr	271-5110
	*Thomas Loria	548-8471
	*U Truck Tire Svcs	427-0284
	*Quality Copy Machs	425-1970
	*A C Spreng Co	271-8150
	*Suburban Lawn Svcs	548-8640
	*Tennis Court	427-8904
	*Velvetop Sealer	427-8904
	*Walsh-Hughes Inc	427-8904
1457	*Four Winds Bar	421-1184
	*G Valentine Tel-Fs	421-1184
1480	Robert K Creed R	421-4284
1488	*John P Kane Lwyr	423-4190
	D Sabal	75
1475	Calvin Kaiser	675-9533
	Dan Miller	548-8088
1480	H Breen	421-5766
	Lawrence Johnson	79
	M Gera	79
1484	Ramon Gonzalez	271-7886
1485	*Red Bank	421-4500
1501		NP
1507	Arthur J Szabo	79
1516	*A-1 Woodworking	271-8434
	*A-1 Woodworking	427-4775
1528	*St Calvary Church	425-8952
1521		NP
1532	Mrs Mary R Tieber	427-0735

NEW YORK AVE 1975

Address	Business Name	Phone Number
ND	**VERNERHERBS AUTO	HA1428
104	RESIDENCE	591 BUSINE
NEW YORK AVE		1171
HUNTINGTON STA P O		
901-	1369 T 1109	88..C 4
1360-	2299 T 1112	8C..C 4
2300-	2532 T 112001	8C..C 5
2533-	2631 T 1119	8A..B 5
839-56	LIL CO	3486279
904		NP
915		NP
921		NP
925		NP
934**	A CONNELL FNRL	HA71123
	*HUNTINGN FUNRL HM	HA71123
943		NP
946		NP
949		NP
984**	HARRIS&SONS	4277156
995*	TOMS AUTO RAD SVCE	HA77331
1000*	TILDEN BRAKES	6926475
	*TILDEN CAR CARE CT	4230290
1001*	JOSEPH CANTOR GLSS	HA10300
	*CANTORS	HA10300
	*PARAMOUNTS HSE GLS	HA10300
1006*	SHAW'S BARBER SHOP	4238249
1024	D L BENNETT	4232689
	BRANDTS HSE OF BTY	423872
	MARY LEE	4271026
1026*	TASHANS GLASS SHOP	HA79900
1044*	FIESTA LAUNDROMAT	4239448
	A	NP
		NP
1065		NP
1090*	DR SAMUEL TEICH	HA31264
1209*	US AIR FORCE RECRY	4214039
1262*		NP
1266*	LEPERAS RESTAURANT	HA33399
	*LEPERAS TAVERN	4239867
1287*	F M CONCANNON	HA32450
	AGEORGE W GANZLE	9 4210018
1290*	ECONO-CAR INC	HA73123
	*TRIPLE G SERV STA	HA76038
1297*	CARVEL	HA36061
1320*	FLOWERDALE	HA30244
	*R P SPENGLER FLRST	HA30244
1326*	ATECH ENTERPRISES	4211444
1328*	HUNGTH YOUTH BOARD	2715497
	*MARINAIR INC	2715055
	*UMA INC	HA15866
1335*	PRECISION ELECTRNC	4276900
1342*	ZELLES BEAUTY SLN	4239205
1344*	MANDAS BOUTIQUE	4236471
1345*	HALL APPLIANCE PART	4274605
	*HEM MFG CO	HA36283
	*ROGGENE SPORTSWR	NY25858
1351*	HNGTN PUBLIC LIBRY	4219053
1354		NP
1380*	A L JACOBSEN FH	HA32185
	GEORGE PALLAS	HA74852
1389*	PANDA WINE&LIQDR	HA30192
	*L J SEIDE WINE&LOR	HA30192
1391*	HENRIETTAS EMPLOYM	5491049
	*LIL-DAN CLEANERS	4239426
1398*	NO SHORE LAUNDRY	HA32186
	L E SCHREIBER	0 HA76141
1399*	DEW CATERING	4239273
	*DEPOT BARBER SHOP	HA70744
	*EMPIRE CATERING	4270714
1402*	MANOR SERVICE STA	HA34623
1415*	HUNTINGTON PAPR CO	HA38299
1425*	PIERPONT PNTCNLPR	HA32222
1433*	NEARLY NEW SHOP	2719449
	MRS C L WALKER	9 2713712
1435*	JOES DELCATESSN	HA35980
1437*	KAVANAGH ASSOCS	HA32087
1439	V MCGEE	4 5491404
	*TONYS MKT	4278760
1445*	J P DEVITT ATTY	2710250
	*J E FARRELL ATTY	4210444
	*JEBCO BUILDERS INC	2719402
1450*	ST HUGHES CATH SCH	HA32949
1452*	ST HUGHES SPAN APST	2718986
1454	ELLIOT HONIG	4 4232942
1455*	TENNIS COURT	4275904
1457*	FOUR WINDS BAIT	4211184
	*GEORGE VALENTINE	4211184
1460	CHARLES BYRNE	HA76596
1466**	R CORSO RL EST	HA72334
	*G A HAHN RL EST	HA71
	*JOHN P KANE LWYR	HA34
1475*	CODING INS AGCY	4230
	*BOB LEVOW	4230
	*SABATINO AGNCY INS	4230

A
P
P
E
N
D
I
X

F


Appendix F
Site Photographs
Phase I ESA
Railroad Street and New York Avenue
Huntington, NY
Page 1 of 5



Date: 1/30/14

Location: Subject Property

Description: Typical view of parking lot

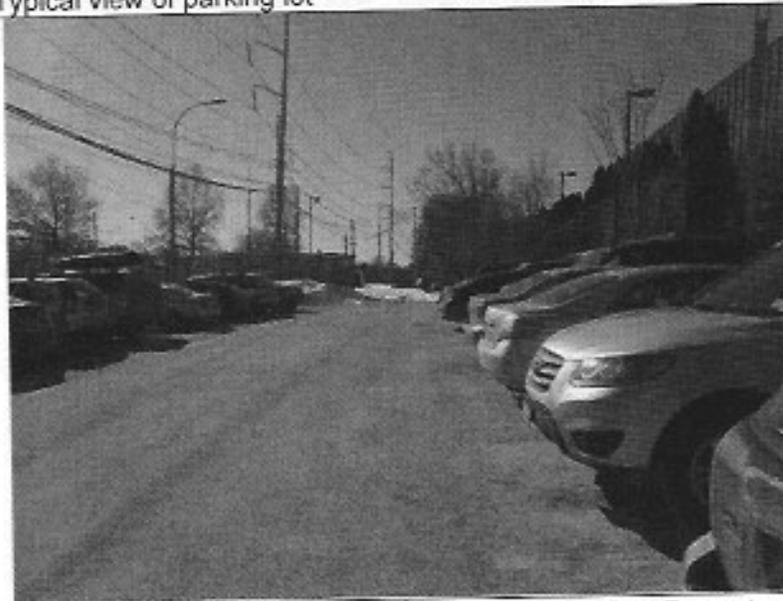


Date: 1/30/14

Location: Subject Property

Description: View of parking lot area adjacent to LIRR and Huntington First Aid Squad

Appendix F
Site Photographs
Phase I ESA
Railroad Street and New York Avenue
Huntington, NY
Page 2 of 5

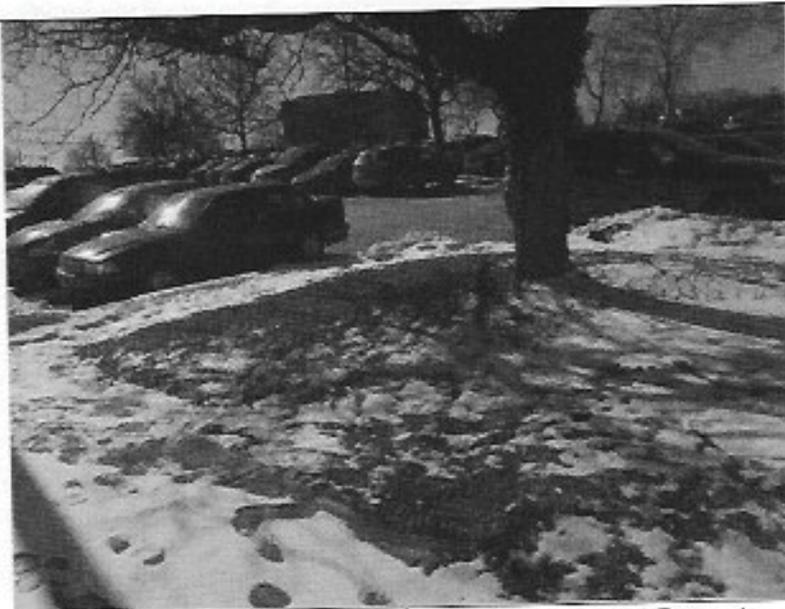

Date: 1/30/14

Location: Subject Property

Description: View of landscaped area with manhole, looking west



Date: 1/30/14

Location: Subject Property

Description: View of landscaped area with catch basin, looking south


Appendix F
Site Photographs
Phase I ESA
Railroad Street and New York Avenue
Huntington, NY
Page 3 of 5



Date: 1/30/14

Location: Western Adjoining Property

Description: View of First Aid Squad Facility

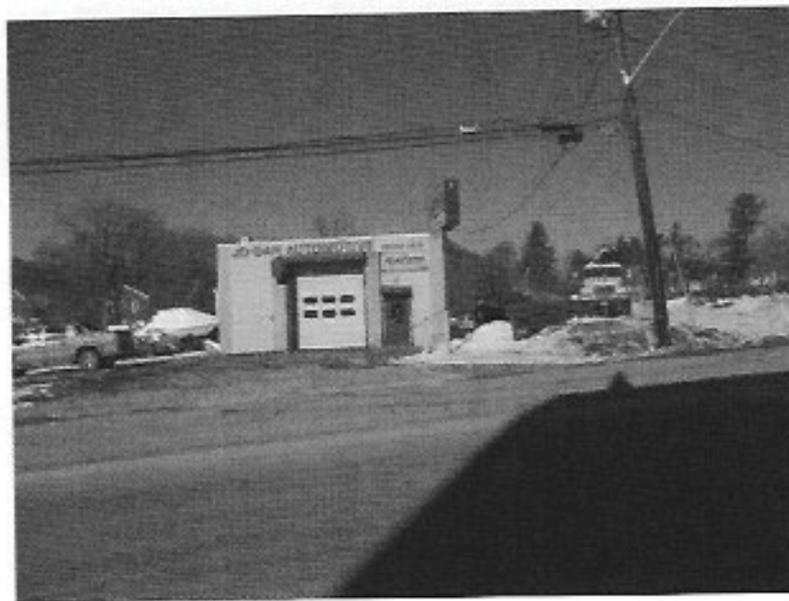


Date: 1/30/14

Location: Railroad Avenue

Description: View of northern adjoining properties


Appendix F
Site Photographs
Phase I ESA
Railroad Street and New York Avenue
Huntington, NY
Page 4 of 5

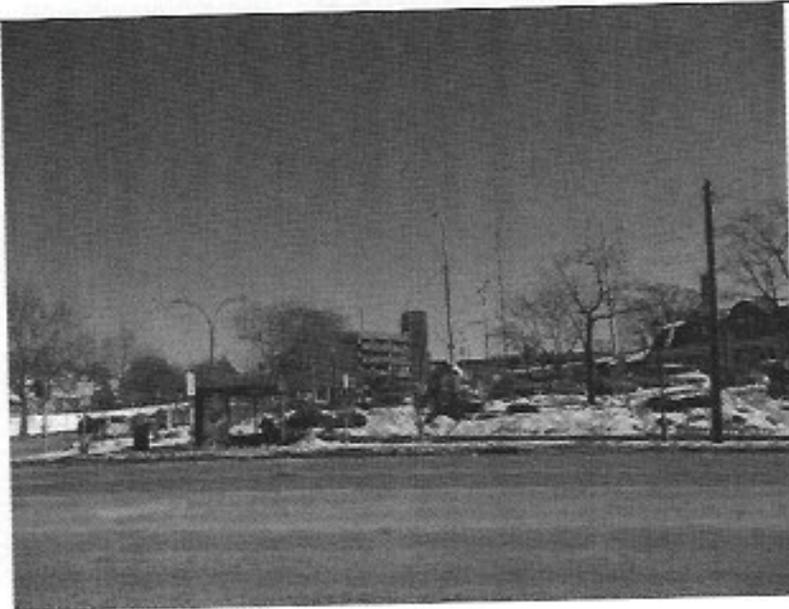

Date: 1/30/14

Location: LIRR Huntington Station

Description: View of Huntington Station and associated garage, looking east from NY Ave.

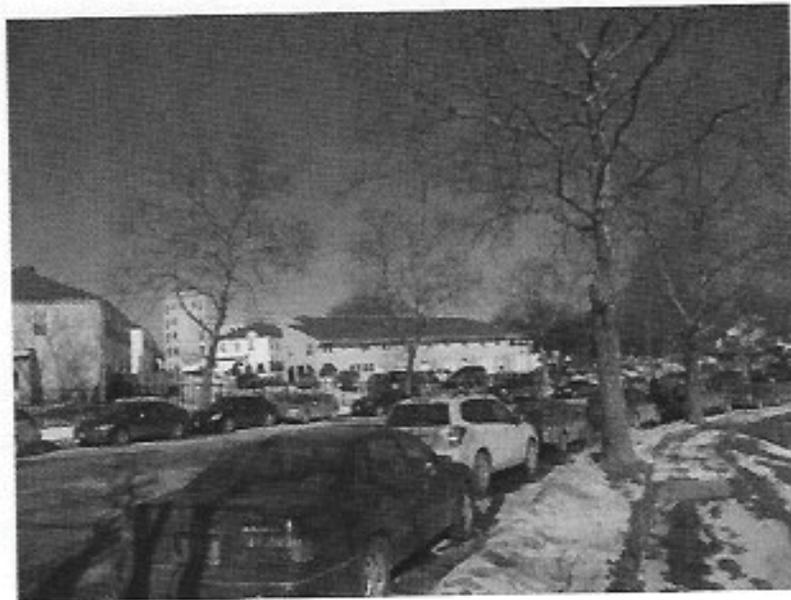


Date: 1/30/14

Location: Railroad Avenue

Description: View of housing to the north of the subject property

Appendix F
Site Photographs
Phase I ESA
Railroad Street and New York Avenue
Huntington, NY
Page 5 of 5

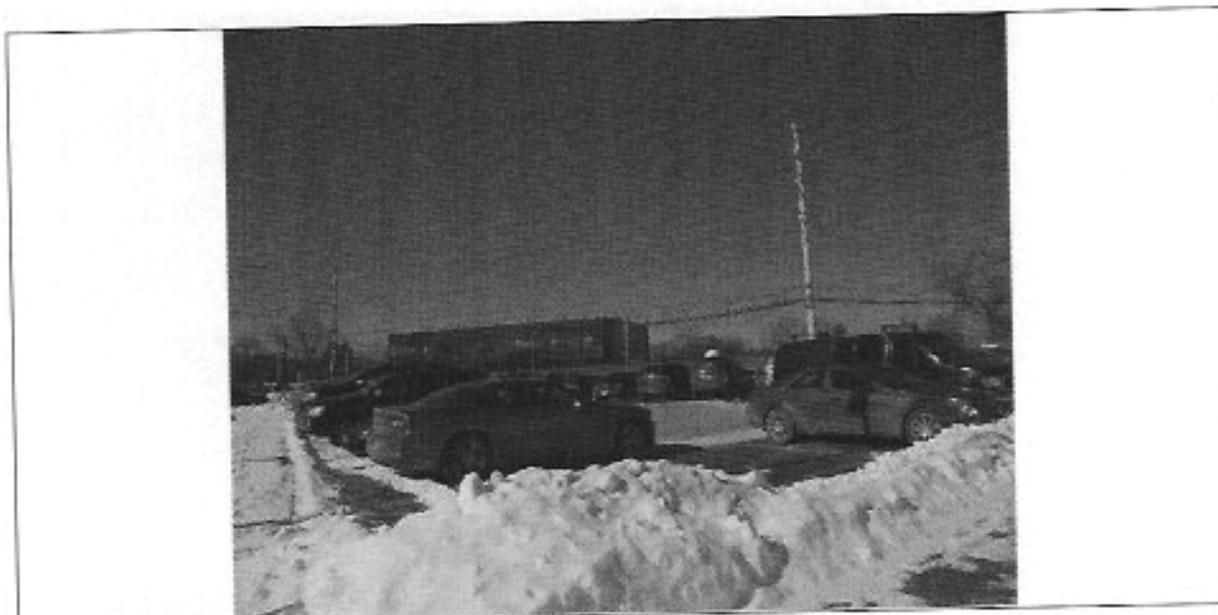

Date: 1/30/14

Location: New York Avenue

Description: View of southern adjacent property, looking north east across railroad tracks

A
P
P
E
N
D
I
X

G

